

Spectralink IP-DECT Server 200  
Spectralink IP-DECT Server 400  
Spectralink IP-DECT Server 6500  
Spectralink VIP-DECT Server One  
Spectralink IP-DECT Base Station  
Spectralink IP-DECT Media Resource  
Spectralink VIP-DECT Media Resource One

## Release Notes

Firmware Version PCS25Ac

# Table of Contents

<b>Revision History.....</b>	<b>3</b>
<b>Introduction .....</b>	<b>7</b>
Release .....	7
Important Notes.....	7
System Requirements.....	7
Distribution Files.....	8
<b>Changes.....</b>	<b>9</b>
Version PCS25Ac – R1.2 2025.....	9
Version PCS25Ab – R1.1 2025.....	9
Version PCS25Aa – R1 2025.....	10
Version PCS24Dc – R4.1 2024.....	11
Version PCS24Db – R4 2024.....	12
Version PCS24Ca – R3 2024.....	12
Version PCS24Ba – R2 2024.....	13
Version PCS24Ae – R1.4 2024.....	15
Version PCS24Ad – R1.3 2024.....	15
Version PCS24Ac – R1.2 2024.....	15
Version PCS24Aa – R1 2024.....	16
Version PCS23Be – R2.4 2023.....	16
Version PCS23Bd – R2.3 2023.....	16
Version PCS23Bc – R2.2 2023.....	17
Version PCS23Bb – R2.1 2023.....	17
Version PCS23Ba – R2 2023.....	17
Version PCS23Ab – R1.1 2023.....	20
Version PCS23Aa – R1 2023.....	20
Version PCS22Cb – R3 2022.....	21
Version PCS22Bb – R2 2022.....	23
Version PCS22Ab.....	24
Version PCS22Aa – R1 2022.....	25
Version PCS21Cb – R3 2021.....	27
Version PCS21Bd.....	28
Version PCS21Bc – R2 2021.....	29
Version PCS21Am.....	30
Version PCS21Ak – R1 2021.....	30
Version PCS21Ah.....	31
Version PCS20Dj.....	33
Version PCS20Dh.....	33
Version PCS20Dd – R3 2020.....	34
Version PCS20Bb – R2 2020.....	38
Version PCS20Ae – R1 2020.....	40

Version PCS19Cd.....	42
Version PCS19Cc – R3 2019.....	42
Version PCS19Be.....	49
Version PCS19Bc – R2 2019.....	49
Version PCS19Ac – Q1 2019.....	50
Version PCS19Ab.....	51
Version PCS18Je.....	52
Version PCS18Jd .....	52
Version PCS18Jc – Q4, 2018 .....	52
Version PCS18Gb.....	55
Version PCS18Ga.....	55
Version PCS18Fa – Q3, 2018.....	55
Version PCS18Ea .....	56
Version PCS18Da.....	59
Version PCS18Ca.....	59
Version PCS18Ba – Q2, 2018.....	59
Version PCS18Aa – Q1, 2018.....	61
Version PCS17Ea – Q4, 2017 .....	63
Version PCS17Da.....	64
Version PCS17Ca – Q3, 2017.....	65
Version PCS17Ba – Q2, 2017.....	65
Version PCS17A – Q1, 2017 .....	69
Version PCS16F_ – Q4, 2016.....	70
Version PCS16E_.....	72
Version PCS16D_ – Q3, 2016.....	72
Version PCS16C_ - May, 2016 .....	73
Version PCS16B_ – Q2, 2016.....	73
Version PCS16A_ – Q2, 2016.....	74
Version PCS16__ – Q1, 2016 .....	75
Version PCS15D_ – Q4, 2015.....	78
Version PCS15C_ – Q3, 2015.....	83
Version PCS15B_ – Q2, 2015.....	87
Version PCS15A_ – Q2, 2015.....	87
Version PCS15__ – Q1, 2015 .....	92
Version PCS14C_ – Q4, 2014.....	99
Version PCS14B_ – Q3, 2014.....	104
Version PCS14A_ – Q2, 2014.....	109
Version PCS14__ – Q1, 2014 .....	115
Version PCS13F_ – Q4, 2013.....	119
Version PCS13Eb.....	124
Version PCS13E_ – Q3, 2013.....	125
Version PCS13B_ – Q2, 2013.....	129
Version PCS13__.....	132

# Revision History

<i>Date</i>	<i>Description</i>
2013-03-11	Release notes for PCS13B_
2013-06-11	Release notes for PCS13E_
2013-09-24	Release notes for PCS13F_.
2013-12-16	Release notes for PCS14__
2014-03-24	Release notes for PCS14A_
2014-06-20	Release notes for PCS14B_
2014-09-18	Release notes for PCS14C_
2014-12-11	Release notes for PCS15__
2015-03-20	Release notes for PCS15A_
2015-05-06	Release notes for PCS15B_
2015-06-09	Release notes for PCS15C_
2015-09-21	Release notes for PCS15D_
2015-11-20	Release notes for PCS16__
2016-03-15	Release notes for PCS16A_
2016-04-20	Release notes for PCS16B_
2016-05-17	Release notes for PCS16C_
2016-06-17	Release notes for PCS16D_
2016-09-13	Release notes for PCS16F_
2016-12-12	Release notes for PCS17A
2017-04-04	Release notes for PCS17Ba
2017-06-29	Release notes for PCS17Ca
2017-09-12	Release notes for PCS17Da

<i>Date</i>	<i>Description</i>
2017-09-12	Release notes for PCS17Ea
2017-12-21	Release notes for PCS18Aa
2018-04-13	Release notes for PCS18Ba
2018-06-07	Release notes for PCS18Ca
2018-07-20	Release notes for PCS18Ea
2018-09-20	Release notes for PCS18Fa
2018-10-22	Release notes for PCS18Ga
2018-11-26	Release notes for PCS18Gb
2019-01-04	Release notes for PCS18Jc
2019-01-15	Release notes for PCS18Jd
2019-01-17	Release notes for PCS18Je
2019-02-07	Release notes for PCS19Ab
2019-03-25	Release notes for PCS19Ac
2019-06-01	Release notes for PCS19Bb
2019-06-25	Release notes for PCS19Be
2019-11-05	Release notes for PCS19Cc
2019-12-06	Release notes for PCS19Cd
2020-02-10	Release notes for PCS20Ae2
2020-05-18	Release notes for PCS20Bb
2020-09-22	Release notes for PCS20Dd
2020-11-30	Release notes for PCS20Dh
2021-02-26	Release notes for PCS20Dj
2021-04-15	Release notes for PCS21Ah

<i>Date</i>	<i>Description</i>
2021-05-19	Release notes for PCS21Ak
2021-08-17	Release notes for PCS21Bc
2021-11-01	Release notes for PCS21Cb
2022-04-01	Release notes for PCS22Aa
2022-05-01	Release notes for PCS22Ab
2022-08-22	Release notes for PCS22Bb
2022-12-07	Release notes for PCS22Cb
2023-03-30	Release notes for PCS23Aa
2023-05-26	Release notes for PCS23Ab
2023-09-06	Release notes for PCS23Ba
2023-10-24	Release notes for PCS23Bb
2023-11-03	Release notes for PCS23Bc
2023-11-14	Release notes for PCS23Bd
2023-11-17	Release notes for PCS23Be
2024-01-04	Release notes for PCS24Aa
2024-01-17	Release notes for PCS24Ac
2024-02-13	Release notes for PCS24Ad
2024-04-24	Release notes for PCS24Ae
2024-05-22	Release notes for PCS24Ba
2024-09-23	Release notes for PCS24Ca
2024-11-06	Release notes for PCS24Db
2024-12-05	Release notes for PCS24Dc
2025-03-19	Release notes for PCS25Aa

<i>Date</i>	<i>Description</i>
2025-05-28	Release notes for PCS25Ab
2025-06-23	Release notes for PCS25Ac

# Introduction

## Release

The products in the Spectralink IP-DECT portfolio are based on the same software platform. These release notes include information about software updates and corrections for the following products:

- Spectralink IP-DECT Server 200
- Spectralink IP-DECT Server 400
- Spectralink IP-DECT Server 6500
- Spectralink VIP-DECT Server One
- Spectralink IP-DECT Base Station
- Spectralink IP-DECT Media Resource
- Spectralink VIP-DECT Media Resource One

## Important Notes

Some features require specific versions of the firmware loaded into the base stations or media resources.

## System Requirements

### Hardware

<i>Hardware Platform</i>	<i>Description</i>
KWS6500 HW PCS 01__ or newer	KWS6500 Server
Media Resource 6500 HW PCS 01__ or newer	Media Resource 6500
KWS400 HW PCS 09__ or newer	KWS400 Server
IP-DECT Base Station HW PCS 09__ or newer	IP-DECT Base Station



## Software

The IP-DECT Server communicates with media resources and base stations using a version-controlled communication protocol.

When an IP-DECT Server is updated with new firmware, this might introduce a new version of the communication protocol towards either media resource or base station.

To minimize downtime when an IP-DECT Server, media resources and base stations are updated with new firmware, the following approach is recommended.

Update all infrastructure units: base stations, media resources, and IP-DECT Server to new firmware before rebooting any of these. The new firmware and, thus, the new protocol will not be active until the unit has been rebooted. When the firmware update of all units is successful, reboot the system in the following order: Base stations first, then media resources, and finally, the IP-DECT Server.

The reason for this recommendation is that the base stations and the media resources can be rebooted from the IP-DECT Server, and this is much easier than logging into each unit manually. If the IP-DECT Server is updated first, it might no longer be possible to control the base stations from the IP-DECT Server.

Often new firmware of, for example, the IP-DECT Server allows for - but does not require - an update of media resource and base station firmware.

The following table lists the firmware revisions of the IP-DECT Server that introduce new protocol versions and therefore require an update of base stations and media resources.

<i>IP-DECT Server Firmware</i>	<i>Media resource protocol</i>	<i>Base station protocol</i>	<i>Media resource Firmware</i>	<i>Base station Firmware</i>
PCS13E_	12	7	PCS13B_	PCS13E_
PCS13B_	12	6	PCS13B_	PCS13A_
PCS13__	11	6	PCS12D_	PCS13A_



### Note

It is not possible to upgrade software for the IP-DECT Server directly from PCS18Xx (or older) to PCS19Cc (or newer), due to increased software image size. The firmware must be upgraded in two steps:

1. PCS18Xx (or older) -> PCS19Ac
2. PCS19Ac -> PCS19Cc (or newer) [Software assurance license required]

## Distribution Files

Download the latest software at the [Spectralink Support Portal](#).

# Changes

## Version PCS25Ac - R1.2 2025

### Added or changed features

- Handset configuration (COTA XML File) over the air can now be forced to be sent/re-sent when the handset is restarted or if put in a charger. This is helpful, if you want to retain a certain handset configuration, even if users alter the setup of the handsets. This resolves DECTESC-1414.
- Logging TLS keys for package capture is now added for provisioning traffic to help troubleshoot on provisioning scenarios.

### Corrections

- Handset subscriptions were lost when updating an IP-DECT server from PCS23Ab to a newer version when DECT Encryption was enabled. Handset subscriptions are now retained after updating. Note, If the IP-DECT server firmware is downgraded from this release, the subscriptions will be lost, as the same issue is present as with upgrading. This resolves DECTESC-1416.

## Version PCS25Ab - R1.1 2025

### Added or changed features

- New Setting: You can now add a custom HTML browser title using the configuration html.title. This feature helps in identifying a specific IP-DECT server.
- New Setting: Messaging events initiated by the handset can now use the secondary username instead of the primary username. This can be achieved by enabling the "Prefer secondary username" setting found under Configuration > Wireless Server. This update resolves DECTESC-1408.
- Added Handset Models: Funktel ATEX models FC5 and FC11 can now be used with Microsoft Teams SIP Gateway.

### Corrections

- SUOTA Update: Retrying SUOTA for handsets that are out of range was causing unnecessary paging requests to be sent to all base stations for sites with more than 255 base stations. SUOTA is now no longer attempted for

handsets that are out of range and will instead be retried upon location registration. This is a partial fix for DECTESC-1395.

- Teams optimization: A missing MSF release from a handset could cause the Microsoft Teams onboarding process to stall. This resolves DECTESC-1402.
- Teams value, changed: The default SIP client transaction timeout is increased from 16000ms to 32000ms when configured for Microsoft Teams, in case of slow response time. This resolves DECTESC-1403.
- Cert update: Fix issue where some legacy certificates could not be loaded when the enable legacy TLS configuration was set. This resolves DECTESC-1404.
- Redundancy issue, database: Deleting devices could cause the device database to be out of sync in a redundant setup. This resolves DECTESC-1399.
- Cert enhancement: When changing the Host Certificate on a VIP-DECT Server One the internal Media Resource could not reconnect. This resolves DECTESC-1393.
- Interop challenge: The IP-DECT server goes offline when an outgoing call was initiated while the endpoint was awaiting a release to be completed. This issue is specific to Funktel handsets. This resolves DECTESC-1411.

## **Version PCS25Aa - R1 2025**

### **Added or changed features**

- Webhooks API is a new feature that allows the IP-DECT Server to send events to a Webhooks server. Events include an overall system status sent periodically or upon receiving a SIP Notify check sync event and several events for monitoring users and base stations. Please see Spectralink IP-DECT Portfolio/Webhooks API document for further information.
- Admin users have been re-designed to be set per username (or secondary username) instead of per handset. The feature has been significantly enhanced and can now receive alarms, such as when the alarm button is pressed, as well as system notifications, including alerts for all SIP proxies being offline or an emergency number being called. It also includes alarm acknowledgements, callbacks and logging function in the server log.
- Added function for LAN sync to support subdomains based on the site, can be used to separate LAN sync in separate sync island on same subnet.
- More information about Base station type, sync type sync master (locked RPN), has been added to rfps.xml in exported log.
- Disabling and enabling call establishment now displays a confirmation dialog when changed.

- Spectralink IP-DECT 400 SE cannot be downgraded to an earlier version than PCS25Aa.
- Secondary usernames can now be modified when the IP-DECT server is configured for Microsoft Teams.
- In a Microsoft Teams setup respond with 486 Busy Here when the handset is set to absent in charger. This resolves DECTESC-1379.
- Internal routing of calls can now be forced when calling username or secondary username. If forced, calls completely bypass the PBX/Call handler.

## Corrections

- An issue where an unexpired license could be shown as expired in the log is fixed. This resolves DECTESC-1358.
- Address a memory leak when handling failed TLS handshake. This resolves DECTESC-1362.
- Disallow access to company phonebook from a signed-out handset. This could cause the phonebook to become unresponsive. This Resolves DECTESC-1359.
- Address a failure in user import with a CSV file from DECT 2500/8000 with max standby text length (25 characters) for any given user, IP-DECT standby text length is 24 and the import was thus stopped. This resolves DECTESC-1372.
- A user CSV file could sometimes not be imported if saved from Excel. This resolves DECTESC-1372.
- An issue with multiple (169+) connections to Funktel FAS server version 2 has been fixed. This resolves DECTESC-1375.
- When updating a new handset firmware file, all pending handset updates are cancelled and instead updated and renewed with the new firmware file.
- Restart handset firmware provisioning when attempting to upload a new handset firmware file while handsets are updating or pending. This resolves DECTESC-1394.
- SNMP settings are now sent from the IP-DECT server to Base stations when changed. This resolves DECTESC-1397.

## Version PCS24Dc - R4.1 2024

## Corrections

- The user list in IP-DECT Servers is sometimes not displayed when the Handset configuration feature is enabled. This is fixed and resolves DECTESC- 1361.

## Version PCS24Db - R4 2024

### Added or changed features

- The Linux kernel has been updated to version 5.10 LTS, incorporating the latest security updates. We will continue to update our Linux kernel with security patches as they become available.
- Support has been added for SKU: 02344504 - IP-DECT Server 400 SE.

## Version PCS24Ca - R3 2024

### Added or changed features

- Third-party packages have been upgraded.
- **Microsoft Teams-related changes and enhancements:**
  - Settings for feature codes are now hidden in the IP-DECT Server GUI as they are set by Microsoft in the SIP GW environment.
  - Users can now set their presence status to “Do Not Disturb” (DND) through the handset’s presence menu. The DND feature is applied globally rather than locally. This complies with the \*30\* and \*31\* commands SIP GW uses for global DND.
  - Use the supported voicemail feature code \*99\* instead of your own number when calling your own voicemail.
  - (Preview) Dynamic location is now supported, based on a custom SIP X-switch info header. The remote SIP GW server uses this information to determine the user’s emergency location, based on the MAC address of the device or base station the device is connected to. Added X-switch information is applied, when enabled, to both SIP registration and SIP invite messages. Choices are; MAC address of the base station the handsets are connected to, or the DECT handsets’ IPEI (MAC) – can be set/enabled in the Teams config tab on IP-DECT server settings.
    - Example Base station MAC:  
`X-switch-info: mac=00:13:d1:81:00:04,  
 subnet_length=20, BSSID=00:13:d1:81:00:04`

- **Example Handset IPEI:**

```
X-switch-info: mac=15:09:30:00:07:45,  
subnet_length=20, BSSID=00:13:d1:91:0f:cd
```

- Dispatchable Locations settings are removed when systems are configured for Microsoft Teams or Lync/SfB, as the function is configured on those systems.
- (Preview) A new messaging option has been added: sending messages to DECT handsets directly from the Server GUI. Messages can now be sent to one, multiple, or all handsets through the IP-DECT Server's web interface; messaging is found under the Users tab.
- The same User-Agent header is used for SIP and provisioning (following SIP UA), except for the Microsoft Teams setup.
- Secondary username in subscription – Added option to use a secondary username for DECT handset subscription and in handset sharing. Using a secondary username in subscription and handset login can benefit systems utilizing very complex usernames or E.164 as a username/extension.

## Corrections

- Microsoft Teams – corrections:
  - Removed unused fields: The Teams configuration tab's Username and Password fields are now gone from the IP-DECT Server GUI.
  - Send SIP status 603 instead of 486 when rejecting an incoming call. This means that when reject is pressed on a DECT handset, all user-connected devices will stop ringing, and call behavior will be according to Microsoft Teams settings for when you cannot receive a call.
- Several COTA settings names have been corrected to better align with AMIE.
- Resolved an issue where, in some cases, messages sent via XML-RPC were not received and XML-RPC returned user busy (-2). This resolves DECTESC-1351.
- Resolved an issue where the order of phonebook entries in the handsets could be shifted if a surname(sn) was not configured for the entry. This resolves DECTESC-1352.

## Version PCS24Ba - R2 2024

### Added or changed features

- Added support for Configuration Over The Air (COTA) for S Series handsets, enhancing the user experience with increased stability. This update ensures that users can effortlessly manage their S Series handset settings remotely.

- Add an option to delete users and device database from the maintenance page. (<https://example.com/maintenance>). This is added in case the databases become out of sync in a redundant setup. Deleting the database on a slave server will cause the database to resynchronise from the master IP-DECT server database. This resolves DECTESC-1336
- Microsoft Teams -Secondary username additions:
  - Keep the secondary username in case a handset logs out and no other handsets are logged into the same account.
  - The secondary username keeps being assigned to the last logged-in handset.
  - Move the secondary username to another logged-in handset that is logged into the same account.
- Support for MS Teams global DND feature (\*30\*)
- GUI - Top banner image and status icons have been updated.
  - Updated icon formats and colors
  - Latest activity - A battery icon has been added under each user's latest activity, indicating if a handset is in a charger.

## Corrections

- IP-DECT Web server enhancements:
  - The web server could become unresponsive when trying to create more than 128 HTTP sessions in a short period of time.
  - Remove uploaded files if an HTTP session has timed out. This could result in a failure uploading a file when logged in again.
  - The web server could become unresponsive when more than 1000 HTTP connections were made. To prevent this from happening, the webserver drops the old server connection when it reaches a predefined limit. This resolves DECTESC-1329.
  - Added web server connection list to exported log output .tar file
- REST API enhancements:
- ARI in demo mode was missing the last digit when requesting status/general.
  - Fixed the issue with the log not being retrieved if a message had a non-UTF-8 character. The export log can now be retrieved correctly.
  - Rework request to hide/show Teams menu entries in handsets.
- VIP-DECT Server One – DEMO mode:
  - Fixed issue with DECT handsets connected to a slave VIP-DECT Server One in Demo mode could not make calls.

- Redundancy V2 license is now a part of Demo mode.
- Optimized enhanced messaging queue: Previously, when using digital bases, some messages could not be delivered correctly on older message systems if local messaging queues were not implemented correctly due to limited channels on digital base stations. This resolves DECTESC-1344.

## **Version PCS24Ae - R1.4 2024**

### **Corrections**

- Several edge cases have been addressed and resolved for the IP-DECT webserver. This fixes DECTESC-1329.

## **Version PCS24Ad - R1.3 2024**

### **Added or changed features**

- IP-DECT Server 400 now has the option to operate in DCP Mode to support the new DECT Complete Plan (DCP)

### **Corrections**

- In the IP-DECT GUI Provisioning tab, under firmware and S3x Series, if the S3x Series field had a saved value, it was impossible to clear it. This fixes DECTESC-1330.

## **Version PCS24Ac - R1.2 2024**

### **Added or changed features**

- Sometimes, Microsoft Teams SIP Gateway may have a problem with the timing of RTP packets at the beginning of a call, which can cause one side to hear the other with a delay. You can fix this with newly added setting by adjusting the RTP jitter buffers min and max values from the IP-DECT server GUI. Go to SIP settings and then Media. The values range from 10 to 1,000 milliseconds, default is 500 milliseconds. This fixes DECTESC-1322.



## Corrections

- Resolve a problem that could prevent the GUI from working. This applies only to the Auerswald WS-650IP - product code 02350002.  
This fixes DECTESC-1326.
- Add cable length icons for Auerswald branded servers when digital base stations are connected.

## **Version PCS24Aa - R1 2024**

### Added or changed features

- IP-DECT Digital Gateway support. This allows RFP5 and RFP6 digital base stations to connect to IP-DECT servers. An Advanced Feature Bundle license is required on IP-DECT server to enable this feature (Digital bases).
- IP-DECT Server 400 now supports up to 20 Base stations.
- Base station and Media resource firmware update from the IP-DECT server can now be done with a zipped firmware file.
- The standby text and secondary username can now also be set to the last 3 or last 6 digits of the phone number when configured for Microsoft Teams. Note secondary username can also be used to send MSF messages to
- One or more handset menu entries for Microsoft Teams can now be hidden. Menus to hide are selected in the IP-DECT server Microsoft Teams tab.

## Corrections

- The ARI is now correctly set in the REST request for status/general for Virtual IP-DECT server One.

## **Version PCS23Be - R2.4 2023**

### Added or changed features

- Two new options have been added for handset standby text when configured for Microsoft Teams. Standby text can be set to the last 4 or 5 digits of the E.164 number. This fixes DECTESC-1320.

## **Version PCS23Bd - R2.3 2023**

## Corrections

- Base station firmware could not be updated from Virtual IP-DECT server One. This fixes DECTESC-1319.
- Optimization of handling SIP registration errors on Teams SIP Gateway: for Microsoft Teams users that receive a SIP registration error with response code 403, either of the following actions will now be performed:
  - The handset is logged in: resynchronise the configuration with the provisioning server, eliminating mismatched configuration.
  - The handset is logged out: re-onboard the handset, renewing the onboarding User ID from the provisioning server.

## Version PCS23Bc - R2.2 2023

### Corrections

- When running Microsoft Teams, handsets were checked for compatibility on every location registration. In rare instances, this could cause the handset subscription to be deleted if frame-errors were received when the location registration happened. Now, the handset is only checked for compatibility the first time it is subscribed to the IP-DECT server. This fixes DECTESC-1318.

## Version PCS23Bb - R2.1 2023

### Added or changed features

- LDAP Bind user length has been increased to 511 characters.

### Corrections

- Correctly validate the S3x firmware provisioning tag "pp14234000" in the IP-DECT server config.xml configuration file.
- Statistic settings could not be saved and changing them could crash the GUI.

## Version PCS23Ba - R2 2023

### Added or changed features

- Support for DECT Security Step B - DECT Standard Authentication Algorithm #2 (DSAA2) is now supported.
- DAAS mode is now supported.
- Funktel ATEX handsets are now supported when configured for Microsoft Teams.

- The IP-DECT server now offers the option to configure an RFP as a LAN sync master, removing the necessity to manually access and configure a particular RFP. Starting with this release, it's no longer possible to establish this configuration directly from an RFP, guaranteeing that the IP-DECT server maintains control over assignment management.
- The default LDAP load interval has been extended from 1 hour to 8 hours. This resolves DECTESC-1302.
- When configured for Microsoft Teams, the default blacklist timeout has been adjusted from 3600 seconds to 300 seconds.
- When configured for Microsoft Teams, you now have the capability to use your own DDI or extension number for voicemail calls.
- The configuration "Allow auto offhook" is added to the REST API.

## Corrections

- Microsoft Teams web login not functioning has been resolved, which was caused by a hardcoded web sign-in URL. Now, the web sign-in URL is dynamically retrieved from the provisioning server.
- An issue where the LAN sync fallback does not initiate when transitioning between enabling and disabling the fallback settings has been resolved.
- RFPs fail to switch frequencies when the frequency switching feature is activated has been resolved.
- When configured for Microsoft Teams, the issue of the "Confirmation code sent" message not being delivered to the handset when dialling \*55\* has been addressed. This resolves DECTESC-1299.
- A log warning related to prolonged IO access during handset login and logout, has been resolved. This resolves DECTESC-1304.
- The RFP and Media resource databases can now be reset in case they become corrupted. This resolves DECTESC-1300.
- A server crash, caused by simultaneous CC\_RELEASE commands from both the SIP stack and the DECT stack when a new outbound call is received during the previous call while the endpoint is still waiting for CC\_RELEASE confirmation, has been successfully resolved. The issue was discovered during PP8 field trials. This also fixes DECTESC-1303.
- Funktel handset did not automatically stop ringtone playback when operating as a GAP handset. This has been addressed and fixed.
- An issue was identified where some RFPs, utilizing LAN Sync, were unable to synchronize with the master, unless rebooted. This problem has been resolved, and an additional sync monitor has been implemented. If an RFP fails to sync within a 5-minute timeframe, the sync process will be

automatically restarted, ensuring successful synchronization. This resolves DECTESC-1292.

- A production issue occurred where the HWPCS of IP-DECT 200 servers was mistakenly configured as "01A\_," causing the radio process not to start. This issue has been resolved, and the radio process now functions as expected. This resolves DECTESC-1305 and DECTESC-1308.
- Missing Web SignIn URL during Microsoft Teams web sign-in when the handset is connected to a slave server has been successfully resolved.
- Missing MSF release when an APP sends an MSF request to a Funktel handset has been addressed and resolved. This could cause the SIP stack and MSF to be out of sync.
- In certain conditions the admin process would crash when disabling an active AMIE connection, which was triggered by specific handlers continuing to operate on the terminated connection. This resolves DECTESC-1307.
- AMIE ping timeout has been adjusted to ensure more robust keepalive procedure. This resolves DECTESC-1307.
- Resolve the issue of duplicated secondary usernames resulting from lack of synchronization of user data in a redundant system when configured for Microsoft Teams. This resolves DECTESC-1310.
- Address the occurrence of an empty secondary username after automatic configuration synchronization when configured for Microsoft Teams.
- Resolve the issue where the handset limit per account is not functioning as intended on a redundant setup when configured for Microsoft Teams. This also resolves DECTESC-1310.
- Address the problem where the Allowed Domains feature is not functioning correctly when configured for Microsoft Teams.
- Resolve the issue with XMLRPC lookup not functioning for secondary usernames a redundant setup.
- Correct the lack of synchronization in the redundant setup for the RFP database when modifying or deleting RFPs.
- Apply a patch to libosip2 to reverse the partial SDP parser alteration made since version 5.1.1, as it disrupts the SDP lines of Avaya CM/R018x.00.0.822.0.

## Version PCS23Ab - R1.1 2023

### Added or changed features

- The IP-DECT Server now allows the selection of a LAN sync master, giving users the option to manually choose a master if the automatically chosen master exhibits undesirable performance. This feature replaces the previous method of setting the master from individual Base Stations.

### Corrections

- The issue of MS Teams web login no longer functioning has been resolved by removing the hardcoded web sign-in URL. Instead, the web sign-in URL is now dynamically obtained from the provisioning template.
- The issue where LAN sync fallback fails to initiate when transitioning between enabling and disabling the fallback settings has been resolved.

## Version PCS23Aa - R1 2023

### Added or changed features

- License error handling and error feedback has been improved.
- Force codec priority order to PCMU, PCMA, G.726 when Microsoft Teams is enabled. Some customers have observed one-way audio when transferring calls using G.729. This fixes DECTESC-1289.
- IP-DECT 400 Server can be set to DaaS mode.
- The Default CA bundle has been updated.
- The Default CA bundle is now used when connecting to Microsoft Teams SIP Gateway.
- Admin rights are not allowed to replace handsets in a Microsoft Teams setup.

### Corrections

- IP-DECT base station did not handle multicast correctly when the IP-DECT Server was restarted, or base station configuration changed. This issue was introduced in PCS21Ak and fixes DECTESC-1287.
- A Base license must be loaded before any other license in Virtual IP-DECT Server One. This fixes DECTESC-1284.

- Signing out a handset, when running in a redundant setup with handset sharing and COTA enabled, could crash the IP-DECT Server. This fixes DECTESC-1296.
- Automatic Base station firmware update could only be done for 32 Base stations. Now it can update all connected base stations. This fixes DECTESC-1297.

### Known limitations

- Base station region cannot be changed without a restart, even if frequency swap feature is enabled.

## Version PCS22Cb - R3 2022

### Added or changed features

- Microsoft Teams – Users can now be signed-in to Teams SIP Gateway directly from the IP-DECT Server GUI or REST. A pair code is received for a given user and the user must then be signed-in at Microsoft sign-in web page. Up to 10 users can be signed-in at a time.
- The LAN sync fallback to Radio sync feature has been redesigned and improved. The feature is in a [POC](#) phase and is available on IP-DECT Server 400 only. Please contact Technical support for questions on the new function.
- IP-DECT 400 is now a multicell server by default without requiring a license.
- Add new EMCs, 0x3AF5 and 0x3AF6, used to check if an IPEI belongs to a Spectralink handset.
- Microsoft Teams – An inband tone is now generated as confirmation for feature code calls, so there is no longer a need to play local busy tone.
- Automatic Alarm Call license is now a built-in feature on IP-DECT 200.

### Corrections

- 3<sup>rd</sup> party handset could be subscribed with wildcard subscription when an IP-DECT Server was configured for Microsoft Teams. The 3<sup>rd</sup> party handsets will now be correctly removed.
- The standby text was not updated in some cases. This was due to a missing MSF release indication causing a deadlock when sending the standby text. This only affected Microsoft Teams setups.
- COTA system load could not be changed in the IP-DECT Server GUI.

- REST - Proxy port was not unset when proxy domain was unset. This fixes DECTESC-1266.
- Missing ICE candidates could cause a Media Resource to crash. This partially fixes DECTESC-1274.
- Remove host certificates on secondary IP-DECT Server when running in a redundant setup when installing Microsoft Teams license. This fixes DECTESC-1276.
- CTI feature option has been removed from IP-DECT 200 as it is not supported on the server.
- LAN sync type of service (TOS/Diffserv) default value was not shown correctly in the IP-DECT Server GUI when a LAN SYNC license was installed.
- Suppress log message for unsupported crypto suite other than AES\_CM\_128\_HMAC\_SHA1\_80. Instead, we log if we don't receive it in the offer.
- Adding very long extra HTTP headers to a response could crash the admin process. This fixes DECTESC-1265.
- REST - Invalid licenses could not be deleted.
- REST – User Access code could not be set if Handset sharing was enabled.
- Allow only one active subscription dialog for the same event. CUCM 14 complains about "Subscription does not exist" due to CUCM always creating a new subscribe dialog and forgetting all earlier active dialogs. This partially corrects noisy logs for DECTESC-1278.
- Long log messages are now word wrapped in the IP-DECT Server GUI. This fixes DECTESC-1269.
- Microsoft Teams - EUDB regulations mandates that if a user is homed in EU, then their data must be stored in EU. Therefore, if 'EU user' signs to SIP device that is onboarded to another region (i.e., NOAN or APAC) then we must transfer the device to EMEA.
- REST – Requesting handset statistics could crash the admin process. This fixes DECTESC-1279.
- Secondary IP-DECT Server could crash when performing device actions. This fixes DECTESC-1281.
- A part of statistics for traffic Erlang could be missing. This fixes DECTESC-1272.
- Media Resource could hang/crash on a socket error. This fixes DECTESC-1275.
- Using the XML-RPC call endpoint\_call\_setup with display timeout and alert timeout set to 0 did not work. The error was introduced in PCS22Ba. This fixes DECTESC-1283

- COTA status is now reported as a Notice instead of an Error, and only after all retry attempts have been completed. This fixes DECTESC-1267.
- It was not possible to enable Automatic alarm call on Virtual IP-DECT Server One. This fixes DECTESC-1285.
- Cleaning up old SIP transactions with no original request could cause a crash. This was discovered in DECTESC-1286.
- Lync trusted server setting is now set to false as default when moving from Lync/Sfb to a Microsoft Teams setup.

## **Version PCS22Bb - R2 2022**

### **Added or changed features**

- Microsoft Teams – Remote restart request from TAC will trigger a re-registration request for the user of the handset.
- Use time zone (time offset) if received from DHCP option 2.
- Microsoft Teams CA certificates are now displayed in the Web GUI under Configuration > Certificates.
- Base stations can now be used behind a firewall for all multicell infrastructure.
- Microsoft Teams – A warning tone can be played in the handset if a user is signed-out by Teams Admin Center (TAC). The warning tone is played every 5 minutes. To cancel the warning, press the OK softkey in the handset when the message appears, sign-in again or turn off the handset.
- Firmware version is shown as PCS20xxxx instead of firmware build number in the Web GUI under Status > Wireless server.
- Octal representation of the server's ARI has been removed from the Web GUI.
- SIP Proxy settings are now disabled when DNS SRV is selected as DNS method when configured for Microsoft Teams.
- It is now possible to allow SIP wildcard certificates.
- Microsoft Teams License is valid for one year. If a license expires, subscription is disabled. A warning is shown in the Web GUI 60 days before expiry and when the license has expired.
- Remote sign-in to Microsoft Teams by dialling \*55\*<Verification code>.
- Automatic Alarm Call license is now a built-in feature on IP-DECT 6500 and Virtual IP-DECT server One.



- Licensed features can be enabled or disabled. This can be done from Administration > Features in the Web GUI. The following configurations have also been moved there:
  - Handset sharing
  - Lync/SfB
  - Automatic alarm call

## Corrections

- Unset teams.secondary\_username when removing Microsoft Teams license.
- Microsoft Teams – Do not sign-out handset if downloading the config file fails.
- More stable SNMP subagent internal communication.
- Microsoft Teams – turn of mail icon when a handset is signed out. This fixes DECTESC-1254.
- Increase validation of SIP SSL/TLS wildcard certificate used by Microsoft Teams DEV environment.
- Fix host verification of internal Virtual Media Resource and Virtual IP-DECT server One in a redundant setup. This fixes DECTESC-1255.
- Microsoft Teams Sign in screen was sometimes shown blank on 72x2 handsets when using languages other than English. For now, English is used to address this issue. This fixes DECTESC-1256.
- Base stations were not displayed in the Web GUI if an assigned Site name included special HTML characters. This fixes DECTESC-1258.

## Version PCS22Ab

### Added or changed features

- A new feature to hide system passwords has been added. If enabled the following will be hidden or removed from export logs, the GUI as well as through the REST API:
  - LDAP Password
  - System access code
  - SIP default authentication password
  - TURN password
  - Microsoft Teams provisioning password
- Fallback to secondary username if SIP username is not found when using MSF messaging or the XML-RPC interface.

- When configured for Microsoft Teams, showing the Extension has been added as a Standbytext option for the handsets. If this setting is changed a user must sign-in again for the change to take effect.
- When configured for Microsoft Teams, hostname is not used in SIP headers.
- When configured for Microsoft Teams, it is possible to choose how secondary username is set. It can be set to Extension, Last 4 or 5 digits of phone number or not set. These options reflect setting an Extension for each user or configure a dial plan using the last 4 or 5 digits in a phone number as an extension in Microsoft Teams. Setting secondary username makes MSF more user friendly as it follows the extension but not the SIP username and allows for internal routing fallback.

## Corrections

- Fix wrong SDP answer when receiving “a=sendonly” in SDP offer when the attribute is located in the session level. This fixes DECTESC-1247.
- The REST calls to GET status and status/system\_count could become nonresponsive. This is fixed.
- Send SIP Options keepalive directly to already resolved destination to avoid extra redundant DNS lookup on domain. This issue was introduced in PCS22Aa due to keepalive rework for Microsoft Teams.
- Never set hostname in SIP headers when configured for Microsoft Teams.
- When a Base license is installed on an IP-DECT server One in Demo mode, the option 'Remove user passwords from exported data' and 'Remove system passwords from exported data' are disabled. This allows for full system backup when the server is no longer running in Demo mode. The options can be enabled again to remove user and system passwords from exported data.

## Version PCS22Aa - R1 2022

### Added or changed features

- Microsoft Teams – Added Integration for Microsoft Teams SIP gateway. This is supported for all Spectralink IP-DECT Servers and Spectralink handsets 72x2-75x2-76x2-77x2 series. A license is required to activate the integration.

Features include:

- Connect with Microsoft Teams SIP gateway provisioning server automatically using DHCP option 160 or statically.
- Specify when to sync data with the provisioning server.
- Specify how many handsets can be connected per account.

- Specify a list of domains allowed to use handsets on the server.

Call features Include:

- Basic Calling.
- Call Hold/Resume.
- Call Transfer.
- Call Waiting.
- Call Forward (Always, On Timeout, Simultaneous).
- Call Forward Status
- Call to voicemail
- Caller ID.
- Message Waiting.
- Music on Hold.
- Shared Line (SIP forking).
- Call Completed Elsewhere.
- Do Not Disturb (DND).
- Microsoft Teams Logo in Handset.

Note: When a Microsoft Teams license is loaded, all 3<sup>rd</sup> party handsets will be removed from the IP-DECT server.

Note: When a Microsoft Teams license is loaded, it is not possible to take a backup of the user data.

- Additional TLS logging - It is now possible to log TLS keys when capturing packages from provisioning servers.
- Automatically generated Centralized phonebook – The Central phonebook can now be generated using local user data, if not using Centralized phonebook CSV or LDAP.
- New options for adding custom Alert-Info SIP messages - This enables custom values to be entered for Alert-Info to play internal ringtones for incoming calls and auto answer incoming calls. This Fixes DECTESC-1236.
- End of compatibility for old KIRK IP Bases - The old KIRK IP-Base Stations (SKU# 02337300, 02337301) EOL (End of Life) on October 1, 2013, and EOS (End of Service) on October 31, 2016, will no longer be supported beginning with this release. Customers still using these EOL/EOS KIRK IP-Base Stations must upgrade to the new Spectralink IP-Base Stations to continue receiving support and firmware updates and to make sure their deployments continue to work.

- Maximum SIP Blacklist timeout has been increased from 10 minutes to 1 hour.
- Respond 200 OK to incoming OPTIONS requests with no username, as a response to keep alive messages.

### **Corrections**

- New import/Export function Windows encoding - User data can now be imported/exported with Windows-1252 encoding. This fixes DECTESC-1231.
- User databases on IP-DECT servers could come out of sync in redundant setup. Internal access to the databases in redundant setup has been enhanced. This fixes DECTESC-1232.
- Some html files in exported logs were not shown correctly. The issue was introduced in PCS 21Cb and has been identified and fixed. This fixes DECTESC-1238.
- It was not possible to import users with the merge feature on a redundant setup. This fixes DECTESC-1240.
- If a wrongly formatted log message were added to the server logs, all logs could not be displayed in the web GUI but were accessible if exported. This is fixed.
- SIP keepalive messages with a from/to field length of 1 character was not parsed correctly. This is fixed.
- System count REST API call was not working in a redundant setup. This is fixed.
- Invalid UUID value was set Contact field when updating users from existing systems. This is fixed.
- IP-DECT server in redundant setup could come out of sync If all Software Assurance licenses were expired and only one of them was rebooted. This fixes DECTESC-1246.
- When enabling “Remove user passwords from exported data” is enabled, user database is not backed up as a part of a system backup. When the backup was restored, the existing user database was removed. This has been corrected and the existing user database is not removed.

## **Version PCS21Cb - R3 2021**

### **Added or changed features**

- The maximum number of users for Virtual IP-DECT Server One has been increased from 4096 to 16384. And subsequently, the maximum number of

simultaneous calls has been increased to 16384 when using Virtual Media Resources.

## Corrections

- Base stations and Media Resources firmware auto update will now trigger when identical firmware has been loaded as default firmware.
- Virtual IP-DECT Server One now supports CUCM instead of SfB in Demo mode.
- Rebooting Media Resources is no longer required when changing site.
- Rebooting Virtual Media Resources is not required when changing the number of media channels.
- Virtual Media Resource statistics are reset when changing the number of media channels.
- Only log when network is not full duplex. This fixes DECTESC-1211.
- Disable emergency number setting in a SfB setup as the emergency numbers are handled by SfB.
- Some characters were not displayed correctly in the handset when using Dispatchable Location.
- The GUI could become unresponsive for some time when using special characters in Dispatchable Locations.
- The corporate phonebook's search function stopped working for some users with long usernames. This fixes DECTESC-1225.
- The Base Station GUI no longer has some tabs missing. This fixes DECTESC-1228.
- Removed a log message, which could cause a lot of undesired entries for some systems. The log message consisted of "NOT VALID PPID".

## Version *PCS21Bd*

### Corrections

- Virtual IP-DECT Server One could not be deployed using VMware Cloud Director. This was due to strict validation of the Virtual IP-DECT One image description file and has been fixed.

## Version PCS21Bc - R2 2021

### Added or changed features

- LAN sync with radio sync fallback timeout can now be configured. It can be set to a value, in seconds, between 2 and 5 minutes.
- Language can now be set for each user. Users will receive system messages in the configured language. All previously available languages are supported.
- Users can be merged when imported from a CSV file. Merging is based on the new "UUID" field added to the users CSV files.
- Time zone can now be configured for each existing site. Handsets will receive the time from the site which it is configured to.
- When doing IP-DECT server firmware update with 'Use firmware as default' enabled and an identical firmware, the firmware is now saved as default even though the server is not updated. Hereafter the firmware file can be used to update other infrastructure, such as Base Stations or Media Resources.
- More parameters have been added to the file `base_station_device_info.csv` from statistics report generation. The parameters are: AutoSync, PrimarySync, SecondarySync, SyncType, SerialNo, RPN, Description
- Configuration group can be assigned to multiple users using the REST interface.
- Emergency call support in accordance with regulations (e.g. Kari's law). This allows users to be able to use telephones to dial the required emergency number (9-1-1) and provide dispatchable location to the first responders. Up to 10 emergency numbers can be predefined in the server. Dispatchable location can be set as the location of the IP-DECT server, based on sites or zones, or for each base station.

### Corrections

- An internal Media Resource could have a duplicated entry in the database and as a result shown twice in the GUI. This fixes DECTESC-1200.
- A Media Resource or Base Station could crash when receiving large RTP frame from a remote endpoint. This fixes DECTESC-1187.
- IP-DECT Base Station UPnP connection failover was not working on a IP-DECT server in secondary mode, in a redundant setup. This have now been corrected and fixes DECTESC-1194.
- The IP-DECT server now tries to reconnect to an LDAP server if the connection is temporarily lost. It will also retain the phonebook data already received for the LDAP server if connection is lost. This fixed DECTESC-1206

- If all SIP proxies are blacklisted, calls are now routed internally if internal routing is enabled. The calls are routed for a specific amount of time before trying to connect to a proxy again. This time can be configured with the setting `sip.allow_internal_routing_timeout` and can be set to a value from 30 sec to 600 sec.
- The SIP proxy blacklist is now correctly checked for blacklisted servers based on IP address instead of hostname.
- The IP-DECT server could go down if no subject alternative names were present in the certificate presented by a SIP server. This is now fixed.
- When doing an IP-DECT Server firmware update the reboot button is now disabled until the firmware update succeeds.
- Company phonebook could crash when the phonebook is requested with MSF and the phonebook was disabled.
- Handsets, that were turned off, could not connect to a secondary server, in a redundant setup, if they were turned on after primary server went down. This fixes DECTESC-1193.
- A few unnecessary log messages, regarding COTA, have been removed. This fixes DECTESC-1190.
- The Export log contained empty HTML files. These have now been cleaned up. This fixes DECTESC-1208.
- In a SfB setup a new call request could be sent to a registrar other than the registrar registered to (current registrar). This bug was introduced in PCS21Ak. This fixes DECTESC-1209.

## Version PCS21Am

### Corrections

- Partial chain validation for CA certificates is now enabled for backwards compatibility. This fixes DECTESC-1198.

## Version PCS21Ak - R1 2021

### Corrections

- OpenSSL security level was set to level 2 in PCS21Ah which could give backwards compatibility problems and problems with inadequate certificates. It is now set to security level 1.  
The difference between the two security levels are:

- Level 1: “The security level corresponds to a minimum of 80 bits of security. Any parameters offering below 80 bits of security are excluded. As a result RSA, DSA and DH keys shorter than 1024 bits and ECC keys shorter than 160 bits are prohibited.
- Level 2: “Security level set to 112 bits of security. As a result RSA, DSA and DH keys shorter than 2048 bits and ECC keys shorter than 224 bits are prohibited.”
- WebSocket timeout handling have been modified. Previously, the connection was terminated if no answer was received within 5 seconds. The timeout mechanism now attempts contact up to 3 times before timing out. This improves connection stability for AMIE installations with low bandwidth.

## Version PCS21Ah

### Added or changed features

- Maximum number of connected Base Stations for Virtual IP-DECT Server One has been increased from 2048 to 4096.
- Multiple LDAP phonebooks can now be configured, one per site. This feature requires a Phonebook license.
- Base stations, connected to an IP-DECT Server 400, will now fallback to Radio synchronization if they fail to synchronize over LAN. This requires that the deployment has been pre-configured with LAN synchronization.
- It is now possible to use separate provisioning servers for:
  - Firmware
  - License
  - Users and Configurations (infrastructure and handset)

This allows provisioning to be carried out from different sources e.g., users and license could be provisioned from different departments within a company and firmware from a service provider.

Each provisioning can also be configured with its own schedule for example, to check for a new firmware at 02:00AM every night and check for a new license every hour.

It is also possible to configure a Default provisioning server that will function as in previous releases. Firmware, user and configuration provisioning are by default set to use the Default provisioning server and License provisioning is by default disabled.
- It is now possible to provision licenses for a secondary IP-DECT server, in a redundant setup. Licenses to provision are added to the primary server's configuration file under the tag <slave><license></license></slave>.
- Automatic Alarm Call license is now a built-in feature on all IP-DECT 400 servers. The feature is disabled by default but can be enabled under Configuration-> Wireless Server-> Application interface-> Automatic Alarm



Call. If an Automatic Alarm Call license has been previously loaded, the feature is always enabled.

- Base stations can now be used behind a firewall for IP-DECT Server 6500 and Virtual IP-DECT Server One. This allows for deployments where IP-DECT Server(s) and Media Resources are located at a different site than the Base stations and connect through the Internet. An example of a deployment is where IP-DECT servers(s) and Media Resources are deployed at e.g., a Data-Center and Base Stations are deployed at one or more different sites. IP-DECT servers and Media Resources must be configured with public IP addresses and traffic routed through the relevant firewall. Base Stations are configured with the IP-DECT server's public address and no firewall routing is required.

## Corrections

- When a user-license was added or deleted for a Virtual IP-DECT Media Resource One, the information on the connected server was not updated correctly.
- If a Virtual IP-DECT Media Resource One was running as a Server Licensed Virtual IP-DECT Media Resource One, and then changed to contain a license, calls were no longer possible. A work around was to delete the Media Resource on the IP-DECT server. Now it works automatically.
- The IP-DECT Media Resource now correctly handles RFC4571 framing of STUN connectivity checks of ICE TCP relay candidates. Previous releases would ignore the connectivity check which could cause one-way audio and/or dropped calls in some Skype for Business setups. This addresses DECTESC-1167.
- When connecting an IP-DECT Server, produced (or factory reset) with firmware PCS19Cc or newer, as a slave server to a master server that had been running a firmware older than PCS19Cc, the Media Resource database synchronization would only partly transfer the data to the slave server, possibly resulting in a corrupt database. As a result, some or all Media Resources would not connect to the slave server. The media resource database is now always fully transferred when the servers synchronize. This addresses DECTESC-1177.
- A resource leak in the HTTP interface of the IP-DECT Server could cause resource exhaustion when a very large number of connections had been handled. The resources are now correctly cleaned up when a connection is closed.
- When trying to connect to an unresponsive LDAP server, the IP-DECT Server phonebook could be unavailable for several minutes until the connection attempt was aborted. The IP-DECT Server now skips any server not answering immediately. This addresses DECTESC-1181.

- Doing more than 8 handovers between Base Stations in a single call with Base Station media encryption enabled would previously result in one-way voice call.
- Deleting Base Stations from Administration -> Base Station -> Delete in the GUI is now working correctly. This issue was introduced in PCS20Dx.
- SIP servers are now correctly blacklisted if connection was lost.
- When an incoming invitation to a conference call was rejected, e.g., due to the handset being busy, the call would not be properly release and stay in the active call list until the IP-DECT Server was rebooted. The IP-DECT Server now correctly releases the calls and removes it from the Active Calls list.  
This addresses DECTESC-1184.
- The IP-DECT Server could crash if either of the SIP headers, P-Asserted-Identity or Remote-Party-ID were empty. This has been fixed.
- SHA256 and AEAD ciphers for TLSDSK have been enabled.  
This addresses DECTESC-1186.
- The statistics could sometime be reset due to a crash of the statistics module, this has been fixed.  
This addresses DECSESC-1182.
- Communication error between the server and the phonebook application could cause the phonebook to hang.  
This addresses DECTESC-1174.
- Handset statistics could produce a number of error messages due to a buffer overflow.  
This addresses DECTESC-1172.
- CallControl Req/Cfm via XML-RPC was not working in a redundant setup.
- The administration menu was visible in a Media Resource since PCS20Ae, which it should not have been. The menu has been removed.
- The phonebook app could crash when the phonebook is requested with MSF and the phonebook is disabled.
- Wrong validation of vlan setting when set using REST made it impossible to set vlan higher than 2. The setting is now validated correctly.

## Version PCS20Dj

### Corrections

- If power was removed shortly after the initial startup of a IP-DECT Server or Base Station, it could possibly cause an invalid TLS configuration in the device and as result the web GUI did not start.

## Version PCS20Dh

## Corrections

- It was not possible to make calls in DEMO mode in Virtual IP-DECT Server One when using Virtual Media Resources. The handset displayed “No available channels”. The error was introduced in PCS20Dd and has been corrected.
- The IP-DECT Server, Base Station and Media Resource could, during shutdown, hang forever and the only way to recover was to power cycle the units. The error was introduced in PCS20Dd. This issue has now been resolved.
- When using Microsoft Teams in an SBC gateway setup, the IP-DECT Server log was sometimes receiving a lot of warnings, due to proprietary ICE extension in relay candidates. These log entries were not real warnings and are now not logged and instead ignored.
- When receiving an MSF function from the handset on the XML-RPC interface, the MSF call was always released immediately. This error has been fixed.
- It was not possible to restore files larger than 1MB when using OAM REST API. This limit has now been removed and the limit extended to 16 MB.
- Improved messaging interface to 3rd party ATEX handsets.

## Version PCS20Dd - R3 2020

### Added or changed features

- The IP-DECT Server web GUI now sets autocomplete to “off” for the login password fields, disabling the storage of the admin password in browsers supporting this setting.
- XML/RPC functions and events added for a "Lone-worker" solution. This feature can be used as a personal emergency signal solution by third party systems.
  - endpoint\_loneworkermode\_setup
  - endpoint\_loneworkermode\_config
  - endpoint\_loneworkermode\_monitoring
  - endpoint\_loneworkermode\_proceed
  - endpoint\_loneworkermode\_status
- XML/RPC function and event “endpoint\_alarm\_test” added to test various sensors for specific Spectralink handsets (76x2/77x2).

- XML/RPC functions and events added for Call Control. These signals can be used to make a given handset call a specific number. This feature can e.g. be used with a "Lone-worker" solution.
  - endpoint\_callcontrol\_dial
  - endpoint\_callcontrol\_release
  - endpoint\_callcontrol\_status\_ind
- OAM REST API
  - Add allow\_gui to /config/base\_stations, a setting to disable/enable IP-DECT Base station GUIs.
  - The API now correctly blocks requests, which should not be available for a redundant secondary IP-DECT Server. In addition, a new tag has been added to the OAM REST API Documentation, to identify which requests are available and supported for a redundant secondary node.
  - Add node type of the server which a handset is subscribed, to the users' overview (/users).
  - It is now possible to do the following bulk actions of IP-DECT Base Stations: Delete, set site, set sync method, perform auto sync, restart.
  - It is now possible to retrieve a specific part of the log's entries instead of always retrieving all log entries.
  - It is now possible to get DECT to DECT user information for system count and user information.
- It is now no longer required to have a Software Assurance License installed, to update firmware on the IP-DECT Server 200.
- It is now possible to control when a call is terminated during scenarios involving the SIP REFER method (e.g. call transfer). The default behavior is to release the call immediately after the REFER request is sent, but by disabling "Send BYE with REFER" in the Configuration->SIP menu, the call is not released until the transfer has been completed. The later behavior is required for all transfer scenarios to work on some call handling platforms, e.g. Skype for Business response groups with agent anonymity enabled. This addresses DECTESC-972.
- Support 'DECT to DECT': Restrict extension to internal DECT calls only, thereby not being able to do external calls. A setting has been added for each user to configure it as a DECT to DECT user or a regular SIP user.
- The IP-DECT server now does strict validation on configuration files when imported through the GUI and when provisioned, allowing misspelled variable named and invalid values to be caught. The XML schema used for the validation is available at the Spectralink support site and on updated IP-DECT servers at <https:<hostname>/config/ipdect-config.xsd>.

NOTE: The IP-DECT server was previously case-insensitive when reading many configuration values (e.g. booleans). This is no longer the case, so check any provisioned configuration files before upgrading to this release.

- The LDAP backend of the central phonebook now provides improved error messages when unable to connect to the LDAP server.
- Redundancy version 2.0 license has been introduced.  
In the existing format, when acquiring a redundancy license to a secondary node, the ARI from the primary node must be known beforehand.  
In Redundancy version 2.0, it's not necessary to know the ARI of the primary node when creating the license to the secondary node. If two servers have the Redundancy version 2.0 license, they can just be connected the usual way, and they will internally transfer the primary server ARI to the secondary server. The license is only intended for a limited range of server SKU's.
- Setting up a "Server licensed Media Resource".  
Before, when an IP-DECT Server One requires more media channels, a new IP-DECT Server One is installed and via a license equipped with a given number of dedicated media channels, transforming it to a Media Resource.  
Now, during the installation of the .ova file, it is possible to deploy as an IP-DECT Server One or a "Server licensed Media Resource". Starting as Media Resource enables the setup to continue as a Media Resource with no internal media channels installed. The "Server licensed Media Resource" must be configured as usual (pointing to an IP-DECT Server One). On the IP-DECT Server One web GUI the new "Server licensed Media Resource" will show up as a *shared* Media Resource. The internal media resource in the server and all connected "Server licensed Media Resources" will share the number of media channels that is unlocked from the server license.  
In a Redundancy setup the number of media channels should be the same in the primary and secondary server.  
A "Server licensed Media Resource" can default handle up to 96 media channels (if the licenses on the server allows for it). This setting is depending on hardware performance on the system that runs the virtual machines and which codecs are in use. Possible settings are 32, 64, 96 and 128 channels and can be configured from web GUI.
- During installation of the .ova file, it's now possible to set the admin password and some network settings, e.g. static IP address and hostname.
- Generation of an inventory list.  
During (or after) installation/setup of the entire DECT system an inventory list can sometimes be requested from Spectralink sales/order management when creating SpectraCare or Software insurance. The inventory list contains all connected entities (servers, base stations, media resources and handsets). The inventory report is available from the Status->Logs menu in the web GUI.
- AMIE Support.  
Support for connecting and communicating with Spectralink DECT management tool AMIE has been added.  
A new category can be found under Configuration->General, with the following settings:

- Enabled: Defines if connection to AMIE should be enabled or disabled.
- Region: Determines which AMIE region to connect to. With this firmware release, the Ireland instance is the only available.
- Server: Only used when selecting "Custom" in the Region drop-down, to enable connecting to a custom AMIE instance.
- Authentication Token: Is a token generated in AMIE to validate the IP-DECT Server upon connection. Once acquired from the AMIE portal, it must be entered into this field.
- Proxy: Can be used to connect to AMIE through a HTTP proxy (Optional).

Further AMIE informations are available at: <https://www.spectralink.com/>

- Previously provisioning of firmware had to be transferred within 30 seconds. Due to some low bandwidth connections seen at customers sites and an IP-DECT Server One image that is close to 60 MB, the allowed transfer time is now extended to 10 minutes.

## Corrections

- OAM REST API
  - tx\_power and global\_tx\_power for IP-DECT Base Stations could not be set to "default". This is now fixed by changing the input type from a number to a string. Making it possible to send the string "default" to set the configuration to default or e.g. "10" to set it to 10 dBm.
- An invite CANCEL request is now sent from caller to CUCM when callee is busy. This is only relevant for systems with CUCM license installed.
- Fix SIP protocol stack crash when sending a SIP message without transaction (ACK or OPTIONS) and destination address lookup failed.
- An issue was fixed, where automatic firmware update, was not possible for IP-DECT Base Station with older firmware than PCS19Ac. This issue is only related to IP-DECT Server firmware PCS20Bb. This addresses DECTESC-1140.
- Fixed an issue, where calls made to secondary username was not working in a Skype for Business setup. This addresses DECTESC-1125.
- The IP-DECT Server now correctly disables SIP proxy support when configured for Skype for Business and using DNS SRV. This addresses DECTESC-1131.
- The HTTP interface initialization has been delayed until the IP-DECT Server is ready to answer requests.
- Fix calculation of next provisioning time when the configured provisioning time is before the current time. This addresses DECTESC-1149.
- It is now possible to provision server firmware to secondary nodes in redundant setups.

- An issue has been fixed, where heartbeat confirmation was not received for XML-RPC. This addresses DECTESC-1130
- Fixed an issue with a missing element in an XML-RPC signal (ExternHwCfm), used during Lone-Worker mode logon process. This addresses DECTESC-1153.
- Fixed a IP-DECT Server crash when a pickup feature call was terminated very early, e.g. due to being unable to allocate a media channel. This addresses DECTESC-1159.
- The LDAP phonebook backend will now respect the 'Enable legacy TLS' setting, allowing SHA-1 signed certificates to be used with LDAP. This addresses DECTESC-1156.
- A rare issue has been fixed, where sometimes after a firmware upgrade, some configuration settings could be changed to default. This resolves DECTESC-1088.

## Version PCS20Bb - R2 2020

### Added or changed features

- A new concept "Admin Rights User" has been added. By having admin rights, a user can replace other handsets and allow subscription to the IP-DECT Servers. These features are available through an admin menu. To access the menu, an admin rights user may either long press "key 7" or navigate through a handset menu (Menu -> Settings -> Advanced -> Master Handset). This feature only works on 72x2-75x2-76x2-77x2 series (except Spectralink handset 7502) and handset firmware 17H or newer.
- The OAM REST API certificate handling has been improved and can now handle host keys and host certificates separately.  
Host keys can now be imported, deleted and auto generated. Certificates can now be imported and deleted, and it is possible to auto generate self-signed certificates and generate a certificate signing request.
- Added "tags" to OAM REST API documentation, holding information of limitations and special cases when using the OAM REST API.  
These tags included "Requires reboot", "Requires license" and limitations to which IP-DECT Server various requests are applicable for. The OAM REST API documentation version has been increased to 0.2.0 with this change.
- Several additions have been made to the OAM REST API:
  - CUCM device name can be set and retrieved for users.
  - The following information to Base station overview, RPN, Description, Sync source and Sync type.
  - A new REST call to get numerous total numbers for Users, Devices, Base Stations and Media Resources.

- The following SIP configurations, Max pending registrations, Blacklist timeout, NAT keepalive and Nat keepalive interval.
- UUID added for each Media Resources.
- The following information for Media resource overview, UUID, Sites, Max channels and Codec.
- OAM REST API license info added to the documentation.
- It is now possible to upgrade the firmware using a zip file containing the firmware file, both using the GUI and using provisioning.  
This change makes it possible to upload a zip file containing different firmware files for IP-DECT Server One (.ova file for the Server and .bin for physical Base Stations & Media Resources).  
When provisioning a zip file, a .ver file containing the PCS release and build number must be manually generated.
- A new feature has been added, enabling automatic configuration of radio synchronization. When starting the automatic radio synchronization, only base stations with synchronization type set to Radio Synchronization will be configured. Either all base stations or only base stations on a specific site can be automatically configured.  
Max 256 base stations in same coverage area, e.g. a system has 800 base stations on 4 different sites with 200 base stations each (the sites are physically separated and do thereby not share coverage area). All 800 base stations can have their radio synchronization configured automatically simultaneously. Alternatively, only run the automatic configuration on one site.  
If a single physical location has more than 256 base stations (using radio synchronization) the synchronization configuration must be done manually.
- Added 2 additional sub-tabs to Statistics. System and Site view. This is an initial update to the IP-DECT Server statistics.

## Corrections

- A bug has been fixed when handling MSF functions received from handsets. When a handset sends a MSF function containing anything else than “Long-Press Key” or “Start Phonebook”, the output was previously not sent to XML-RPC interface.
- If an incoming call is received shortly after a previous call has been released, there was a small-time window where the call could fail with SIP response “480 Temporarily Unavailable”.  
The IP-DECT Server will now retry to establish the incoming call on a new connection. This addresses DECTESC-1017.
- Previously it was not possible to configure Media Resource host in the Media Resource GUI. This was due to the sub menu not being visible.



- When switching master/slave roles in redundancy, some Base Stations could turn out unresponsive.  
This has been fixed. This addresses DECTESC-1082
- When updating the route set for active calls in Skype for Business / Lync environment due to an endpoint logging out, the IP-DECT Server could crash due to referencing an invalid call dialog. This addresses DECTESC-1120.
- A busy tone was sent to Atex handsets in a wrong state, causing the handsets to send out a tone in the loudspeaker, when a call was ended. This addresses DECTESC-1117.
- Key press digits sent from an Atex handset in a call was not passed on to the PBX.
- A reboot-loop caused by inputting certain invalid values in the IP address setting field has been eliminated. This addressed DESTESC-1121.
- The IP-DECT Media Resource will now correctly handle SSRC change combined with a sequence number reset during an SRTP session.
- Responses from the OAM REST API with no body no longer, incorrectly, sets the Content-Type header.
- SIP SUBSCRIPTION responses that does not contain the mandatory Contact header could cause the IP-DECT Server protocol stack to crash. The IP-DECT Server now handles the response, although any further messages in the same SIP dialog may not reach the correct destination due to the missing Contact header. This addresses DECTESC-1115.

### Known limitations

- Secondary username calling is not working when connected to SfB.

### Notes

- Interoperability with RingCentral Office, has been tested and validated.

## Version PCS20Ae - R1 2020

### Added or changed features

- A column showing LAN synchronization performance, has been added in the web GUI under "Administration->Base Station". This will provide the user a quick status on how the LAN performs in relation to LAN synchronization. There are four different icons that represent the status:
  - Green - Representing good LAN sync health.

- Yellow – Indicates that some one or more issues have occurred. However, the system might perform as desired.
- Red - Indicates that one or more issues have occurred, that leads to bad system LAN performance.
- Grey - Unknown LAN sync performance status.

When holding the mouse cursor over the icon, a tooltip will appear, describing the status in more detail. The column is called “Lan sync performance” and is only visible when a LAN sync license is loaded.

- A setting has been added, to disable bearer handover to/from repeaters, on IP-DECT Servers. The setting is located under “Configuration->Wireless Server->DECT” and is called “Allow bearer handovers to repeaters”. If disallowed, handovers between a repeater and a base station must take place as connection handovers. If paging method is set to “Zone based” bearer handovers to/from repeaters are always disallowed. TBD: Add default value. This addresses DECTESC-1056.
- A license is no longer required to use the encrypted SIP transport (TLS) or encrypted voice data (SRTP).
- Encryption keys, X.509 self-signed certificates and X.509 certificate requests can now be generated directly in the IP-DECT Server GUI, allowing simpler administration of the certificates used for HTTPS and SIP over TLS.

## Corrections

- When loading or deleting a license, the information displayed on the IP-DECT Server GUI are now correctly updated, without the need to reload the license page.
- The column “Times busy” under “Statistics->Base Station” is now correctly updated, whenever the value changes. In addition, the IP-DECT Base Stations LED now blinks fast/slow if the base station is busy/not busy. This resolves DECTESC-1066.
- Frequency swap is now enabled on single cell servers.
- Extra software build info in the SIP user agent header, that was introduced in PCS19C, has been removed.
- When the IP-DECT Base Station is not synchronized, it will no longer queue any received paging messages but rather drop them immediately. The previous behaviour could cause the paging queue to overflow during heavy traffic or with long periods where a base station was unsynchronized. This addresses DECTESC-1098.
- The internal base station in a IP-DECT Server 200/400 is now always allowed to connect, even if the setting “security.allow\_new\_rfp” has been provisioned with a false value. This addresses DECTESC-1108.

## Version PCS19Cd

### Added or changed features

- It is now possible to configure how the IP-DECT Server decides if a SIP URI can be treated as a phone number with the “Convert SIP URI to phone number” in the Configuration->SIP menu or with the sip.convert\_sip\_uri\_to\_phone configuration file key . If enabled, the IP-DECT Server will always consider a SIP URI only containing numbers in the username part as a phone number. If disabled, only SIP URIs with the user=phone parameter will be considered as phone numbers. This addresses DECTESC-1073.

### Corrections

- A bug in PCS19Cc preventing importing a host certificate has been fixed. This addresses DECTESC-1077.
- An issue causing LAN sync issues in some network environments with PCS19Cc has been fixed. This addresses DECTESC-1076.
- The base station would not automatically connect to the new IP-DECT Server when the configuration what changed if it was not set when the base station was booted. This addresses DECTESC-1062.
- Added missing “Reboot now” button for IP-DECT Base Stations under “Configuration->Base Station”. Addresses DECTESC-1062.

## Version PCS19Cc - R3 2019

### Added or changed features

- When using DNS SRV method, the IP-DECT Server no longer changes the active SIP proxy if a call is in progress.
- Some SIP endpoints incorrectly use the G729A/8000 SDP media type for the G.729 codec instead of the correct G729/8000 value. By enabling "Use G729A media type for G.729 codec" in the Configuration->SIP menu the IP-DECT server will now also use the G729A/8000 value.
- TLS 1.3 is now supported. By default, the IP-DECT Server no longer supports these legacy TLS features:
  - Protocol versions 1.0 and 1.1
  - Certificates signed by SHA-1
  - Cipher suites based on CBC
  - Cipher suited not providing Perfect Forward Secrecy

These features can be enabled again with the "Enable legacy TLS" setting in the "Configuration->Security" menu or by the security.legacy\_tls configuration file setting.

- The IP-DECT Server web GUI now sets a number of HTTP headers to increase security:
  - Content-Security-Policy
  - Strict-Transport-Security
  - X-Content-Type-Options
  - X-Frame-Options
  - X-XSS-Protection
- If the SIP proxy, where a user is currently registered, is not responding to keep-alive requests, the IP-DECT server will now initiate a re-registration on another SIP proxy. This addresses DECTEST-1033.
- It is now possible to change the call hold behaviour of the IP-DECT Server during an attended call transfer. By default, all calls are put on hold before performing the call transfer by a SIP REFER message, but by disabling the "Send Hold before REFER" setting in the "Configuration -> SIP" menu, the IP-DECT Server will send the REFER immediately. This increases interoperability on some call handling platforms, where the call transfer target would remain on hold, even after the transfer has completed.
- The timeout of an LDAP query for the integrated phonebook is now configurable in the "Administration -> Phonebook" menu and by the phonebook.ldap\_timeout configuration file setting.
- If no hostname is configured, the IP-DECT Server will now register the hostname 'ipdect-<serial>' when using a Dynamic-DNS capable DHCP server.
- It is now possible to configure Spectralink handsets (72x2 series and 75,76,77x2 series with firmware PCS19K or newer) from the IP-DECT Server over the air.

All handset settings can be configured, and every menu item can be hidden/shown. As an example, an administrator sets the "ringing volume" to a desired level and hides the menu item "Ringing volume", the ring volume is now predetermined and can't be changed by the user.

A user can be assigned to a configuration group. An IP-DECT Server may have many configuration groups configured, e.g. a configuration group for different departments, workers in noisy environments, more silent office areas etc.

There is an XML file for each group that contains the handset configuration. Every configuration file has a tag with group number and version number, if a configuration file is uploaded to the IP-DECT Server with a different version number, the handsets within that group will be updated with new settings.

An XML file does not have to contain all handset configurations but only those relevant for the configuration group.

The outline of the XML looks like this:

```
<cota>
<info>
  <group>100</group>  #group number between 1 -9999
  <version>1</version>  #version number between 1 -999
</info>
<data>
  #Configuration data.
</data>
</cota>
```

Update of the handsets configuration/settings happens every time when:

1. A new configuration file, with different version number than is already on the handset, is uploaded to the server.
2. A handset is assigned to a user, in a different group, either via handset sharing or web GUI/OAM REST API.

This handset configuration functionality is a beta version and does not work on redundant systems. Please refer to the installation and configuration guide for more details.

- Cisco Computer Telephony Integration (CTI) is now supported on Cisco Unified Call Manager (CUCM). This allows for call control of Spectralink handsets (72x2 series and 75,76,77x2 series with firmware PCS19K or newer) by CTI enabled applications like Cisco Jabber. This feature requires that a COP file is loaded on the CUCM server, a CUCM license is loaded on the IP-DECT Server and a CTI license is loaded on the IP-DECT Server (not applicable to Spectralink IP-DECT Server 200). Supported features are:

- Basic calling
- Call hold
- Call retrieve
- Call transfer
- DTMF tones

This feature has been tested on CUCM 11 and 12 using Jabber 12.6.

- Cisco BroadWorks phonebooks/directories integration has been added, allowing access from handset to Cisco BroadWorks phonebooks/directories. This can be chosen instead of importing a company phonebook from a CSV file or via an LDAP server.

When the company phonebook has been configured, users can begin searching by pressing the up key on the handset. The BroadWorks phonebooks/directories are retrieved on the fly each time the user enters the phonebook from the handset.

It is possible to select a combination of five BroadWorks phonebooks/directories on the IP-DECT Server:

- Enterprise Directory
- Enterprise Common
- Group Directory
- Group Common
- Personal Directory

Each retrieved phonebook/directory entry consists of the following data:

- Name, corresponding to the BroadWorks' "name" element or a concatenation of the "firstname" and the "lastname" elements.
- Department, corresponding to the BroadWorks "department" element.
- Number, corresponding to the BroadWorks element with the following priority: 1: "number", 2: "phone", 3: "extension".
- Mobile, corresponding to the BroadWorks' "mobile" element.
- Multiple base stations can now be assigned to a site at the same time. Under "Administration -> Base Station" it is possible to select one or more base stations. Then it is possible to choose available site from the "Choose Available Site" dropdown-menu and assign it to the selected base stations.
- It is now possible to choose between four different types of paging on incoming calls.

Whenever there is an incoming call, the server needs to page the base stations to find where the handset is located. On large or busy system, there might be a situation where paging on the base stations will occupy too many channels, making the base stations unavailable for other incoming or outgoing calls.

This problem can be solved by using a smart mechanism that puts the base stations into sites and zones. If the server knows in which site/zone the handsets are currently located, then it is only needed to page on the base stations belonging to that site/zone.

It is recommended only to use Spectralink handsets (72x2 series and 75,76,77x2 series) when zone based paging is used as paging method. Before using zone based paging method it is important to upgrade the Spectralink handsets with firmware PCS19K or newer.

The paging method can be configured in the "Configuration -> Wireless Server -> Base stations -> Paging method".

Paging methods:

- Default:
  - The server pages on all base stations on incoming call.
  - A maximum of 256 base stations is recommended.
- Multicast:
  - The server pages on all base stations on incoming call by sending only one multicast network packet.
  - The limitation is 1024 base stations.
- Site based:
  - The server only pages on base stations within the site that the handset is located in.
  - Base stations should be assigned to a site.
  - Base stations that are not assigned to a site, will page on every incoming call.
  - Each site cannot have more than 256 base stations assigned.
  - Base stations on the same site must have unique RPNs.
  - Base stations that are not assigned to the same site, must be physically widely separated, i.e. handsets must not, at the same time, be within coverage area of two base stations, assigned to different sites.
  - If a handset moves between sites, it will be unreachable until the user makes some activity with the handset on the new site, e.g. user restarts the handset or presses the hook-key.
- Zone based:
  - This feature utilizes functionalities in the DECT standard defined as "Location Area Level".
  - It can also utilize sites as described in site based paging.
  - The server only pages on base stations that belong to the site and/or zone that the handset is located in.
  - Base stations assigned to different sites, may have overlapping coverage areas, as long as they have different RPNs.
  - Each site cannot have more than 256 base stations assigned.
  - Base stations on the same site must have unique RPNs.
  - The base stations are divided into zones, based on the base stations RPNs.
  - There are three possible zone sizes, 8, 16 and 32 base stations per zone.

Please refer to the installation and configuration guide for more details.

## Corrections

- When provisioning is enabled and the setting 'Use firmware as default' is set, the IP-DECT Server now always downloads server firmware and saves it as default firmware for IP Base Stations and Media Resources if it has a different version. This addresses DECTESC-1031.
- Disabling the internal media resource in the menu “Configuration->Media Resource” now correctly removes it from the list under “Administration->Media Resource” and “Statistics->Media Resource”. This resolves DECTESC-948.
- Changing the administrator username now triggers the IP-DECT Server GUI to request a reboot.
- The IP-DECT Server now correctly handles the case where a handset is subscribed again shortly after it has been deleted from the database. This could previously cause a database inconsistency with duplicated entries.
- When starting a large number of handset firmware upgrades simultaneously, they are now started with a short interval to avoid causing large load spikes.
- During startup, the IP-DECT Server will now do a cleanup of the user and device databases to ensure consistency when handset sharing has been disabled and devices without an assigned user is present.
- An issue was fixed where the IP-DECT Server was not able to establish calls and would log the error “no free channels on MR” although there were no active calls.
- It is now possible to use special characters in LDAP attribute names. This addresses DECTESC-1045.
- An issue where it was not possible to do call-back to a SIP URI where the username part was consisting of only numbers has been fixed. This addresses DECTESC-984.
- When DECT early encryption was enabled on redundant systems, handsets could lose their subscription when one of the IP-DECT Servers was restarted. This addresses DECTESC-1037.
- The IP-DECT Server was incorrectly using UTC when logging via syslog, it now uses local time. This addresses DECTESC-1022.
- Automatic updates are now only active on the primary server in a redundant setup. Automatic update of base stations and media resource could incorrectly be active on the secondary server, if the secondary server had previously been configured as primary or standalone server with automatic update enabled.
- A possible IP-DECT Server crash when deleting a user while it had a SIP registration pending has been fixed.



## Known issues

- IP-Base stations with default configuration require a manual reboot after changing Server IP address (Configuration | Base Station). Unfortunately, the reboot button has disappeared.

Until issue has been fixed there is a recommended workaround. In IP-Base Station GUI go to Configuration | General. Choose any setting with two “\*\*”, e.g. choose UPnP and toggle the setting “Enabled” and press save button. Now a yellow bar appears in the top of the window, where IP-Base station can be rebooted. Before rebooting the IP-Base station remember to revert changes to the UPnP setting to “Enabled”.

## Version PCS19Be

### Corrections

- DECTEST-1013: Increment the local CSeq in existing early dialog when resending a new request.
- DECTEST-1016: Prevent a protocol stack crash by not sending a PRACK message if the early dialog could not be established due to invalid Contact header in the 183 response.
- DECTESC-1021: Fixed a buffer corruption issue when servers in a redundant system is connected by a slow and/or bad connection.
- DECTESC-1025: The IP-DECT Server now accepts SIP responses missing a mandatory Contact header that is unneeded due to included Record-Route headers
- DECTESC-1026: Fix provision stopped working in redundant setup due to lost connection when merging users.
- DECTEST-1027: The Contact URI in REGISTER messages is not the same as original registration when unregistering the handset.
- CVE-2019-11477: A sequence of SACKs may be crafted such that one can trigger an integer overflow, leading to a kernel panic.
- Fixed protocol stack crash when a Butterfly handset tries to release two call that are already in the terminated state.

## Version PCS19Bc - R2 2019

### Added or changed features

- Internal routing with secondary username (introduced in PCS19Ab) can now be used in a redundant setup and with TLS, thereby obsoleting former limitations.
- Naming of “clusters” have been changed to “sites” for the IP-DECT Server.
- If a Base Station Belongs to a specific site, it will only be paged if the handset being called is registered to that site. The handsets automatically register to its surrounding site on location registration. This feature can reduce radio and network overhead as not all connected Base Stations are paged when a handset receives a call.
- Improved integration with Funktel handsets. Now supporting basic features (reject calls, hold a call, call forward attended, call forward unattended, toggle between calls, call waiting). Conference call not yet supported. Also, basic support for Funktel Application Server. A basic connection to Funktel

Application Server can be established and messages can be sent to Funktel handsets. Connectivity to Funktel Application Server must be enabled before it can be used. To enable FAS connectivity from GUI go to Configuration | Wireless Server | Application interface. Default is disabled.

## Corrections

- The phonebook will no longer return “no match found” when entering search keys that correctly should return an existing user. The error was seen when some user names started with a digit. This addresses DECTESC-981.
- Corrected wrong indexing in response to OAM REST API /config/sip GET request.
- An issue regarding support for Skype for business has been resolved, which caused several hanging calls in the IP-DECT server GUI active calls tab. This fixes DECTESC-1001.
- A correction is introduced to SUOTA, resolving an issue which could cause a lock preventing the possibility to provision new handset firmware to the server. This addresses DECTESC-998
- Fixed an issue which caused SNMP monitoring to crash during IP-DECT server restart. The SNMP process now correctly avoids crashing and can restart itself if crashed. This fixes DECTESC-989 & DECTESC-1002.
- Now restricting auto update of base stations to not update KIRK IP bases. This resolves DECTESC-964.
- Added additional error handling for XML-RPC.
- Fixed minor errors in OAM REST API documentation and updated it to match the release.

## Version PCS19Ac - Q1 2019

### Corrections

- Disabling the GUI on base-stations connected to an IP-DECT Server 400 no longer restart the GUI on the server itself.
- Deleting a license now correctly indicates that a reboot is required.
- An issue, where signing in from a handset with user@domain was not handled correctly, has been fixed.
- Fixed an error in a call-waiting scenario, where the IP-DECT Server could crash when all three involved parties released the call within a short timeframe.

## Version PCS19Ab

### Corrections

- When initializing SUOTA, .ver files were sometimes read resulting in an error being displayed in the logs. Only firmware binary files are now read.
- CSV export now always includes cucmdevicename and secondary username. CSV import can handle files without them, with cucmdevicename added or both cucmdevicename and secondary username added.
- The Model tag shown in the Web GUI for users has been renamed to Product name. Fixed error when accessing the phonebook with long key press. Long key press on '0' and '2' was not working correctly.
- Correctly parse licenses including both a feature and extension to the number of users. These would previously incorrectly drop the number of built-in users. This fixes DECTESC-951.
- The phonebook now works when signed in to multiple devices with the same username.
- An issue where there would be no audio in calls after the IP-DECT server was upgrade to PCS18Ja+ until the base stations was rebooted has been fixed. This fixes DECTESC-967.
- Fixed a sorting issue in company phonebook, when sorting "Q" and "q" – other letters are sorted correctly.
- Accessing the company phonebook with long pressing key 0 – 5 on the handset was not always showing the correct menu. This fixes DECTESC-974.

### Added or changed features

- The IP-DECT Server 400 maximum number of supported users and IP-Base Stations has been increased. The total amount of users is now increased to 60 from the previous 30.  
The IP-DECT 400 user licenses are increased to achieve this new limit. Each previously issued or new IP-DECT 400 Server user license increases the number of allowed users to 60. Newly issued IP-DECT 400 Server user licenses increases the number of users by 24.  
The maximum amount of external IP-Base Stations has been increased to 9 from previous 3. This is obtainable by loading a single Multi Cell License, enabling all 9 IP-Base Stations.  
The IP-DECT Server 400 internal Base Station license limit remains at 3.
- A secondary username has been added to users. This can be used for internal routing through localhost if SIP registrar(s), translating SIP usernames to extension numbers, become unreachable. This requires that the localhost address 127.0.0.1 (or just localhost) be entered as a URI in the first available proxy field in SIP settings. Secondary username must be globally unique i.e. unique among other usernames and secondary usernames.
- If no NTP server is configured or provided by DHCP, the IP-DECT server will now fall back to a default NTP server (currently time.google.com). This behavior can be disabled by setting the NTP server value to 'None'. This fixes DECTESC-975.

## Known limitations

- Secondary username cannot be used in a redundant setup, TLS SIP transport or with PIN auth.
- During login with Chrome 72 in certain configuration, the web GUI may return a "411 Length Required" error and a reload of the page is required. This is fixed in Chrome 72.0.3626.96.

## Version PCS18Je

### Corrections

- Fixed an issue where upgrading to IP-DECT Server firmware versions PCS18Fa – PCS18Jd could cause device subscriptions to become corrupt when converting the internal database to a new format. This addresses DECTESC-969.

### Added or changed features

- The IP-DECT Server will no longer terminate a subscription due to an error conditions, but only in response to a user action, e.g. unsubscribing/deleting a device in the web GUI.

## Version PCS18Jd

### Corrections

- An issue causing handsets with PPID larger than 255 to be unsubscribed when restarted has been fixed. This addresses DECTESC-963.

## Version PCS18Jc - Q4, 2018

### Added or Changed Features

- The internal timestamp of this release is set to "2018-10-01"
- The IP-DECT Server will now block any firmware updates of handsets, base stations and media resource if the new firmware is not covered by the installed software assurance licenses.
- It is now in the web GUI possible to manually set the certificate provisioning URL used for PIN authentication with Skype for Business server.
- If more than 10 consecutive LAN sync delay requests times out, the PTP protocol layer is now restarted.

- The Linux kernel has been updated to version 4.14.76.
- The duration of blacklist timeout when reattempting to connect to a SIP server is now configurable (previously fixed to 30 sec). The timeout can be configured between 5-600 seconds.
- Added the possibility to increase the amount of allowed maximum pending SIP registrations in the range 1 to 100. The default value is 1, being the previous fixed value.
- The IP-DECT server now has a OAM REST API for operating, administrating and managing the server along with a documentation thereof. OAM REST API requires a license. For more details, refer to the documentation available at the Spectralink support site.
- It is now possible to disable access to the web interface (GUI) of the IP-DECT server and IP base stations. For more details, refer to the documentation available at the Spectralink support site.
- Merge functionality has been added to the provisioning of the config.xml. It is now possible to add/change a single setting without overwriting the rest of the settings in the IP-DECT server. For more details, refer to the documentation available at the Spectralink support site.

## Corrections

- When DECT early encryption is enabled, the IP-DECT Server will now release any DECT connections from handsets that sends data before encryption is enabled. This addresses DECTESC-909.
- Fixed a race condition during start-up of the SNMP component that could cause no IPDECT specific values to be available. This addresses DECTESC-904.
- Fixed a server crash that could occur when deleting a user with an active voice call. This fixes DECTESC-927.
- During the first start-up after upgrade to firmware PCS18Ga, the IPDECT could log a number of "Error writing Subscription database" messages. This has been corrected.
- Fixed a bug in firmware version PCS18Ga where base stations using a tagged VLAN would not be able to use LAN sync. This addresses DECTESC-932.
- An issue in PCS18Ga dial- and ringback tones was in some situations not played and/or stopped correctly has been corrected. This addresses DECTESC-913.
- The web GUI will now show an error if the user tries to use any unsupported characters in the login password.

- The SIP registration procedure has been improved to better handle situations where the SIP proxy is slow and/or many users need to be registered at the same time. Previously the IP-DECT server ended up in a state where registrations would time out before being renewed.
- Fixed an error in PCS18Ga where the DHCP client would not wait more than 5 seconds to acquire a DHCP address. The IP-DECT Server now correctly waits for 60 seconds before falling back to a static IP address. This addresses DECTESC-914.
- COBS C-31xxi handsets are now correctly identified in the web GUI. This addresses DECTESC-920.
- Enabling handset sharing now correctly shows that the IP-DECT Server needs to be restarted to activate the feature. This addresses DECTESC-917.
- When accessing the legacy version of the central phonebook, some special characters in name fields were not properly converted, i.e. names like "Åse Bælle" was shown as ".se B.lle". This addresses DECTESC-903.
- Fixed bug when selecting invalid handset firmware file. By pressing "OK" the web GUI now goes directly to list users, instead of returning to previous path.
- A redundant server is now prevented from auto updating base stations and media resources which could lead to an update loop.
- Fixed bug where the server would end up in endless loop of restarting. This would happen if the firmware version file was empty during provisioning.
- The connection monitoring between the IP-DECT Server, the IP-DECT Base Station and the IP-DECT Media Resource has been adjusted to be less aggressive, resulting in better performance in networks with a small packet loss.
- An error message that was logged when a DECT packet sequence number error occurs has been removed as this can often happen in normal operation.
- An incorrect error message about not being able to load a SUOTA .ver file has been removed.
- A IP-DECT Server crash that could occur when a handset is in an active call, is deleted, and then receives an MSF message has been fixed.
- Fix an error that could cause a crash of the IP-DECT server when editing a disabled Base station or Media Resource entry.
- Fix an IP-DECT Server GUI crash when the browser closes the connection while listing the connected Media Resources.
- The IP-DECT Server monitoring of the connections from the Base Stations and Media Resources has been relaxed, allowing small amount of packet loss without dropping a connection. This addresses DECTESC-936.

## Version PCS18Gb

### Corrections

- Some erroneous log messages incorrectly stating that a subscription has been terminated due to a security issue has been removed.

## Version PCS18Ga

### Corrections

- The internal timestamp of this release is set to “2018-07-01” and it will require a software assurance licence to allow firmware update with firmware having an internal timestamp of “2018-07-31” or newer.
- Fixed an issue where an incoming call arriving just before an outgoing call is set up could cause the IP-DECT server call handling component to crash. This addresses DECTESC-912 and DECTESC-915.
- The timeout when trying to acquire an IP address from a DHCP server has been increased. This addressed DECTESC-914.

### Known limitations

- A log message indicating that subscription has been terminated due to a security issue may in some situations appear when a location registration fails even though the subscription are left intact.

## Version PCS18Fa - Q3, 2018

### Added or Changed Features

- Early encryption and re-keying are now disabled by default.

### Corrections

- An issue causing much longer boot times has been fixed
- Base station and media resource running a protocol older than the IP-DECT server are now also updated if a newer firmware is available.
- The connection to base stations and media resources are now gracefully shut down when a reboot is requested from the IP-DECT server. This avoids error messages in the server log.
- A number of debug log entries with MAC release reason has been removed.



- A license that is already installed on the IP-DECT server can no longer be loaded through the web interface.
- The web interface will no longer allow early encryption and re-keying to be enabled if encryption has been disabled.
- The number of licenses that can be installed on the IP-DECT server has been increased to 500.
- When an encrypted network connection is closes, a proper TLS shutdown message is now always send to the remote end.
- An issue that could cause LAN based synchronization to not start up properly has been fixed. This addresses DECTESC-898.
- In some situation the SNMP functionality would not start or start with limited functionality.

## Version PCS18Ea

### Added or Changed Features

- The IP-DECT Servers now supports DECT Security Step A, including:
  - Early encryption of connections
  - Re-keying of active connections
  - Subscription time limits

This functionality is configured with the "Early encryption and re-keying" setting in the "Configuration->Wireless Server" menu and is enabled by default.

For more details, see [DECT Security Certification](#)

**Note:** The re-keying procedure that is part of the DECT Step A Security is defined in a way that makes it very sensitive to bit error on the radio link. As a consequence, enabling early encryption and re-keying increases the requirements of the DECT deployment and can cause issues with call quality and dropped connections.

On sites where it is planned to enable DECT Step A Security, it is highly recommended that a site survey is performed with the early encryption and re-keying option set to required.

In a deployment with areas with signal quality issues (i.e. muted and/or dropped calls), enabling early encryption and re-keying can significantly increase the risk of losing an active call in those areas.

- After enabling "Subscription allowed", previously subscription was open for ever. Now by default the IP-DECT Servers will open subscription for 120 seconds or until a successful subscription. This behaviour can be disabled

with the "Automatically disable subscription allowed" setting in the "Configuration->Wireless Server" menu.

- On a Lync / Skype for Business system, the IP-DECT Server now supports re-registration as part of dialog recovery, i.e. when a user is moved between frontend pools. This addresses DECTESC-879.
- The SIP 305 Use Proxy response is now supported.
- Starting with the IP-DECT Server firmware 2018Q4 release, a valid "Software Assurance" license covering all users must be installed on the server. A firmware update to this or later version will now require a correct license installed.
- It is now possible to store the TLS session keys during a packet capture, allowing analysis to be performed on encrypted connection. This must be enabled in the Packet Capture dialog and after the capture is complete, the next exported log will contain the TLS session keys of any new established connection.
- When "Capture Everything" is selected for a packet capture, decrypted SIP is no longer included. Use the "Decrypt SIP over TLS" option to enable this.
- A new setting for allowing auto off-hook call control has been added, allowing the IP-DECT Server administrator to disallow the usage of auto offhook / intercom calls. This is controlled by the "Allow automatic offhook" setting in the "Configuration->SIP" menu and is disabled by default.
- Keepalive of UDP connection is now supported by the IP-DECT servers by sending SIP OPTIONS messages - this is configured with the "NAT keepalive" setting in the "Configuration->SIP" menu.
- The NAT keepalive interval can now be configured with the "NAT keepalive interval" setting in the "Configuration->SIP" menu.
- The SIP UserAgent header now includes the MAC address and firmware revision of the IP-DECT Server.
- Error messages reported during TLSDSK authentication now includes more information to help troubleshoot any issues.
- The Linux kernel has been updated to version 4.14.53.
- The list of default CA certificates has been updated to version 2018.02.24.

## Corrections

- Sometimes after transferring a call from one handset to a another handset, the user that made the transfer stay online and does not stop the call. If the IP-DECT Server received an REFER 2xx response after receiving a NOTIFY with a 2xx status in a transfer scenario, the DECT call was not correctly terminated at the end of the transfer. This addresses DECTESC-876.

- The RFPI scanner on the IP-DECT Basestation are now available again. This addresses DECTESC-885.
- Unused SIP TCP connections are now closed after 120 seconds by the IP-DECT Server.
- In a Lync / Skype for Business setup, non-REGISTER messages are now properly authenticated with TLS-DSK if required by the frontend server.
- In a Lync / Skype for Business setup, errors during TLS-DSK authentication could leave the SIP endpoint in a state where authentication was not complete. Issue is fixed
- In a Lync / Skype for Business setup a slow Location Information Server (LIS) could cause emergency location info to be missing from E911 calls.
- The IP-DECT Servers have improved interoperability with third party handsets:
  - A CC\_ALERT message is no longer required before a CC\_CONNECT message.
  - CC\_INFO messages are now supplied to indicate that the handset should play dial / ringback tones.
  - More informational reject reasons are used during failed authentication.
  - Handsets are allowed to supply a fixed identity with a longer PLI than required.
- Short invalid data packets (i.e. packets from a port scanner) received on the port listening for connections from media resources and base stations could cause the server not to service connected media resources and base stations.

## Known limitations

- After upgrading to this firmware, it will no longer be possible to downgrade to any firmware version earlier than PCS14C.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	dect.early_encryption_rekeying	Controls DECT connection early encryption and re-keying. Values: disabled / enable / required Default: enabled
config.xml	Added	dect.subscription_window	If set, when subscriptions allowed are enable, it will automatically be disabled after 120 seconds or after a successful subscription. Values: true / false Default: true

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	sip.allow_auto_offhook	If set, SIP calls are allowed to indicate that the dialled handset should do automatic off-hook, which is used for e.g. intercom. Values: true / false Default: false

## Version PCS18Da

### Corrections

- An error that prevented the IP-DECT Server 1G9 version from properly booting was corrected.

## Version PCS18Ca

### Corrections

- Receiving a short un-encrypted RTP packet in an encrypted RTP session could cause a buffer overflow resulting in a crash of the Media Resource (DECTESC-886).
- Exporting logs or other large file retrieval from the server could fail if the client and server was not both on the same fast/local network (DECTESC-880).

## Version PCS18Ba - Q2, 2018

### Added or Changed Features

- Sorting of CSV or LDAP phonebook data was previously only done according to English characters. Sorting is now following the local language set on the server. With that in mind it is even more important now to set the language in the server if the CSV or LDAP phonebook is used.
- The G.729 low bitrate codec no longer requires purchase of a license, but is now freely available.
- The maximum number of supported clusters is now 1024.
- It is now possible to acquire a raw CSRF token from the web interface using the URI `https://<ip>/csrf_token` for use in e.g. scripting.
- It is now possible to distinguish disabled base stations and media resources from disconnected base stations and media resources.

## Corrections

- TLS algorithms without an explicit hash function (e.g. AEAD algorithms) has been disabled in TLS-DSK. This fixes TLS-DSK based authentication when the Skype for Business frontend is running on Windows Server 2016 (DECTESC-841):
- ICE candidate priorities received from the remote endpoint are no longer assumed to be unique. This works around a bug in Polycom endpoint ICE implementations causing hold/transfer menu button not to be displayed. (DECTESC-845).
- Fixed an issue where if a SUOTA attempt failed, subsequent voice calls could be randomly disconnected until the SUOTA instance completed or was cancelled (DECTESC-846).
- When connected by a slow connection or if the IP-DECT server was loaded, the internal send buffer in the base stations and media resources could overflow and cause the device to hang or become unresponsive (DECTESC-849).
- When the base station received the IP-DECT server address via DHCP, it would incorrectly show that it needed to be rebooted in the web GUI (DECTESC-851).
- A race condition between deleting a user and doing a subscription from a handset could cause the user database to create an inconsistent device entry that would prevent creating new users (DECTESC-852).
- A remote endpoint generating many reflexive peer candidates could cause the media resource to overflow an internal table and crash.
- Error reporting from the internal HTTP client has been improved.
- Fixed error in the web interface returning a 500 internal error when importing a CSV file with the same name.
- In a Cisco Unified Communication Manager environment, SRTP is now optionally supported, so that it will work in a mixed mode setting with both SRTP enabled and regular endpoints (DECTESC-836).
- When connected to a very slow or a stalled client, the web GUI could block and become unresponsive. The web GUI now disconnects such clients (DECTESC-828).

## Known limitations

- The IP-DECT server is no longer compatible with Asterisk releases earlier than 1.2.

## Configuration File Parameter Changes

## Version PCS18Aa - Q1, 2018

### Added or Changed Features

- The connection between the IP-DECT server and the base stations and media resources are now fully encrypted if both ends supports it. Optionally the encryption can be set to mandatory in the Configuration/Wireless server menu.
- When new base stations and media resources are connected to the server, they are now by default added in the disabled state to allow for better control over which devices connects to the server. This behaviour can be changed in the Configuration/Wireless server menu.
- The server web GUI now includes cross site request forgery (CSRF) protection on all pages that may cause changes to the server.
- The name of files created on the server (logs, packet capture, backups) now includes the serial number of the device and the current date and time.
- It is now possible to block user passwords and other sensitive data from being exported in files. Note: Enabling this will cause system backups to exclude the user database. Note: When enabled, it can only be disabled with a factory reset, removing all configuration and user data.

### Corrections

- User experience in regards to manually firmware update has been improved. When updating media resources and IP base stations it was previously mandatory to manually type in version and build number of the firmware. As from this firmware the information's are extracted directly from the binary image file.
- When updating server, media resources and IP base stations firmware via provisioning (media resource and IP base station requires a enhanced provisioning license) the user previously had to enter file name for all 3 firmware's (Server, media resource and IP base station). Since Spectralink recommends to use the same firmware on all devices the 3 name fields has been reduced to one (see provisioning documentation on support portal).
- DECTESC-829: The linking to the user data from the device statistics page was potentially incorrect on systems where handset sharing had previously been enabled.
- DECTESC-833, DECTESC-845: Calls between IP-DECT systems and Polycom VVX phones would sometimes be disconnected after 10 seconds due to a bug in the Polycom ICE stack. This release add a workaround on the IP-DECT server, enabled by setting sip.media.polycom\_ice\_bug\_workaround

to true in the configuration. Note: Enabling this setting may impact the compatibility with OCS/2007 endpoints.

- DECTESC-834: Users logged in via Skype for Business PIN authentication would periodically not be able to make or receive calls due to a missing refresh of the authentication token.
- DECTESC-839: Could not dial (and show) a SIP number from a phonebook retrieved from LDAP. Previously only numbers 0-9 and "+" sign was accepted in a number field. Now also a number that starts with "sip:" is accepted.
- Timing between NTP time setting and service startup has been adjusted so all timestamps in the logs should use the correct time if a NTP server is configured.
- Special SIP URI parameters are stripped off in the active call list.

### Known limitations

- The IP-DECT server is no longer compatible with Asterisk releases earlier than 1.2.

### Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	security.allow_new_rfp_as_active	Add new base stations as enabled. If not set they will have to be manually activated. Values: true / false. Default: false.
config.xml	Added	security.rfp_encryption	Require an encrypted connection with the base stations. Values: true / false Default: false Note: Not compatible with previous generation base stations.
config.xml	Added	security.allow_new_media_resource_as_active	Add new media resources as enabled. If not set they will have to be manually activated. Values: true / false Default: false
config.xml	Added	security.media_resource_encryption	Require an encrypted connection with the media resource. Values: true / false Default: false Note: Not compatible with previous generation media resources.
Config.xml	Added	security.passwords_unexportable	Remove passwords and other sensitive data from exported files. Values: true / false Default: false Note: Can only be reset by a factory reset.

## Version PCS17Ea - Q4, 2017

### Added or Changed Features

- Support handset phonebook for multiple keys search (more than one search digit). Previously the user could enter 1 digit..... wait for search to appear on display, enter another digit ..... wait for search to appear on display and so forth. As from this version the user can type multiple digits in one go and only receive a single display update with the search result. This applies to 2017 Q4 release on handset 7xx2 series.
- Support for Turkish language in 75x2, 76x2 and 77x2 handset series.
- Added support for enhanced provisioning. Previously only users, configuration and firmware for the server could be received from a provisioning server. With this new feature, it is also possible to receive firmware for Media Resource, IP base stations, handsets series 72x2, 75x2, 76x2 and 77x2. These automatic update features are in some extend also available from web-GUI. Enhanced provisioning requires a license.
- The XML-RPC endpoint\_base\_stations request now report that last connected base station for third party handsets.
- It is now possible directly to dial SIP URIs from the handset.

### Corrections

- If an incoming call is abnormally released early (e.g. before alerting), the IP-DECT server will now retry to establish the call. This addresses DESCDESC-777.
- If Music-on-Hold is enabled, it will not continue to play toward the far end during a semi-attended call transfer and not just cut off the media stream as in earlier releases. This addresses DECTESC-788.
- The SIP re-registration process has been optimized when using TLSDSK authorization.
- When a user that is created by logging in on the handset turns off the handset or is disabled from the web user interface, the user is no longer removed from the database. This addresses DECTESC-812.
- The lifetime parameter of SRTP in SDP messages is no longer added if the setting is disabled. This addresses DECTESC-817.



- Fix a race condition where a second incoming call was released from both the external endpoint and the handset at the same time, causing the IP-DECT server could drop the first call on the handset. This addresses DECTESC-749 and DECTESC-799.
- Always send the syslog server setting to the MR/RFP even if no server is set or the scope is excluding it. This allows also disabling syslog on e.g. the RFP. This addresses DECTESC-798.
- A number of cross-site scripting issues in the web user interface has been fixed.
- Base stations can now be rebooted via XML-RPC.
- It is now possible to log out from the web user interface on base stations and media resources.
- The characters ,;?/ has been added to the set of allowed characters in SIP usernames extending the allowed set to the full set specified by RFC3261.
- Fix an issue where bad network conditions when a base station connects to the IP-DECT server could cause the server to crash. This addresses DECTESC-820.
- Add a workaround for third party endpoints that do not correctly initiate ICE connectivity checks when starting to establish a call. This addresses DECTESC-809.
- Do not flood the log with the same repeated connect failure message when the internal media resource is disabled on a IP-DECT server. This addresses DECTESC-813.
- Fix an issue on the IP-DECT server 400 causing local UDP port allocation to sometimes fail. This addresses DECTESC-765, DECTESC-787, DECTESC-802, and DECTESC-803,
- Fix an issue where the sync status of base stations was incorrectly reported on redundant systems. This addresses DECTESC-792.

### Known limitations

- The IP-DECT server is no longer compatible with Asterisk releases earlier than 1.2.

## Version PCS17Da

### Corrections

- When a SIP request was resent due to authorization, the new message was sent with a random sequence number, breaking compatibility with Asterisk. The IP-DECT server did not increment the sequence number correctly.

### Known limitations

- The IP-DECT server is no longer compatible with Asterisk releases earlier than 1.2.

## Version PCS17Ca - Q3, 2017

### Added or Changed Features

- Support for new company/centralized phonebook GUI in handset. This feature requires 7xx2 handset series, and firmware PCS17J or newer. To preserve backwards compatibility old interface to company/centralized phonebook is still available.
- CUCM Device name (SEP-ID) can now be edited for users via Provisioning, CSV file import and Web GUI. If a CUCM Device name is not edited it will be automatically generated as in previous versions. If CUCM device names are edited, the editor has a responsibility to keep them unique. In addition, CUCM Device names are included in user information when exporting user XML and CSV files. This requires a Cisco Unified CM license.

### Corrections

- When changing SIP Type Of Service (in SIP configuration) the base stations was previously rebooting. Now the Change is picked up without rebooting the base stations.

### Known limitations

- The IP-DECT server is no longer compatible with Asterisk releases earlier than 1.2.

## Version PCS17Ba - Q2, 2017

### Added or Changed Features

- In addition to trusted server and username+password authentication, the IP-DECT server can now utilize phonenumber+PIN for authenticating users in a Lync/Skype for Business environment when enabled on the frontend servers and that the CertProvUrl vendor options is provided by the DHCP server.
- The TLS-DSK SIP authentication method has been added for use in setups connecting to a Lync/Skype for Business server. If TLS-DSK authentication is disabled on the frontend server, the IP-DECT server will fall back to using

NTLM authentication. Trusted server authentication continues to be available as authentication method.

- A new user administration mode has been added as an alternative to trusted server on Lync / Skype for Business installations. In this mode users are not entered into the IP-DECT web GUI, but are created by a sign-in procedure on the handsets. This relieves the IP-DECT server administrator of setting up the trusted server configuration and keeping the IP-DECT server user database synchronized to the Active Directory. To utilize this feature, both "Handset Sharing" and "Handset Login" should be enabled in the Configuration->Wireless server menu (the handset sharing license is now included in the Lync License). Users can then initiate sign-in or sign-out through MSF function 9 available from either the main menu or long-press 9 (if configured). This feature requires handset firmware PCS17H or newer.
- Lync / Skype for Business E911 support has been added. A call to a number configured as an emergency number in the Lync / Skype for Business configuration is now marked as a special high priority call. The call information sent to the Lync / Skype for Business server now includes the location of the currently connected base station if the base station IP-address/subnet is added to the Lync / Skype for Business Location Information Service database. This feature is only available when TLS-DSK authentication is used, and is thus not available when trusted server authentication is used. This feature requires handset firmware PCS17H or newer.
- The IP-DECT server and handset now uses a special ringtone and display indication when receiving an incoming call on a Lync/Skype for Business private line. This feature requires handset firmware PCS17H or newer.
- Support for SIP dialog recovery on Lync / Skype for Business has been added, allowing active calls to continue on an alternative server in case the server where the call originated is down.
- The IPDECT server now fully supports IPv6 in a Lync / Skype for Business environment, both for SIP traffic and RTP media traffic.
- When making calls through a Cisco Unified Communications Manager, the IP-DECT server and handsets now supports entering Forced Authorization Codes (FAC) and Client Matter Codes (CMC). This feature requires handset firmware PCS17H or newer.
- On Cisco Unified Communications Manager encryption of SIP traffic and RTP voice traffic is now supported with the TLS and SRTP protocols. Enabling TLS encryption requires installing a host certificate that is signed by a CA certificate installed on the CUCM.
- The IPDECT server now keeps a persistent audit log that shows system events:
  - User login / logout

- System restarts
- Configuration changes
- User modifications

This log can only be removed by a factory reset.

- The security of the IP-DECT server web GUI has been significantly updated:
  - HTTP digest authentication has been replaced with a forms and cookies based solution that now allows for storing the admin password salted and strongly hashed.
  - The IP-DECT server can be configure to enforce certain rules when changing the IP-DECT server web GUI password, the following requirements must now be met:
    - Minimum length of 8 characters
    - Must contain characters from at least two of the following classes: upper case letters, lower case letters, numbers and special characters
    - No simple or dictionary based words
    - Must be different from the last three passwords
    - Not contain more than two successive identical characters

When the strict password requirements has been enabled, they can only be disabled by a factory reset.

- After being idle for 20 minutes, the user is automatically logged out of the IP-DECT server web GUI.
- The password can be configured to expire after 30 or 90 days. Note: When this has been enabled, it can only be disabled by a factory reset.
- After five successive failed login attempts, the IP-DECT server web GUI will be locked for the next five minutes.
- HTTPS is forced by default. HTTP support can be enabled in the Configuration->Security menu (WARNING: Enabling HTTP causes passwords and other sensitive data to be transferred in clear text on the network).

Please note that downgrading to an IP-DECT server firmware earlier than PCS17Ba will reset the admin password to the default value.

- The RFPI scanner functionality that was present on earlier versions of the IP-DECT base-stations has been ported to the current version of hardware.
- The IP-DECT server handling of communication with the base-stations and media resources has been rewritten to be more robust, particularly on networks with errors and in situations with failing devices.

- When a handset that is out of range is scheduled for an update, it will now only be logged once that it is not reachable and not fill up the log with the message.
- A SIP TCP connection is now considered dead if an acknowledge packet is not received within 10 seconds after sending data on the connection. This provides for faster failover in situations where the server has become unresponsive.

The Linux kernel has been updated version 4.4.52.

Update the default CA bundle. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

## Removed Features

None

## Corrections

The device and host certificate list are no longer sorted, allowing the correct chain order to be seen.

Parsing of SIP messages that includes nested multipart bodies is now handled. This fixes an issue with handling Skype for Business response group calls (DECTESC-752).

When a SIP request was resent and a another SIP request had been sent for the same user, the resent request would contain an incorrect sequence number.

When using SRV record, only one record for a given priority was tried, even if several records was available. The server now tries all record with a given priority before moving to the next priority group.

On US DECT / 1g9 systems, the base stations would in some situations position the dummy bearer on an unavailable channel, resulting in loss of sync for any other base stations using it as sync master. The base station now only uses the allocated channels, this fixes DECTESC-761.

The timeout for retrieving system data when exporting logs has been increased to allow it to work on busy systems. This fixes an issue where files were missing in exported logs (DECTESC-778).

The previous size limit of four kilobytes on imported CA certificates has been removed.

In a Lync/Skype for Business setup, the SIP proxy discovery procedure would always use the default SIP domain name, not the specific user domain name.

If a user has no display name set, the IP-DECT server no longer adds an empty display name field to the SIP headers.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	dect.handset_sharing	Controls if handset sharing is enabled (requires license) Values: true / false. Default: false.
config.xml	Added	dect.handset_login	Controls if handset login is enabled (requires license). Values: true / false Default: false
config.xml	Added	security.strict_password	Controls if strict password quality rules are enabled. Values: true / false Default: false Note: Can only be disabled by a factory reset.
config.xml	Added	security.password_lifetime	Set how many days the web GUI password is valid. Values: 0 (forever), 30, 90 Default: 0 Note: Can only be reset by a factory reset.
Config.xml	Added	security.allow_http	Controls if unencrypted HTTP request to the web GUI are allowed. Values: true / false Default: false

## Version PCS17A - Q1, 2017

### Added or Changed Features

The Linux kernel has been updated version 4.4.32.

Update the default CA bundle. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

The product ID (P-ID) of all connected base stations are now included in exported logs.

A textual representation of the internal call control state is now included in abnormal call release log entries.

The IP-DECT server now support wildcard handset subscriptions. This allows for handset subscription out of the box without configuring the server or creating

any users, although the handsets will not be able to perform calls. This can be useful in deployment scenarios and for troubleshooting systems.

Packet error and loss statistics now also displays the total number of packets in addition to a percentage of lost/error packets.

## **Removed Features**

None

## **Corrections**

Fix issue that prevented PKCS12 formatted certificate chains that included an intermediate certificate from being imported.

Handle race condition in certain call transfer scenarios that could cause a crash in the main server component, dropping all active calls. This addresses DECTESC-739.

Ignore DECT CC\_INFO messages only containing ignored proprietary element, which would otherwise result in the call getting dropped shortly after setup. This addresses DECTESC-744.

When doing Lync / Skype for Business bandwidth allocation, fail the allocation if either the RTP or RTCP allocation fails. Previously a call would be allowed even if only RTCP bandwidth was available.

During a Lync / Skype for Business bandwidth allocation for TCP media connections, use the server reflexive candidate of the remote endpoint if no host candidate is available.

## **Configuration File Parameter Changes**

None

# ***Version PCS16F\_ - Q4, 2016***

## **Added or Changed Features**

The Linux kernel has been updated version 4.4.18.

Update the default CA bundle. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

The UDP port range used for the RTP traffic between the base stations and the media resources can now be configured. The default is to use the 57000-57511 range.

TOS/DiffServ values can be configured for PTP packets used for LAN sync.

The rfps.xml file now includes a full neighbour table with RSSI and offset values for each basestation within range.

A lot of LAN sync diagnostic values has been added to rfps.xml:

delay\_min: The minimal delay in ns between the master and slave over the last 1 minute interval.

delay\_max: The maximal delay in ns between the master and slave over the last 1 minute interval.

delay\_avg: The average delay in ns between the master and slave over the last 1 minute interval.

delay\_dev: The standard deviation in ns of the delay between the master and slave over the last 1 minute interval.

longterm\_delay\_dev\_max: The maximal standard deviation in ns of the delay between the master and slave since startup.

lucky\_rate: The ratio of packets useable for the sync algorithm over the last 1 minute interval.

longterm\_delay\_min: The minimal delay in ns between the master and slave since startup.

longterm\_delay\_max: The maximal delay in ns between the master and slave since startup.

longterm\_delay\_avg: The average delay in ns between the master and slave since startup.

longterm\_delay\_dev: The standard deviation in ns of the delay between the master and slave since startup.

longterm\_lucky\_rate: The ratio of packets useable for the sync algorithm since startup.

rate\_correction: The applied frequency correction in parts per billion.

rate\_dev: The standard deviation of the frequency correction in parts per billion.

offset\_dev: The standard deviation of the estimated offset to the LAN sync master in ns.

The LAN sync regulation algorithms have been tuned to work better in network environments with jitter.

When LAN sync loses sync with the master base stations, it is no longer reset if the base station has any active sessions, but will postpone the reset until it is idle. While the base station is out of sync, it will refuse any new connections until either the LAN sync recovers or the base station is reset.



## Removed Features

None

## Corrections

Fix issue in Lync / Skype for Business environments where RTP and RTCP in some situation could select different networks paths to the remote endpoint.

The sign of the first ulaw codepoint was incorrect.

Fix issue where hanging system component would prevent a log export from completing.

Avoid race condition between finalizing media setup and receive an re-invite message with a replaces header that would cause the call to drop. This addresses DECTESC-729.

Fix error that caused the user interface to crash when starting a packet capture with only decrypted SIPS selected.

Lync / Skype for Business usernames containing '&' are now supported.

The base station sync loop detection now assumes that base stations in different clusters can not form a sync loop.

## Configuration File Parameter Changes

None

## *Version PCS16E\_*

This was a unreleased version containing no user visible changes.

## *Version PCS16D\_ - Q3, 2016*

## Added or Changed Features

The Linux kernel has been updated version 4.4.11.

Update the default CA bundle. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

## Removed Features

None

## **Corrections**

Fix issue in Lync / Skype for Business environments with latest cumulative updates installed and bandwidth control enabled, where outgoing calls in some situations would have one-way audio. This addresses DECTESC-708.

Do not include host type passive TCP candidates in list of offered ICE candidates on Lync / Skype for Business. This fixes an issue that would prevent media from using TCP as the transport when traversing a firewall.

Fix issue that would cause early media to be ignored when present in a transferred call.

## **Configuration File Parameter Changes**

None

## ***Version PCS16C\_ - May, 2016***

### **Added or Changed Features**

None

### **Known limitations**

None

### **Corrections**

Improved selection of channel for dummy bearer in DECT 6.0 (1G9) systems.

## ***Version PCS16B\_ - Q2, 2016***

### **Added or Changed Features**

None

### **Removed Features**

None

### **Corrections**

Improved detection of other systems and own bases, thereby enhancing the handsets ability to discover the base station in handover situations.

## Version PCS16A\_ - Q2, 2016

### Added or Changed Features

Lync Quality of Experience (QoE) reporting. This feature enables advanced monitoring and reporting of a large number of metrics and information about the media quality, device types, participants etc. involved in calls.

Add `endpoint_partial_clear` function to XML-RPC interface. The function is used to clear messaging and calling lists in the handset.

PP7 generation handset part numbers are recognized in the user interface.

Lync DNS based auto discovery of the frontend server / pool. This changed the DNS procedures to be more like the Microsoft client, allowing for easier integration into a Lync environment.

Streaming packet capture and log download. This allows for capturing packets and logging system events for long periods of time as it is no longer stored on the server but downloaded directly in the browser.

The default maximum length of MSF messages has been increased from 72 to 180 characters and the default maximum callback number length has been increased from 24 to 64 characters. The old maximum lengths will be used if the setting `dect.allow_long_messages` is set to false.

The legacy KWS600v3 MSF protocol is now disabled by default. It can be enabled from the Wireless Server configuration page.

When Lync is enabled an Accept-Language header will be added to outgoing INVITE messages, allowing remote endpoints like voicemail and IVR to select which language to use. The value sent is controlled by the Phone Language setting.

The SIP registration and re-registrations time interval now includes a random portion to help reduce the load of a server after restarts etc.

### Removed Features

None

### Corrections

Fix one-way audio issues when connecting to certain PSTN gateways in a Lync environment and RTP encryption is enabled. This addresses DECTESC-666 and DECTESC-676.

Fix LAN sync support when using UDP as transport. This addresses DECTESC-652.

The LAN sync adjustment algorithm parameters have been adjusted to allow it to work on a larger range of switches.

Eliminate blocking when setting up a TLS connection.

Remove buffer overflow when receiving very large DNS results.

Eliminate memory leak when a SIP redirect loop is detected.

Eliminate memory leak when the SNMP ipDectAbnormalReleaseTotal counter is requested.

Do not generate a new Cisco Unified CallManager SEP number when changing the username of a user is changed.

Only handle registration-notify events in SIP NOTIFY messages when Lync is enabled as other SIP registrars has been observed sending these events in a format not understood by the Wireless Server.

## Configuration File Parameter Changes

None

## Known Issues

After upgrading to PCS16A\_\_, it is no longer possible to downgrade to PCS15\_\_ or earlier. As a workaround, first do a downgrade to PCS16\_\_ and then to the desired version.

## Version PCS16\_\_ - Q1, 2016

### Added or Changed Features

The IP-DECT Server is now able to join calls into a bridged ad hoc conference on Cisco Unified Communications Manager.

The feature is available when two calls are active on the handset and is invoked by selecting "Join in conference" from the call Options menu. When the conference is established further participants can be added by adding a new call and joining it into the conference.

Ad hoc conference requires the newest handset platform and is supported on Spectralink 7522, 7532, 7622, 7642, 7722 and 7742 handsets. It is not supported on the 7480, Butterfly, 7202 and 7212 handsets. Furthermore, the "Cisco Unified CM Enhanced features" license is required.

Automatic Lync presence bootstrapping is now supported.

Lync requires bootstrapping of presence for a user in order for a device to be able to publish presence. In previous releases of the firmware automatic bootstrapping was not supported and the administrator had to issue Power Shell commands or login with a Lync client in order to enable presence. Starting with this release the IP-DECT Server will automatically perform this bootstrapping and no manual steps have to be taken in order to activate presence.

The corporate phonebook now supports LDAPS for secure communication with a corporate directory. This is utilized by configuring a ldaps:// URI in the phonebook configuration.

The IP-DECT Server now supports internal/external ring-patterns on Cisco Unified Communications Manager. CUCM supports using specific Alert-Info headers to indicate whether a call is internal or external. These headers are now parsed and recognized by the IP-DECT Server. Spectralink handsets have two variants of each ring-pattern making it possible to hear whether a call is internal or external. The symbol for an incoming call will also reflect whether the call is internal or external.

DECT dummy bearer handling has been improved in the base stations.

The radio is now faster to find the best DECT channel for the dummy bearer when the dummy bearer is moved. This reduces the chance that handsets or base stations that uses dummy bearer for synchronization will lose the signal.

For LAN based synchronization require that the delay in both directions is low before using packets for sync. Otherwise the system might end up in a loop with increasing skew that cannot be corrected. This addresses DECTESC-639 and improves the stability of the LAN based synchronization.

Restart PTP sync algorithm if not in sync after 2000 sync cycles. This addresses DECTESC-639 and improves the stability of the LAN based synchronization.

Let the transmission of early RTP be controlled by the peer ICE status and not the session ICE status.

This makes the media resource transmit early RTP for outgoing calls to non-ICE peers even if the global ICE setting is enabled. This is required in order to punch a hole to receive early media through a NAT/firewall.

Keep the base station radio active for about three minutes when the connection to the IP-DECT Server(s) is lost.

This increases the availability of the system because minor server connection interruptions and server reboots will not tear down the synchronization and the handsets will not lose their DECT signal.

The handling of SUBSCRIBE NOTIFY signalling has been improved when connected to a Microsoft Lync server.

The IP-DECT Server now allows Lync to piggyback the first NOTIFY with the 200 OK for SUBSCRIBE.

Furthermore the BENOTIFY request is now supported. BENOTIFY is best-effort NOTIFY, which is a NOTIFY that is sent without a transaction and which does not require a response.

Both improves scalability as the amount of signalling required is reduced.

The handling of SIP registrations has been improved when connected to a Microsoft Lync. The IP-DECT Server now supports Lync keepalive signalling. When SIP registrations are sent from the IP-DECT Server it indicates to Lync that it supports Lync keepalive, and extracts the keepalive timeout from the register response and sends keepalive signals at the rate specified by Lync. Also, when a REGISTER is sent to Lync the IP DECT Server will omit the "Expires" header from the REGISTER because Microsoft recommends that. When Lync keepalive is used the re-register period is increased from 900 seconds to 7200 seconds by the Lync server. However, the IP-DECT Server

still has a default re-register period of 3600 seconds, which will be used unless configured otherwise.

Change the SIP signalling with Cisco Unified Communications Manager to be more like the Cisco SIP Phones.

This was required in order to be able to establish an ad hoc conference. The CUCM now uses remote call control and sometimes sends playonereq and statuslineupdatereq instead of standard SIP responses. This is for example the case when calling a busy user. The IP-DECT Server interprets the requests and plays a tone or displays the status text.

The IP-DECT product portfolio now uses a new library for secure communications with TLS.

Amongst other things this means that the IP-DECT products now support certificates with sha384 and ecdsa signatures.

Update the default CA bundle. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

Several open source packages included in the firmware have been updated in order to keep track with upstream development to get improvements and security fixes.

The Linux kernel has been updated from version 3.16.2 to version 4.2.3.

The RTP and STUN/TURN/ICE handling has been restructured in order to make it more correct and easier to maintain.

The handling had some issues that could cause a crash in some special situations. These issues are eliminated with this restructure.

Use SIP Warning header in the log message if a transaction fails. Cisco Unified Communications Manager puts additional error information in the Warning header. This information is now added to the log message to make debugging easier.

Improve the way media resource channels are released.

This is to eliminate the critical log message "Received session new for unused ResourceId=1", which could occur if a call was terminated while it was established. Furthermore degrade log messages from critical to error because they do not impact the overall system.

Improve the way base stations handle settings received from the IP-DECT Servers in a redundant setup.

Previously, for example changed radio synchronization settings were received by a base station but in some situations they were not activated correctly and a base station restart was required to fix it.

Add an additional SRTP SDP crypto line without MKI if MKI is enabled and update local MKI setting from remote.

This is to improve the ability to negotiate SRTP encryption with various SIP endpoints. Specifically, this enables successful negotiation with the Pidgin client when connected to Lync.

The build system used for building the firmware has been updated. Going forward firmware builds of a specific release will be generated in two different formats. A binary format available for download on the Spectralink Support portal and another format used in the production process.

## Removed Features

None

## Corrections

Provisioning is supported by IP-DECT Servers only, it is not supported by media resources and base stations. Previously this was not enforced correctly and a base station could in some cases attempt to start provisioning, which could lead to issues. This problem was reported in DECTESC-633 and is now corrected.

Set the current peer when completing ICE, this eliminates one-way audio problems in some call forking scenarios.

Fix attended transfer to unreachable or busy number for non-NG handsets.

If an attended transfer was attempted with a non-NG handset and the transfer target was unreachable or busy it was not possible to return to the original call or attempt a new transfer. This was reported in DECTESC-643.

Do not send TURN refresh requests in encapsulated in data indications.

The TURN connection was not correctly maintained when TURN was used in a non-Lync setup.

Do not use IPv4 TURN relay for IPv6.

Remove crash if MWI or presence data is deleted while pending delivery to handset.

Avoid crash if remote peer is missing an expected ICE component.

## Configuration File Parameter Changes

None

## *Version PCS15D\_ - Q4, 2015*

## Added or Changed Features

Radio/LAN Gateway functionality added.

Support for a new type of base station synchronization has been added. If configured as Radio/LAN Gateway an IP base station will use an over-the-air

synchronization as the source of synchronization and act as a LAN sync master. With this type it is possible to add a LAN synchronized segment of IP base stations to an existing synchronization chain of base stations. As an example it is now possible to augment an existing DECT Server 8000 system with digital base stations with a segment of IP base stations which use sync over LAN.

It is now possible to set the Microsoft Lync presence status using the handset. The presence status will be sent to the Lync infrastructure and will affect the status on all connected devices for the Lync user. If a manual change of status is performed on the Spectralink handsets or on the Lync Client (e.g. manually setting the status to DND) this will be reflected on the Spectralink handset with a yellow/red/green icon. An automatic change of status on the Lync Client (e.g. making a phone call) will not be reflected on the Spectralink handset.

Setting the presence status requires the newest handset platform and is supported on Spectralink 7522 handsets and on the upcoming 7532, 7622, 7642, 7722, 7742 handsets. It is not supported on the 7480, Butterfly and upcoming 7202 and 7212 handsets.

Starting with this release the server supports Software Update Over The Air for the upcoming 72 series Spectralink handsets. Older IP DECT Server firmware revisions will report bad file for a 72xx SUOTA image.

The supported G.726 codec is now advertised and displayed as AAL2-G726-32. This allows for low bandwidth consuming calls between a Lync Client and Spectralink DECT, as the Lync Client recognizes and supports this codec.

The Ms-Subnet header is now included in REGISTER messages to the Lync Server. This enables support for Location Based Routing by the Lync Server.

Improve handling of SIP transaction timeouts. The default client transaction timeout has been increased from 4000ms to 16000ms. This is to be more forgiving to SIP servers and endpoints that sometimes fail to respond quickly. The increased timeout will make the communication more robust but at the price of prolonged detection of failure. If a faster detection is required the timeout can be decreased by changing the setting Configuration|SIP|Client transaction timeout.

Starting with this Firmware the IP DECT Server will re-register earlier to make room for the increased client transaction timeouts and still maintain a valid registration to a secondary SIP server in a failover situation. The Re-register timeout now depends on the client transaction timeout.

On timeout only blacklist if SIP request is INVITE outside a dialog or REGISTER and no response is received at all. Previously the blacklisting of a SIP proxy could be too effective and blacklist a server due to a missing response from another endpoint. This was observed at an external site in a large CUCM deployment.



On registration expire and connection failure do not issue a re-register if a register is pending. Before this change a new useless REGISTER was put in the queue and send after the pending registration was finished.

Improve detection of transport errors when connecting to SIP servers. The SIP stack will now be faster to detect transport errors while connecting.

If a Spectralink external antenna is mounted it is now reported in the WEB-GUI. The Administration|Base station page will show an antenna icon in the Status column if an external antenna is mounted. Furthermore it is now possible to control the antenna configuration if a Spectralink external antenna is mounted. In the base station configuration page a combo box allows for three different configurations.

- Use internal & external antenna

This is the default setting and recommended in most cases where an external antenna is used.

- Use internal antenna only

This is mainly used for tuning deployment and can be helpful in assessing the need for an external antenna.

- Use external antenna only

This can be useful if the coverage of the internal antennas creates reflections/hotspots and you only need the coverage supplied by the external antenna.

Introduced scope of syslog settings. Currently remote syslog settings are distributed from the server if configured on the server. In this case they will override local settings. Starting with this firmware it is possible to override that and configure e.g. base stations individually. This addresses DECTESC-616.

When synchronising over-the-air the base stations now require a different multi frame number 8 times before we change our multi frame number. This adds resilience against disturbance from foreign systems.

The Administration | Base station page on the WEB GUI has been augmented with LAN sync delay and jitter columns. These columns reflect the current LAN sync delay and jitter respectively. Under normal condition the jitter should be below 1000 ns.

If two IP DECT Servers are configured for redundancy and changes are made to media-resource settings for all media resources these changes will not apply to the media resource on the redundancy peer (slave). Previously if a restart all media-resources was issued from the Master IP DECT Server this would make the slave IP DECT Server restart.

Improvements to the SIP dialog handling for the dialog event package, RFC4235, which is used by CUCM and others to monitor the endpoint call state. These improvements are to better handle creation, deletion and inconsistencies in the SIP dialog state and avoid error messages in the log.

Implement XML-RPC PP attach and detach. These handles can be utilized by an external application to detect when a handset is switched On/Off. Refer to the XML-RPC SDK for more info.

Include CUCM device name in the exported users.xml.

Avoid "Killed too old SIP transaction" when ICE completion fails and send a 488 "Not acceptable here" SIP response.

Handle spaces in the file name of a SUOTA image e.g. "Spectralink PCS15HA.bin" if the file is uploaded from the "Users" page | "Firmware Update". Previously this caused the server to report "Invalid handset firmware file". This change addresses an issue reported in DECTESC-613.

Improve handling of non-ICE calls when ICE is enabled. Re-INVITE with RTP address updates are not supported for calls with ICE. With ICE enabled the media resource did not allow address updates even though ICE was not used for the specific call. This caused the call to have one-way audio and is now fixed.

SIP MSF handling has been refactored and optimized. This is used to send Standby text updates e.g. in connection with CFU status, MWI updates etc.

Use a more efficient encoding of phase of neighbour base stations when sent from the base station to the IP DECT Server. This introduces an incompatibility that will not allow older revisions of IP DECT Server firmware to receive phase information from PCS15D\_ or newer revisions of base station firmware. The Offset column in the RSSI map available when selecting a base station in the Administration|Base stations WEB-GUI, will in this case be empty.

The internal buffers for signalling between the Radio part and the IP part of the base station have been increased to handle communication regarding LAN sync Gateway functionality.

The internal web-server in the IP DECT Server now handles the HTTP header If-Modified-Since better by responding 304 Not Modified not only when the request timestamp is older than the content timestamp (as has been the case previously) but also if timestamps are the same. This improves MoH download to media resources.

## Removed Features

None

## Corrections

If the remote end sends a Remote-Party-ID containing an invalid URI (specifically an URI without a host part which is not allowed as per RFC3261), the IP DECT server could crash. Now an invalid Remote-Party-ID header is ignored. This addresses DECTESC-621.

In a setup with redundancy and CUCM the handling of the CUCM SEP number when a new user is created has been changed. The SEP number is derived from the UUID. Previously the UUID was generated in the local database

(either Redundancy Master or Slave) and therefore not replicated until the next re-connect from the slave. Now the UUID is generated by the entity that updates the database and it is replicated correctly. This addresses DECTESC-615.

Advertise our own ms-implementation-version, not the version received from the remote peer. This addresses a connectivity issue with remote Skype for Business clients. Reported in DECTESC-611.

In a Lync configuration with Call Admission Control (CAC) enabled, the local relay address was incorrectly labelled as the local site address. Furthermore the port numbers of the remote endpoint was set to the TCP port numbers, not the UDP port numbers. This is now corrected and solves some connectivity issues with remote clients behind firewalls when CAC is enabled. Reported in DECTESC-611.

This also addresses a problem reported in DECTESC-603 with an IP-DECT Server connected to a Skype for business server. After upgrading from Lync 2013 to Skype problems were experienced with incoming calls from normal skype users (from federated external users). Incoming calls were disconnected after 10 seconds, and they did not have this issue with their Lync 2013 servers. This scenario is also fixed with this firmware.

Report LAN sync master status when changing LAN sync master without resetting sync. Previously this could result in a wrong RPN number being displayed in the WEB-GUI on the Administration | Base station Sync source column.

Avoid a buffer overflow if neighbour RPN is higher than the number of maximum supported base stations. One example of this is if an IP DECT Server 400 has a multi-cell license installed (which allows for 4 base stations) and a RPN over 4 is detected.

If a CUCM license is loaded it was correctly displayed in the loaded license list in the Administration | License page. It was however not displayed correctly in Active License Summary section of the same page and in the License information available at Status | Wireless Server. This has been corrected.

In a Redundancy setup if a non-recoverable inconsistency between Master and Slave user database was detected, the server could crash when the slave database is cleared from master. This is corrected.

When using handset sharing some log messages could report an incorrect username causing erroneous logging. As an example the username could be erroneous when logging an abnormal call release.

Correct a problem with collecting DECT frame error statistics from the handsets. The server did not collect DECT frame errors from handsets with the latest firmware. This is now corrected.

Fix multi-select Un-subscribe, which left the in-memory database inconsistent and SIP de-registered the user. Now the handset is simply DECT de-subscribed and the SIP registration is un-touched.

When updating MoH file the old file was not properly deleted. This could lead to problems when uploading a new MoH file.

Fix Music-on-Hold load on external and slave media resources. MoH did not work with external media resources.

Eliminated a number of warning/errors

Remove not important State/Event error when deleting/disabling a user.

Avoid S/E error when NG call control is received while releasing the DECT call.

Avoid S/E error on timeout when semi-attended call transfer fails.

Avoid S/E error with GAP handsets with two calls where the active call has failed.

### Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Changed	sip.client_transaction_timeout	Specifies the timeout for client transactions. This controls timer B and F as specified in RFC3261  Values: Milliseconds (1000-32000).  Default: 16000.

## Version PCS15C\_ - Q3, 2015

### Added or Changed Features

LAN based synchronization of the DECT radios is no longer in beta and is now released. A license is required in order to enable this new feature.

IMPORTANT: If the beta release of LAN based synchronization is used and this new firmware is installed the synchronization will be reverted to be radio based. Therefore it is highly recommend to load the license BEFORE upgrading the firmware.

Provide IP-DECT Server generated Music-on-Hold (MoH). This adds the ability to play music when a call is put on hold on a SIP server that does not provide MoH itself. This is for example the case with Microsoft Lync, which relies on the endpoints to generate MoH. The feature is enabled by uploading a music file to the IP-DECT Server via the web GUI at Configuration | SIP | Call status | Provide Music-on-Hold. The music file must be an 8kHz, 16-bit, mono WAV file with a maximum size of 7MB. If MoH is also provided by the SIP server the MoH provided by the IP-DECT Server might conflict and the behaviour is unpredictable.

Avoid "certificate not yet valid" errors when establishing a SIP TLS connection at boot up. Furthermore, avoid failed registrations because the TLS connection is

not yet ready. The problem occurred because the time was not set by NTP prior to the attempt to establish a TLS connection. Now TLS connection establishment and SIP registration via TLS is withheld until a valid time is obtained via NTP. This was reported in DECTESC-596 in a Microsoft Lync setup.

Faster detection of connection failure to SIP servers connected via TCP or TLS.

Some internal timers have been adjusted to reduce the time required to detect a TCP connection failure from 15-30 minutes to a little more than 100 seconds. This enables the IP-DECT Server to be faster to failover to a secondary SIP server and hence reduce the time where users cannot be contacted. This was reported in DECTESC-597 in a Microsoft Lync setup.

In the case of a Lync trusted server configuration, the IP-DECT Server now supports fail back to the primary proxy when registered with the secondary proxy. Previously the IP-DECT Server would stay with the discovered proxy server when re-registering as Lync trusted server. With regard to registration Lync behaves differently when configured for NTLM or trusted server. When configured for NTLM the client is redirected to the home server and it must keep registering towards this one. When configured for trusted server any Lync server will accept the registration and the request is routed to the home server internally within the Lync environment.

In previous firmware revisions if a hostname was configured for the IP-DECT Server (Configuration|General|Hostname (FQDN)). The IP-DECT Server would always add the configured hostname to SIP Contact and Via headers. It has been discovered that this caused problems for some SIP servers and in setups where the DNS was not properly configured. To avoid these issues the hostname is now only added if mutual TLS is used, in which case the hostname is required.

The IP-DECT Server now supports adding a ms-endpoint-location-data header to SIP INVITE in a Microsoft Lync configuration. The remote peer can utilize this to do bandwidth management according to our network location. This was reported in DECTESC-595 in a Microsoft Lync setup.

Improve handling of incoming BYE for current call while a call is waiting.

For Spectralink handsets with firmware 2015-Q3 or later start alerting with the waiting call.

For Spectralink handsets with firmware earlier than 2015-Q3 show hold screen and let resume accept the waiting call.

For GAP handsets do not update display and let the R key accept the waiting call.

Improve handling of receiving DTMF tones with SRTP enabled. When SRTP was enabled the incoming RFC2833 DTMF events affected the jitter buffer and the overall sound quality of the call could be degraded.

If redundancy of IP-DECT Servers is configured avoid that the primary server never starts up if an incompatible secondary server is trying to connect.

Previously the primary server could be kept in a startup state if an incompatible secondary server continuously tried to establish a connection.

The Random Number Generator (RNG) has been improved to increase security. Seeding of the RNG is improved.

LAN based synchronization has been improved. The sending of delay requests used for LAN based synchronization is now randomized to reduce the probability of flooding the LAN synchronization master at system start and during normal operation.

Consolidate the display of base station RPN numbers and RSSI. RPN numbers are now always shown as decimal numbers and not hexadecimal. RSSI is shown in dB and the ADC value is removed.

Update the base station status file, rfps.xml to include the firmware version of the base stations and synchronization lost/inactive values for LAN based synchronization.

Upgrade the JavaScript library that handles tables on the web GUI to the latest version. This is to get better performance and prepare for later improvements.

Correct the HTTP content type for the exported configuration. Content type text/xml is more correct and is also used when exporting the users in XML format.

Make create user and device buttons on the web GUI be enabled/disabled by the licensed number of users and not the maximum number of users of the IP-DECT Server.

Correct the endianness of the port number send from the IP-DECT Server to the media resource when updating firmware on handsets. This change breaks handset firmware update if the media resource firmware is updated and the IP-DECT Server firmware is not updated.

Make the LDAP reader of the central phonebook more robust. If the LDAP server returned some unexpected data the central phonebook could crash.

The handling of incoming SDP media attributes for controlling media flow and call hold has been simplified in order to make the code easier to maintain.

Add more verbose logging when a response cannot be sent because the SIP transaction is unknown. This is added in order to assist with debugging problems.

Log a NOTICE message when a TCP connection used for SIP fails.

Remove a potential buffer overflow in the internal database handling. This is to avoid future backward compatibility problems when increasing the record size in the internal databases.

Update the default CA bundle. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

## Removed Features

None

## Corrections

Fix Call Admission Control issues with Microsoft Lync. The IP-DECT Server did not maintain and release TURN connections correctly and this caused it to not maintain and release reserved bandwidth correctly when CAC was enabled. This was reported in DECTESC-595 in a Microsoft Lync setup.

Correct a problem in the network driver with regard to LAN based synchronization. In some situations base stations synchronized via LAN could lose their synchronization every 2 hours and 17 minutes.

Fix a problem not removing deleted devices on the backup when data is replicated at start up. This made the databases in the primary and the backup inconsistent and could cause problems.

Correct the handling of incoming SIP UPDATE requests with SDP that modify the media flow. The media flow was not updated correctly and the RTP handling was not correct.

In some call waiting scenarios all calls were not correctly released internally, which could result in the web GUI Statistics | Active calls page displaying hanging calls. This was reported in DECTESC-593 and DECTESC-589 and has been corrected.

Fix a problem that only allowed the IP-DECT Server to load the maximum users minus one. That is 29 for IP-DECT Server 400 and 4095 for IP-DECT Server 6500. The IP-DECT Server kept crashing and a reset to default or a firmware update was required in order to make it work again. This is corrected and the numbers are now 30 and 4096.

Fix an issue with handset software update and redundancy. A release reason was not transferred correctly from the backup to the primary server and therefore an incorrect abnormal release was reported when a handset was on the backup and out of range.

Fix a problem not allowing to delete more than one handset firmware at a time from the web GUI.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	sip.music_on_hold	Used for controlling Music-on-Hold generated by the IP-DECT Server. For MoH to be generated this setting must be set to true and a WAV file must be loaded into the IP-DECT Server.

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			Values: true: Generate MoH. false: Do not generate MoH  Default: false
config.xml	Removed	sip.use_domain_names	

## Version PCS15B\_ - Q2, 2015

### Added or Changed Features

None

### Removed Features

None

### Corrections

Fixed a problem where users were not displayed in the users list on the web GUI. This was reported in DECTESC-598. An analysis of the root cause of this minor problem, revealed that the nature of the problem could potentially cause severe unpredictable behaviour of the firmware. The problem was introduced in PCS15A\_ and it is highly recommended to update the firmware of all units running PCS15A\_.

### Configuration File Parameter Changes

None

## Version PCS15A\_ - Q2, 2015

### Added or Changed Features

IMPORTANT for handset sharing. Since handset sharing was introduced with PCS14\_\_ the device database format has been changed. If the firmware is downgraded from PCS15A\_ or any newer to a firmware between PCS14\_\_ and PCS15\_\_ the device database will be erased. If a handset sharing license is loaded, and a firmware downgrade is required, make sure to create a backup before the downgrade and restore the backup after the downgrade.

The IP-DECT Server will no longer page handsets that are currently powered off. This will improve the user experience for users calling a powered off DECT



handset. Without this improvement the IP-DECT Server will page the handset for 12 seconds before giving up and returning a SIP error response. With this improvement the IP-DECT Server will immediately return a SIP error response and the caller will not need to wait for 12 seconds. This addresses various issues reported in different scenarios, e.g. on CUCM.

The IP-DECT Server can now be configured to SIP de-register the associated user, when a handset is powered off (the handset tells the server it is powered off by sending a DETACH to the server). This is controlled by a new setting "Handset power off action", available in Configuration | SIP | General. Default for this setting is to ignore the power off event and keep the registration. The handset power off state is not persisted in flash, and after a reboot the IP-DECT Server will assume that all handsets are powered on. The server will learn the state when handsets are powered off. The current known state can be viewed in the users and devices list. One use case of this setting is presence in a Microsoft Lync setup. It is now possible to set your Lync presence status to OFFLINE by turning off the DECT handset. Previously the Lync presence status would never be offline if a DECT handset was connected to your Lync account.

Record and display the activity from handsets. The IP-DECT Server will now keep track of the latest activity from handsets and display it in the users and devices list on the WEB GUI. The following activities are recorded:

Unknown: No activity with the handset has been registered since last reboot.

Location registration: Latest activity from the handset is a location registration.

Voice/data: Latest activity was a voice or data connection.

Out of range: Latest attempt to communicate with the handset failed because it was out of range.

Turned off: The handset was powered off while in the range of the system.

Add limited support for draft-liess-dispatch-alert-info-urns to determine external or internal alert tone from an incoming INVITE. This was added to improve interoperability with Alcatel OXO.

Microsoft Lync ms-diagnostics header, which is added to SIP error responses by Lync, are included in log messages. This will make Lync SIP related log messages more verbose, which allows for easier debugging in Lync environments.

In the users list on the WEB GUI only display registration status red when the registration is not OK. When the registration is inactive display the status grey.

Accept 200 OK for REFER and handle unexpected REFER 2xx response correctly. Normally, REFER is accepted with a 202 Accepted response but some SIP servers send 200 OK instead. Allow this and handle other 2xx responses more gracefully. This addresses DECTESC-578 where the handset was unusable on an Alcatel OXO until a reboot after attempting a transfer.

Fix call transfer initiated while performing ICE triggered re-INVITE. When an outgoing call is established with ICE a re-INVITE is issued shortly after the call

is answered in order to complete the ICE negotiation. If a transfer was initiated while this INVITE was pending a state/event error was triggered and the call was terminated.

The quick status on the front page of the WEB GUI has been updated. The status indication is giving a quick overview of the health of the overall system.

#### SIP

- Green: All registrations are OK.
- Yellow: At least one registration is failing.
- Red: All registrations are failing.

#### Redundancy

- Green: Connection to other node is OK.
- Red: Connection to other node is failing.

#### Base stations

- Green: All enabled base stations are OK and no synchronization loops are present.
- Yellow: At least one enabled base station is failing or synchronization loops are present.
- Red: All enabled base stations are failing.

#### Media resources

- Green: All enabled media resources are OK.
- Yellow: At least one enabled media resource is failing.
- Red: All enabled media resources are failing.

#### Provisioning

- Green: Provisioning is active and OK.
- Red: Provisioning is active but failing.
- Grey: Provisioning is not active.

#### NTP

- Green: NTP is active and OK.
- Red: NTP is active but failing.
- Grey: NTP is not active.

Update the default CA bundle to Mozilla 2015-02-19. This updates the list of Certificate Authorities known by the IP-DECT Server, which ensures that the system knows new ones and insecure ones are removed.

For SIP over UDP decrease the re-transmission rate when a 100 Trying is received for non-INVITE client transactions. This reduces the amount of re-transmissions and is more standards compliant.

The XML-RPC function `endpoint_heartbeat_config()` has been made backwards compatible with customer applications built during the development phase.

Degrade log message about sending more than two DECT frames from INFO to DEBUG. This is likely to happen when an extra called party is send to the handset.

Add support for product name send by future handsets at DECT location registration. This information is used to display the correct handset product names in the users list on the WEB GUI.

Start handset firmware update even though no media resources are connected. This eliminates a problem where handset firmware update gets stuck at boot time. Furthermore, fix another problem that could make handset firmware update get stuck.

For incoming calls extract original called party from History-Info or Diversion header and send it to the handset. This can be used by future handsets to indicate that an incoming call is for example forwarded or a group call.

Update the library used for packet capture and improve capture when VLAN tagging is used. VLAN tagged packets are no longer captured twice as two identical packets.

Remove a state/event error if the user presses a key on the handset while an outgoing text call is being established.

Add a confirmation dialog for sign out and unsubscribe from the users list in the WEB GUI. These actions have big impact on the users and are tedious to revert and therefore a confirmation is desirable before executing the action.

Reduce writes to the internal flash when users are enabled/disabled from the users list.

Avoid error "Failed to send BYE - No dialog defined" when a call is replaced and terminated while a media session is being allocated. This has been seen on Microsoft Lync.

Reset handset specific info when the IPEI of a device is changed. Without this the IP-DECT Server displayed wrong information until the new handset made a location registration.

The build system used for building the firmware has been updated and several open source packages included in the firmware have been updated in order to keep track with upstream development to get improvements and security fixes.

## **Removed Features**

None

## **Corrections**

A problem that made the media resource crash when Call Admission Control (CAC) was enabled on Microsoft Lync has been fixed. This was introduced with PCS15\_\_.

Corrected error handling for SIP over TCP. A TCP transport error during SIP registration could completely stop registrations until rebooted.

Fix internal handset to handset messaging. This was broken in PCS15\_\_.

Complete internal media negotiation correctly for incoming calls when ICE is not used. When ICE was not used the media handling ended in an intermediate

state and this could cause crackling sound quality. This problem was introduced in PCS15\_\_.

Fix translation of Message Waiting Indication status message on handset. This addresses DECTESC-584.

Fix handling of incoming CANCEL for INVITE. The CANCEL was not correctly matched to the INVITE transaction. This made cancelling a waiting call not working if the callee was also callee in the existing call. The waiting call was not cleared at the callee and the handset kept indicating a waiting call.

When handset firmware upgrade is not possible because the handset is in a call correctly show busy status instead of "out of range".

Correct the device statistics, text setup failed column. The percentage and the failed count was incorrect. For this to work an updated handset firmware is required as well.

Parse SIP Contact header with <> in a generic parameter in a SIP URI without <>. This eliminates SIP registration problem with AVAYA Session Manager. This addresses DECTESC-559.

For handset sharing fix sign-out requested from the users list in the WEB GUI. Previously this would erroneously DECT unsubscribe the handset.

Fix a problem where SIP settings must be saved twice when Lync is enabled. This was introduced in PCS15\_\_.

Sort durations correctly in tables on the WEB GUI. Specifically, active calls duration and device call time was not sorted correctly for durations.

Do not sometimes show bogus durations in active calls list in a redundant system. The durations was calculated in such a way that the result could be wrong in redundant systems.

In a redundant system correctly show node M(aster) in the users and devices list if the slave is not connected.

Fix problem with VLAN tagging and IPv4 for base station synchronization via LAN. LAN synchronization did not work if PTP over IPv4 was used with VLAN tagging.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	sip.dect_detach_action	Used for controlling what happens with the SIP endpoint if a handset is powered off.  Values: ignore: Nothing happens. deregister: The SIP endpoint is de-registered.

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			Default: ignore

## Version PCS15\_\_ - Q1, 2015

### Added or Changed Features

The IP-DECT server now supports updating firmware on Spectralink handsets over-the-air, if this feature is supported by the handset. This drastically reduces the effort necessary to update handsets, as it is possible to update the firmware of a handset remotely, without having to physically locate and handle the handset.

Handsets can be updated individually, where an administrator individually schedules specific handsets for a firmware update. It is also possible to update handsets automatically. I.e. an administrator uploads a firmware version and all connected handsets automatically update to that firmware. When a handset with a different firmware version is encountered by the system, it will be automatically updated to the uploaded version.

It is now possible to control the base station transmit power levels from the server, if supported by the base station (power level control is only available for the newest generation IP base stations). It is only possible to reduce the power level compared to the default power level. It is e.g. not possible to increase the power level on a NA base station. Power levels can be controlled system-wide i.e. for all base stations, or individually for each base station. A system-wide level can be controlled in the WEB-GUI at Configuration|Wireless Server|System TX power. If a system-wide power level is configured, this will override any base station specific power setting. Base station specific power levels, can be configured at the individual base station configuration page (TX power setting), available through Administration|Base station. A warning is issued in the log if global system TX power control is enabled, and base stations not supporting this are active. Furthermore if base stations with a different local TX power setting configured are present and active, a warning is issued that this local setting will be overridden by the system wide setting.

STUN, TURN & ICE are now supported for efficient NAT and firewall traversal as well as IPv4/IPv6 dual stack media connectivity.

The XML-RPC application interface has added support for the `endpoint_heartbeat_config()`, `endpoint_heartbeat_res()` and `endpoint_retry_config()` functions. These functions give an application access to the heartbeat and retry configuration functionality of the 7640 and 7740 handsets. For further information refer to the XML-RPC SDK version 1.11.

Re-work of the messaging system to enable continuous maintenance and development. The messaging is used internally in the IP-DECT server (i.e. MWI

and phonebook) as well as external messaging controlled through the XML-RPC application interface.

Connection release and timer handling has been changed as part of the messaging re-work. Before, the connection in some scenarios was released immediately. Now a timer is started, and the connection is released after a short while of inactivity. This is to eliminate some race conditions, where the handset and the server release a connection at the same time. This addresses an issue reported in DECTESC-555.

The messaging system previously had a queue, to reduce the chance of flooding the base stations with incoming messaging setups. This has proven to be an unreliable solution, and the messaging applications need to implement their own throttling mechanism. The internal messaging queue has been eliminated because it adds undesired complexity.

#### Base station synchronization over LAN (beta).

In a multi-cell DECT system, the base station radios must be synchronized to each other in order to achieve the optimum handover experience, when handsets are moving around among base stations. The Spectralink IP DECT portfolio supports synchronizing base stations via the radio. With this release beta support for LAN for synchronization of the DECT radios is available.

The Spectralink LAN based synchronization has several advantages over synchronizing via the radio. The configuration is much simpler, because no synchronization chains need to be configured and maintained. The synchronization is self-healing, because the system itself can handle if any base station is failing. Finally, the system can be deployed with fewer base stations, because the base stations no longer are required to be in range of each other.

The LAN based radio synchronization is administrated centrally from the WEB-GUI of the IP-DECT Server. However, the synchronization is handled autonomously by the base stations and the server is not involved and hence, does not need to be on the same network segment.

Attention! LAN based radio synchronization is still in beta, and is not recommended for production use. LAN based synchronization requires an enterprise grade network with enterprise quality switches.

For more information on base station synchronization over LAN refer to Application Note: DECT LAN Based Radio Synchronization.

#### The user administration part of the WEB-GUI has been improved.

It is now possible to select several users (multi select) and perform the same operation on these users in one operation. Previously if an administrator wanted to e.g. disable or delete 40 specific users, it had to be done in 40 individual operations. Now it is possible to select these 40 users and disable/delete them in one operation.

Randomize base station re-connect timer and add exponential back off. The first re-connect attempt will be randomized between 1 and 21 seconds. Before this change it was always 10 seconds. Before this change, an installation with a high number of base stations, would result in a re-connect storm towards the server, which could result in a more prolonged reconnect time than necessary. In addition to the above, the IP-DECT server has been tuned to better handle new connections from a larger number of base stations.

Reset RTP session when a new peer is added. Only accept RTP packets from the last added peer. This change addresses a previously unsupported scenario reported in DECTESC-554. The issue relates to a scenario where an outgoing call from the IP-DECT Server, is forked to different endpoints, which support different levels of encryption (SRTP and RTP). When these endpoints send early media, the authorization of encrypted voice packets (SRTP) could fail, resulting in silence or noise and a log notice about RTP problems.

Allow the SSRC to change with a re-INVITE when SRTP is used. This increases interoperability because some implementations change the SSRC during a call.

Various STUN/TURN/ICE interoperability improvements. Including improved debugging info and logging of STUN/TURN/ICE problems. Furthermore the maximum number of ICE candidates is increased from 20 to 30.

Improved SIP registration handling with redundancy. All users are now re-registered on redundancy failover and fallback, in order to ensure that the registration status is correct shortly after an outage. Before this improvement, it could take some time before the registrations were correct after an outage.

When allocating a resource only add requested codecs, do not always allocate the worst case cost. Addresses DECTESC-548.

Previously a free running base station would automatically restart when the textual description was changed. This is no longer the case. Furthermore the restart indications, (\*\*\*) for the fields have been corrected.

It is now possible to provision a handset sharing pin code.

Display Device ARI on the Status|Wireless Server WEB-GUI when an Redundancy with ARI Swap License is installed. System ARI is the ARI used by the system. Device ARI is the ARI with which the unit was produced. These are different if e.g. a redundancy license is installed.

When a handset performs a location registration, the IP-DECT server will now request enlarged part number and PCS info as well as PPStatistics from the handset. These elements are proprietary for Spectralink systems, and are used to augment functionality. Additionally the IP-DECT server will send the type (DECT/IP DECT), and generation of the system to the handset. This will be utilized in the handset in the future, to only send new features to the newest generations of DECT servers. This is done to ensure that new upcoming handset features do not break backward compatibility with older generations of servers.

A Microsoft Active Directory has a Global Catalogue feature that gives access to the entire directory if an LDAP request is sent to port 3268. This can be used to

access the entire directory of an Active Directory, and is now supported by the Server. Refer to <http://technet.microsoft.com/en-us/library/cc978012.aspx> for additional information.

Avoid displaying reboot required when no setting that requires a reboot is changed. This happened when a WEB-GUI form, which contained settings that require a reboot, was saved for the first time. These false reboot required messages are now eliminated.

Microsoft Lync can report insufficient bandwidth when an outgoing call is initiated. This indication is now displayed on the handset.

Various interoperability issues discovered at the SIPit interoperability test event have been eliminated and general SIP, SRTP/RTP, ICE/STUN/TURN, and IPv6 support has been improved.

Do not use SIPS URI scheme per default when TLS is configured as transport for SIP. It is recommended to instead use the URI parameter transport=tls. The SIPS URI scheme can still be enabled via the configuration if required. Furthermore, request \_sips.\_tcp for TLS via DNS SRV even when SIPS URI scheme is not used. This is recommended practice.

Do not fall back to unencrypted RTP, when the other end offers RTP/SAVP, and the IP-DECT Server is unable to parse the crypto line in the SDP offer. Instead respond with 488 Not Acceptable Here.

Improved SRTP interoperability with regard to the lifetime parameter. Allow SRTP lifetime to differ from  $2^{31}$  and set default lifetime to  $2^{48}$ . For Microsoft Lync continue using  $2^{31}$ .

For non-ICE incoming calls send 200 OK for INVITE and complete media in parallel. This simplifies internal signalling, and the OK response will be sent earlier, reducing the overall call setup time.

Do not log an error if a zero length SIP UDP packet is received, this is legal.

Retransmit 200 OK for incoming INVITE with TCP/TLS transport. RFC3261 requires this for UDP and TCP/TLS because 200 OK for INVITE can get lost in complex proxy scenarios, even if the first proxy uses TCP/TLS. Continue to not retransmit when configured for Microsoft Lync.

Improve handling of transport errors when sending 200 OK for INVITE. Do not release the call without notifying the user, but display an error message in the handset.

When using IPv6 and IPv4 but registering via IPv4 select IPv4 for IP address in SDP.

Fix a problem with DNS where IPv6 addresses were resolved even if no IPv6 address was present. This has given strange logging in Status|Log messages.

Support for several new RFCs has been implemented.

RFC3327 "Session Initiation Protocol (SIP) Extension Header Field for Registering Non-Adjacent Contacts"



RFC3581 "An Extension to the Session Initiation Protocol (SIP) for Symmetric Response Routing"

RFC6026 - Correct Transaction Handling for 2xx Responses to Session Initiation Protocol (SIP) INVITE Requests.

The built-in packet capture feature has been improved to better capture SIP over TCP, SIP over TLS in mixed IPv4/IPv6 and SIP in fragmented UDP datagrams.

Change a NOTICE to DEBUG when a calling party no is too long and is removed

The record sizes used in the base station database and the device database have been increased to handle more information, and be prepared for future changes. The changes are backward compatible, and the server will automatically convert from the old format to the new format.

Add FQDN hint to hostname setting and rename domain to search domain.

The standard date/time format which is used in the status log on the WEB-GUI, is now also used in the exported log. I.e. 2014-09-23 16:46:48.433 instead of 23-09-2014 16:46:48.433.

The RSSI-scanner, in the "hidden" ( /maintenance ) part of the base station WEB-GUI, has been updated. It now recognizes new EIC (Equipment Installers Code) used in Spectralink DECT and IP-DECT servers in production from approximately December 2014.

## Removed Features

None

## Corrections

Re-work the SIP TCP receive buffer handling to allow larger SIP messages. The buffer is now dynamically resized and the maximum message size is increased to 256kB. Furthermore the remaining receive buffer is not discarded when a SIP message cannot be parsed. This addresses DECTESC-551 where Microsoft Lync sent very large SIP messages.

Fix a buffer overflow in XML-RPC and make the built-in HTTP server more robust to malicious clients. This addresses DECTESC-556.

In a redundant system, interchanging the IPEI of two users while the backup/slave node was disconnected could cause a crash of the backup/slave when it re-connected. This is corrected.

Improved mute detection if CRC errors are detected on the radio link. This eliminates some undesired side effects caused by changes in the mute functionality on the base station introduced in PCS14C\_. The base station will now handle mute in the case of frame errors better. This change reduces the impact frame errors will have on the audio quality, in the direction from the handset to the base station.

Properly handle a slow DNS SRV response that arrives after the SIP transaction time out. This could previously cause a crash.

Do not leak calls when several calls are received, while releasing an existing call.  
This could previously result in the active calls list showing calls which were already released.

Eliminate a log message saying "Trying to remove I/O handler on fd:-1, aborting."  
when replicating disabled RFP or MR. This was not a problem.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	dect.global_tx_power	<p>Used for controlling (reducing) the output power of all connected base stations supporting power control. Unless set to default, this will override any base station specific power setting.</p> <p>Values: 0-13            0: default (no reduction)            1: 0 dBm ( 1 mW)            2: 2 dBm ( 1.6 mW)            3: 4 dBm ( 2.5 mW)            4: 6 dBm ( 4 mW)            5: 8 dBm ( 6.3 mW)            6: 10 dBm ( 10 mW)            7: 12 dBm ( 16 mW)            8: 14 dBm ( 25 mW)            9: 16 dBm ( 40 mW)            10: 18 dBm ( 63 mW)            11: 20 dBm (100 mW)            12: 22 dBm (158 mW)            13: 24 dBm (250 mW)            Default: 0</p>
config.xml	Added	rfp.default_sync_type	<p>Default sync type for new base stations connecting to the server.</p> <p>Values:            "freerunning" The base will not synchronize on anything, it will act as a sync-over-air master.</p> <p>"radio" The base will synchronize on another base over-the-air.</p> <p>"lan" The base will synchronize over LAN.            Default: "radio"</p>
config.xml	Added	rfp.ptp.transport	The protocol transport layer used by PTP for LAN sync.

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			Values: "l2": Ethernet. "ipv4": IPv4 "ipv6": IPv6 Default: "ipv4"
config.xml	Changed	sip.use_sips_uri	Normally SIP communication on a TLS connection is using the SIPS: URI scheme. Disabling this option causes the KWS to use the SIP: URI scheme with a transport=tls parameter for TLS connections  Values: true/false Default: false
config.xml	Changed	sip.media.ice.enable	Enable the support for Interactive Connectivity Establishment (ICE) (RFC 5245)  Values: true/false Default: false
config.xml	Changed	sip.media.turn.enable	Enable the support for Traversal Using Relays around NAT (TURN) (RFC 5766)  Values: true/false Default: false
config.xml	Added	sip.media.turn.server	TURN server address.  Value: A string. Default: Empty.
config.xml	Added	sip.media.turn.username	TURN server username. If left blank, the per-user authentication username will be used.  Value: A string. Default: Empty.
config.xml	Added	sip.media.turn.password	TURN server password. If left blank, the per-user authentication password will be used.  Value: A string. Default: Empty.

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
users.xml	Added	user.pincodex	<p>The pin code used for associate a user to a handset when using handset sharing.</p> <p>Value: A string consisting of max 8 digits (0-9). Default: Empty</p>

## Version PCS14C\_ - Q4, 2014

### Added or Changed Features

Improved monitoring capabilities on radio interface.

The base station will monitor active radio connections and report frame errors in voice/data packets back to the server. This is utilized in the server to display the amount of frame errors on the individual base stations. The statistics are available in Statistics|Base Station, as well as in the exported logs. These statistics should be read with care, and some amount of frame errors should be expected. The statistics can be used to get a high level overview of the health of the installation/deployment radio-wise. If a base station has a high amount of frame errors compared to the other base stations, this can be an indication of e.g. a challenging HF-environment or potentially a base station located at the edge of the coverage area with many handsets attempting connections outside the range of normal operation for the base station.

In addition to making radio interface frame error statistics available for monitoring, an INFO message will be logged if the number of DECT frame errors detected by the base station is greater than 2% and the duration of the connection is more than 5 seconds.

```
"DECT frame errors channel:0 received:584 errors:20 3 %"
```

If the number of frame errors detected is below 2% a debug level message will be logged.

Improved monitoring capabilities on network interface.

The media handling will monitor active RTP sessions and report problems and packet loss to the server. This is utilized in the server to display the amount of RTP loss on the individual base stations and media resources. The statistics are available in Statistics|Base Station and Statistics|Media Resource, as well as in the exported logs. The statistics can be used to get a high level overview of the health of the installation IP network-wise.

In addition to RTP loss statistics available for monitoring, a notice message will be logged if the number of RTP problems is greater than 2% and the duration

of the connection is more than 5 seconds.

In addition to the above a lost packets counter is added to the current RTP statistics log message.

The statistics module has been augmented with statistics for devices. Every time a voice call is released Spectralink handsets supporting statistics, will send statistics to the server, which stores the information. The following statistics are available in the web GUI and in an exported log.

#### User

The username currently using the device. (If handset sharing is used and no user is currently signed-in to the device, the username may be empty).

#### Call time (hh:mm)

The total call time for the device (voice calls).

#### Abnormal releases

The percentage and the number of abnormal/total releases (voice calls).

#### Bearer handover cancelled

The percentage and the number of cancelled/total bearer handovers.

A bearer handover is when the handset changes channel (frequency/timeslot) but stays on the same base station. This is typically performed if the handset detects disturbances on the current channel.

#### Connection handover cancelled

The percentage and the number of cancelled/total connection handovers.

A connection handover is when the handset changes base station. This is typically performed if the handset detects a better base station than the one it is currently on.

#### Call setup failed

The percentage and the number of failed outgoing call setups. An outgoing call setup can fail for different reasons. Some examples are: If the radio connection drops while establishing the call or if the user presses on-hook/off-hook quickly.

#### Text setup failed

The percentage and the number of failed outgoing text call setups.

#### Out of coverage

The number of times and the duration in hh:mm the handset has been out of coverage.

#### Frame errors

The percentage of voice/data packets with frame errors detected while in an active radio connection.

In addition to making the device statistics available for monitoring, an information message will be logged when a call is terminated if the frame error rate is above 2 %. E.g.

```
"DECT errors reported by device, Username:1292
```

FrameErrors:4%(4235/91952) "

The user interface of the corporate phonebook has been updated and now has internationalisation support. The user interface of the corporate phonebook was previously only available in English. The Configuration|Wireless Server|Phone Language setting controls the language of text sent by the server to the handsets. Starting with this release the language of the user interface for the corporate phonebook will follow the language setting for strings sent by the server to the handsets.

Enable slide error detection in DECT S-field.

When the receiver on the base station is disturbed by an asynchronous system, the disturbance usually starts in one end of the signal, and thereafter slides in over the signal. Previously the base station only evaluated bit errors at the end of the signal. This could lead to a situation where an asynchronous system unnoticed could slide in from the beginning of the signal. Noticeable audio corruption would then be heard before the disturbance was detected at the end of the signal. To prevent this, the base station now also evaluates the beginning of the signal for bit errors. This can then be reported to the handset, for it to evaluate if a handover should be performed.

When putting a call on hold the server needs a response from the other end (being put on hold). If this response is late and a second call is being initiated before the response is received the handset would enter an undefined state and the following message would be logged:

```
LogTriggerDump("SipCall [id:####] (UserName:####)
(SipEndpointRecvNGNewInd) unexpected state endpoint:####
call:####").
```

The server now handles this situation gracefully, the handset is returned to hold state and the message is no longer logged.

The abnormal releases statistics available at Statistics|Abnormal releases has been improved. Previously a user in an entry in this list was identified by a PPID, which is an internal identifier for users. Now the actual username is presented directly in the list for easier reference. Furthermore the IP DECT Server has been seen to restart, if a HTTP connection breaks while the abnormal releases list is being retrieved, this is no longer the case.

For solicited MWI accept NOTIFY before the OK response is received for the SUBSCRIBE. This fixes an issue reported in DECTESC-541 where the MWI NOTIFY takes a different route than the OK response for the SUBSCRIBE and thereby arrives before the OK response. This breaks the exchange of MWI messages and no MWI is displayed on the handsets.

The server now supports receiving item number from handsets on location registration. It is used to determine the handset name, when users and devices are displayed. This makes it possible to identify OEM branded handsets with the OEM naming.

Base station and media resource statistics are now available on IP DECT server 400 even in a single cell configuration. Although no external base stations or media resources are present it still adds value to see the statistics for the internal ones.

Updated translation files for strings sent from the server to the handsets.

Translations have been added for "Insufficient Bandwidth" message which might be sent in a LYNC setup, when Call Admission Control (CAC) fails to allocate sufficient bandwidth.

In the web GUI the possibilities for sorting columns with empty/non-numeric/percentage values has been improved. As an example the Administration|Base Station part of the web GUI now supports sorting base stations by synchronisation source (Prim/Sec) and by synchronisation lost counter. Furthermore the synchronisation lost column has been made easier to read by using a dash as separator between absolute numbers and percentages.

Make sure to terminate an incoming call correctly by sending a "480 Temporarily Unavailable" response if a DECT error occurs while a media resource is being allocated.

RTCP handling has been improved.

RTCP lost reporting now supports negative loss, which the RFC allows.

Furthermore RTCP lost calculations now only cover current SSRC, and lost statistics and RTCP reporting is only done for a SSRC when in sync.

SIP endpoint state/event errors were previously logged with log-level critical. This was misleading as a state/event error is unexpected behaviour however not critical. Starting with this firmware they are logged with log-level error.

Fix a confusing notice message when a non-INVITE transaction fails. If the remote User-Agent/Server was unknown the message "Error received from unknown" was logged. Now the remote IP address is added to the message and "unknown" is not added to the message if the remote User-Agent/Server is unknown.

Previously state event errors like the following could be logged as a result of a scenario where the user presses a digit while a media resource is being allocated or while toggling between calls:

```
"SipEndpoint (UserName:XXXXX) (SipEndpointRecvCCInfo)
unexpected signal/SIP in state
ResourceAlloc/TwoCalls_OutgoingHold"
```

This is not an error, and the logging has been removed. This resolves DECTESC-546.

If a call is terminated while the media is being completed, the server would previously log the following error message:

```
"MR_COMPLETE_cfm received for unexpected call"
```

UserName:####.

This is not erroneous behaviour, thus the logging has been removed.

The server will no longer send SUBSCRIBE for MWI before SIP registration is successful. If a user was updated via the GUI or via provisioning the server could send a SUBSCRIBE for MWI before a successful SIP registration. This is currently not causing problems, but it is an undesired behaviour.

The linux kernel is updated from 3.14.3. to 3.16.1

The RFPI-scanner in the "hidden" ( /maintenance ) part of the base station web-GUI has been updated and now recognizes new EIC (Equipment Installers Code) used in Spectralink DECT and IP DECT servers in production from approximately June 2014

## Removed Features

None

## Corrections

Using software version 14B\_ in a setup with handset sharing, has been seen to cause an error where no more status messages e.g. voicemail, call forwarding, etc. are shown on the display of the handsets. When this error occurs the following message can be found in the log:

```
"TRIGGER MESSAGE Hashtable duplicate insert:"
```

This behaviour was reported in DECTESC-547, and has been corrected.

The Multicast TTL setting available in the Base stations part of the wireless Server configuration settings page on the WEB-GUI.(Configuration|Wireless Server|Multicast TTL) was not displayed correctly. If multicast towards base stations is used, the Multicast TTL is used to limit the propagation of multicast packets across routers. Previously the GUI would always display 0 or 1 even in the case of a TTL higher than 1, this is now corrected.

If the server is configured to only support G.711 A law media codec (Configuration|SIP|Codec priority setting), the server/media resource has been seen to become unresponsive, if it receives a G.711 u-law RTP packet even if G.711 A law has been negotiated. This was reported in DECTESC-549, and has been corrected.

A buffer overflow in connection with abnormal call release statistic for SNMP has been identified and corrected.

## Configuration File Parameter Changes

None



## Version PCS14B\_ - Q3, 2014

### Added or Changed Features

#### SNMP

Simple Network Maintenance Protocol SNMPv2c is now supported by the IP DECT portfolio. Simple Network Management Protocol (SNMP) is an "Internet-standard protocol used for monitoring devices on IP networks". To perform this monitoring, SNMP uses management systems (3rd party) and agents on the devices. The management system can be used to obtain status from the devices by polling the agents. Furthermore the agents can send "traps" to the management system, if an event has occurred on the device. SNMP agents are implemented on the newest generation of IP-DECT Servers, Base Stations and Media resources.

SNMP consists of a set of standards for network management, including an application layer protocol, a database schema, and a set of data objects. Essentially, SNMP agents expose management data on the managed systems as variables. These variables can then be queried by managing applications. The variables accessible via SNMP are organized in hierarchies. These hierarchies, and other metadata (such as type and description of the variable), are described by Management Information Bases (MIBs).

General MIBs are supported by IP-DECT servers, Media resources and base stations. These provide general information e.g. uptime, number of received/transmitted udp datagrams etc. The following MIBs are implemented on the DECT devices:

IF, IP, IP-FORWARD, TCP, EtherLike, SNMPv2, IPV6, UDP.

In addition to the general information mentioned above specific Spectralink DECT information is available on the IP-DECT server only. This information is defined in a SPECTRALINK-IPDECT MIB.

This MIB includes the following groups of information:

dectGeneralInfoGroup

Objects which provide general information about the IP-DECT server.

dectGeneralStatisticsGroup

Objects which provide general statistics about the IP-DECT server.

dectUserInfoGroup

Objects which provide information about users on the IP-DECT server.

dectRfpInfoGroup

Objects which provide information about base stations (RFP) configured on the IP-DECT server.

dectMediaResourceInfoGroup

Objects which provide information about media resources configured on the IP-DECT server.

dectNotificationsGroup

Notifications that are generated by the IP-DECT server.

SNMP along with the associated Management Information Base (MIB), encourage trap-directed notification. The SPECTRALINK-IPDECT MIB includes a number of traps also called notifications. One example of a notification is "Connection to a base station is lost" another example is "Base station lost DECT synchronization".

Refer to the SPECTRALINK-IPDECT MIB for information available via SNMP

Syslog settings are now controlled and distributed from the server. I.e. the settings on the server will override/control the settings on connected base stations and media resources. Previously if a syslog server was used, every single unit of the infra-structure needed to be configured for syslog individually, now everything can be configured in one place (at the server).

This means that the following settings will be set on the base stations and media resources controlled by the server.

- log.syslog.host
- log.syslog.port
- log.syslog.facility
- log.syslog.level

The system time and date as well as the time zone is now controlled and distributed from the server. I.e. the settings on the server will override/control the settings on connected base stations and media resources.

If handset sharing is enabled and a busy user is re-associated the behaviour was un-predictable. Now this scenario is handled gracefully. The call is terminated and the re-association is effective

When parsing SIP parameters, the server is now more forgiving with lower/upper case of some SIP parameters. This addresses DECTESC-534 where a "replaces" require was not understood from a specific Lync endpoint. This resulted in problems making a transfer from Zeacom (Lync SW based attendant console) to DECT handsets.

A second incoming call (a call waiting call) is no longer automatically accepted if the other end of the original call terminates the original call. If A and B are in a call and C calls A, A will receive a call waiting indication. Previously, in the case of B hanging up, this would automatically result in A accepting the call. This is not necessarily what A wants, thus this has been changed. Now A actively needs to accept the new call.

In an outgoing call, if a other party display name is received in a 1XX response to the outgoing INVITE, the other party display name is displayed in the handset.

As an example this means that if A calls B, the display on A will indicate the display name of B already when phone B starts ringing. Previously the display name would not be updated before the call was answered by B.

DAD (Duplicate Address Detection) has been improved. Previously DAD would only detect duplicate IP addresses if the IP address was assigned using DHCP. Now DAD will also report duplicate IP addresses in the case of a static IP address. To accomplish this, the start up sequence has been modified to wait for ethernet link before continuing.

The IP-DECT server now supports parsing a SIP Contact header with a comma in the URI. This addresses an issue reported in DECTESC-535 regarding call transfer in a Shoretel PBX environment. The scenario causing the issue is as follows:

An incoming call from a mobile phone hits a reception workgroup and makes a number of DECT handsets start alerting. The call remains unanswered and after a timeout, controlled by the Shoretel PBX, the call is automatically forwarded to a hunt group. A DECT handset, which is part of that hunt group, answers the call and attempts a consulted transfer to another phone. The above mentioned scenario failed before and is successful with the latest firmware.

The name and version string of the connected SIP Server/Registrar is now logged when available. As an example when an OK is Received for a SIP REGISTER the Server Name/User Agent string received in the OK is logged in an INFO level log message. See the following for example log messages:

```
"SIP user 2602 registered at 172.29.198.3 OpenSER (1.3.4-tls (i386/linux))"
```

```
"SIP REGISTER response 404 Not Found from:2602 to:2602  
Error received from Cisco-CUCM10.0"
```

The unit is designed to operate on a 100 Mbit full-duplex network. If the unit is deployed on e.g. a 10 Mbit network the DECT radio will drift in frequency. Although not encountered in real installations, some test lab setups involving a hub instead of a switch have been seen to operate with 10 Mbit. If the network is not 100 Mbit full-duplex mode the DECT radio will potentially drift out of the specified range, which will result in faulty behaviour. Starting with this firmware a warning will be logged if the network is not 100Mbit full-duplex.

The base station is now more resilient towards being flooded with DECT page requests from the server. The number of page requests that can be suspended has been limited. When the base station reaches 75 page requests in the suspend queue, all incoming page requests will be dropped until the queue is reduced to 30 suspended page requests.

Several minor improvements have been made to synchronization over the air.

Some log messages indicating Signal link up/down were causing confusion because some customers interpreted these as if the IP link was up/down. It is

now written as DECT signalling link up/down, to avoid confusion. Reported in DECTESC-530.

In a redundancy setup the slave did not log the reason for TCP connect failure with the master. This made debugging of failure scenarios difficult. Now the reason is logged.

Previously every time a DHCP lease was refreshed, it would result in a re-write of DNS information to the flash. Now a rewrite is only performed if the DNS information is actually changed.

A state/event error is no longer logged, if an outgoing call is put on hold while ICE is completed. This is not an error situation and should not be logged as such.

Dialog event package handling has been improved to provide more correct signalling towards e.g. Cisco Unified Call Manager.

The Linux kernel is updated to 3.14.3.

Various improvements to TCP/ICE handling. This includes more elaborate logging in failure scenarios to facilitate debugging and better handling of problematic scenarios.

Logging of media handling has been augmented, this has no impact on normal usage however it increases the possibilities for debugging media-stream related problems.

## Removed Features

None

## Corrections

If a call transfer to an entry in the phonebook was attempted on a 74-series handset, it was not successful. The signalling is now changed to allow for such a call transfer to succeed. This addresses an issue reported in DECTESC-533.

Media handling has been improved. Make sure that resources and sessions are reset when allocated. This fixes an issue introduced in PCS14A\_ which made handover and internal SRTP not work reliable. If internal SRTP was enabled some handover scenarios would result in noise in the media.

The handling of handover signalling has been improved. In very rare scenarios, with handover occurring early in the call establishment, the handover could fail potentially resulting in loss of audio. This is now handled more gracefully.

The process of subscribing handsets without requiring a specific IPEI has been improved. Previously if a SIP user was created without assigning a specific IPEI (device) and a handset attempted a subscription, the IPEI of the handset would be saved in the database even in the case of an unsuccessful subscription (e.g. if a wrong AC was entered). This resulted in the fact that any subsequent subscription attempts would require the same handset to be successful (otherwise the IPEI would not match). Now the IPEI is not stored in the case of an unsuccessful subscription.

If the IP DECT Server receives a Lync conference Notify from a Lync server, it now responds with a 481 (Call/Transaction does not exist) instead of 500 (Internal server error) if no Lync conference is present. This is more correct.

If the base station radio detects a high amount of unknown base stations, it could cause an overflow in unknown bases table, which in rare cases could result in a restart of the base station. This has been corrected.

Handling of internal timers has been improved. Previously it was not always possible to find the end of timer list in all situations. In high load scenarios this could result in restarts.

### Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	snmp.enable	<p>This enables SNMP and when enabled the device will respond to SNMP requests.</p> <p>Values: true/false Default: false</p>
config.xml	Added	snmp.community	<p>The community string used for SNMP. The device will respond to requests for this community.</p> <p>Values: a string. Default: empty</p>
config.xml	Added	snmp.traphost	<p>The host to which SNMP traps are sent.</p> <p>Values: a hostname or an IPv4/IPv6 address Default: empty</p>
config.xml	Added	snmp.trapcommunity	<p>The community used for sending traps.</p> <p>Values: a string Default: empty</p>
config.xml	Added	snmp.syslocation	<p>A descriptive text telling the physical location of the device.</p> <p>Values: a string Default: empty</p>
config.xml	Added	snmp.syscontact	<p>The textual identification of the contact person for this host, together with information about how to contact them.</p> <p>Values: a string</p>

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			Default: empty

## Version PCS14A\_ - Q2, 2014

### Added or Changed Features

IMPORTANT the default password for the WEB GUI has been changed from "ip6000" to "admin". This change has been made in order to use the same default password for all current IP DECT infrastructure components. This change has no impact if the default password has been changed or if the Configuration|Security settings have been saved, in which case the default password would have been saved to the configuration file.

Integration with Cisco Unified CM has been improved significantly. The IP-DECT Server can now be connected to the Cisco Unified CM as a known phone type instead of just being a third party SIP device. This gives handsets connected to the IP-DECT Server access to additional features not supported for third party SIP devices:

Music-On-Hold.

The handsets can put the remote party on hold with Music-On-Hold.

Call pickup.

The handsets have access to various kinds of call pickup by dialing feature codes.

Meet-Me Conferencing.

The handsets can initiate a Meet-Me based conference by dialing a feature code.

Call Forward Unconditional.

Call Forward Unconditional is controlled within the Cisco Unified CM instead of locally in the IP-DECT Server. This means that if Call Forward Unconditional is enabled from the DECT handset other devices sharing the same line in the Cisco Unified CM will also be forwarded. Similarly if Call Forward Unconditional is enabled on a shared line device it will be displayed on the DECT handset.

Furthermore, administration of many DECT handsets on a Cisco Unified CM has been improved. The IP-DECT Server now supports exporting CSV files, which can be imported directly into the Cisco Unified CM Bulk Administration.

The improved integration requires a COP file to be loaded into the Cisco Unified CM and a license to be loaded into the IP-DECT Server. Please refer to the Cisco Unified CM integration application note for further details. If no

license is loaded into the IP-DECT Server it can still be connected to the Cisco Unified CM as a third party SIP device and nothing is changed.

The tables used to display information on the WEB GUI have been improved in order to better handle many users and base stations. The improvements include a search function, allowing searching all table data for a specific string, and a sort function, allowing sorting the table data with respect to any column. Finally, a pagination function, allowing breaking down the table data into suitable page sizes is now available.

The IP DECT server now supports internationalized system messages sent to handsets. The status and error texts send from the DECT Server to the handsets are available in Danish, Dutch, English, French, German, Italian, Norwegian, Portuguese, Russian, Spanish and Swedish. This is to give a better user experience for the end users. The language can be configured on the Configuration|Wireless Server GUI page. This does neither replace - nor affect - the handset language configured locally in the phone.

The IP-DECT Server 400 and Base station now supports the mounting of an external antenna. When an external antenna is detected the base station will automatically include the external antenna in the antenna selection algorithm, and issue an INFO level log message: "External Antenna detected". If an external antenna is un-mounted the antenna selection algorithm will automatically revert to using internal antennas only, and issue an INFO level log message: "External Antenna un mounted."

Optimize the internal signaling in the IP DECT server to better handle if the SDP from the other end is received late in the call setup process for incoming calls. Typically SDP from the other end is included in the incoming INVITE. However in some PBXs/scenarios no SDP is received before the final ACK. Previously a delay in the audio setup could be experienced if the ACK was received very late. DECTESC-524 describes an issue with audio transmission starting late, after answering an incoming call on a DECT handset.

Improved handling of synchronization, the base station will not attempt a shift to secondary sync master if a secondary is not defined.

The algorithm used for synchronization over-the-air has been improved. The sync over air algorithm has been made less prone to oscillating by adding integration in the frequency adjustment feedback loop.

Slicer setting corrected to 2 bit implementing fixed/measured slicing for improved noise immunity over the coverage range.

Synch fall-over to another DECT bearer added to be more robust towards channel and sliding collision caused by foreign systems.

Improved search to find another bearer on the same base when dummy bearer is lost.

The IP DECT server WEB GUI now supports displaying the HW version, SW version, Production ID and Production date for Spectralink handsets. The same information is available in the users.xml part of a log export generated by Status|Logs|Export. The information is sent by newer handsets at subscription & location registration.

The IP DECT server will, starting with this release, accept a new incoming call while an incoming call release is pending. Before this change the IP-DECT Server would reject the new incoming call with a busy response. Now, the new call is accepted and sent to the handset, as soon as the pending release is completed. The IP-DECT Server is required to accept this signaling in order to handle Cisco Unified CM call pickup and some kinds of hunt groups. For this to work perfectly a handset firmware update is required as well. If the handset firmware is not updated the new incoming call may be reported as an abnormal call release instead of a busy.

Release LCE (lower layer) instance correctly when an incoming call is released.

The LCE instance was not released correctly when an incoming call was released and if a new call was received within a few seconds after the release, it ended as an abnormal release. This addresses DECTESC-522 where a hunt group initiates new calls to a handset shortly after the release of the previous call. In the specific use case reported, one of the users in a ring group is busy, then the ring group is being called and while the other handsets in the ring group are ringing, the busy member of the ring group terminates the call and gets (immediately) a new incoming call, as it is part of the same ring group. Previously the IP-DECT Server would respond "Temporarily not available"; now the IP-DECT server can handle the second incoming call.

Handle multiple 180 Ringing responses. In scenarios where an outgoing call is forked or forwarded multiple 180 Ringing responses may be received from different endpoints. The first ringing response was sent to the handset but any additional ringing responses were dropped. This caused the handset display not to be updated correctly. Now all ringing responses are sent to the handset and the display will be updated correctly.

Change the WEB\_GUI date display format from DD-MM-YYYY to YYYY-MM-DD.

The new format is more standardized and is less ambiguous especially for users in the US.

In some call tear-down scenarios the IP DECT server previously potentially would attempt to terminate a media session after the termination of the DECT Call using the media session. This would result in logging a "Session Free: lid (##) not in use" message with level critical. Now the IP DECT server will skip releasing the media session when it has been released by the DECT call.

Call state handling has been changed. When a SIP CANCEL request is received early in a call attempt to release the link layer with a LinkRelease instead of attempting to release the call control layer with a CCRRelease.

Make sure that STUN information sent to MR is correct if UDP or TCP parameters are missing from the Lync server. Correct handling of missing UDP or TCP address for TURN. With this change the IP DECT Server is more robust towards missing UDP or TCP parameters in STUN/TURN parameters provisioned by a LYNC server.

The IP DECT server will only accept Microsoft Lync conference invitations if they contain audio. Previously the IP-DECT Server did not check for audio in a



conference invitation before it was accepted and this caused unintended behaviour.

Show phase/offset in neighbours list. This value represents the offset between a base and the other bases (neighbours), it can see over the air. Handsets (and base stations) can compensate for measured offsets of +/- 10, thus a large offset is not necessarily a problem, however the neighbours with strongest signal strength (RSSI) should have an offset within +/- 10.

On incoming text calls ignore 0-9,\*,# to align with DECT Server 2500/8000. Before this change pressing these keys before pressing ok to accept the incoming text call would result in the release of the text call with cause 84. This is based on feedback from Connexall.

Pass R,X,O,H through before a MSF text call is accepted in order to signal what button the user pressed to release the text call. On request from Connexall. This can be used by an application to determine why a text call was released if not by pressing ok or reject (i.e. hook, etc.)

If the server does not allow using SW-G729 codec (which requires a license on the server) remove G.729 support. This addresses DECTESC-514 "KWS400 G.729 works without license"

Adapt to new time zone for Moscow. Moscow is no longer using Daylight Savings Time, and is fixed at GMT+4; this is now reflected in the time-zone string for Moscow.

Minor changes to WEB\_GUI for administering base stations. The Administration|Base station table has undergone minor layout changes and no longer displays which synchronization source is currently used for synchronization.

Respect CLI restrictions sent from Cisco Unified CM in Remote-Party-ID header. The Remote-Party-ID header has a privacy part, which can be used to control whether or not Display Name and Number should be displayed by the endpoint. If either are marked as restricted the IP-DECT server will not send them to the handset.

The IP DECT Server now supports handling SIP bodies starting with \n. Previously this was not supported and Cisco Unified CM has been seen to send SIP bodies starting with \n in connection with remote call control.

Incoming early media handling has been improved. The IP DECT server now handles a=inactive in SDP in a 1XX response.

Added a new setting to the GUI: "TCP ephemeral port in contact address". Enable this to add the TCP ephemeral port (the local TCP port of the outgoing connection) to the contact header used in outgoing SIP messages. Otherwise the local listening port is used.

Add the correct port number to the SIP contact header when configured with a local port different from 5060 or configured with endpoint separate ports enabled. Without this correction no port number was added and the default 5060 was assumed.

Delete GRUU when registration data is cleaned up. When connected to a SIP server that supports Globally Routable UA URI (GRUU) a GRUU is retrieved as part of the registration process. The GRUU should be deleted when the registration data is reset, because a new one is received on the next successful registration.

Starting with this release the IP DECT Server will support a maximum of 32 allowed peers in a forked call. Previously a maximum of 8 were supported. One use case affected by this change is an outgoing call from a DECT phone to a Lync user who has a ring group (either Team group or Delegate) that rings multiple Lync users. Previously if the group had more than 8 members and no-one answered, the call would be diverted to voicemail after some period of time and the DECT phone making the call would display "Media Failed". Now - the call is transferred successfully to voicemail as long as the number of members in the group is 32 or less. This issue was reported in DECTESC-477.

The base station will now send phase/offset to the IP DECT Server in neighbours list. This value represents the offset between a base and the other bases (neighbours) it can see over the air.

Handle XML escape characters in description when generating rfps.xml.

Do not log a notice message when "481 Call Leg/Transaction Does Not Exist" is received for BYE. This is not uncommon in transfer scenarios and is not a problem.

Degrade log message from warning to debug when the HTTP connection is lost while displaying the log. This is not uncommon and not a problem for the system.

## Removed Features

None

## Corrections

Use the correct component index when creating TCP srflx candidates and correct cleanup of srflx candidates. This resolves an issue reported in DECTESC-515 which describes a situation where it is not possible to make calls from a DECT handset to a Microsoft Lync client.

Save SRTP authentication parameter so we do not trigger a new SRTP creation on each configure. Furthermore do not create new SRTP if no parameters have changed. Before this change sequence numbers on SRTCP could get out of sync with what a Mediation server would expect, which could lead to the disconnection of calls. This resolves an issue reported in DECTESC-528. In a Microsoft Lync setup if an external user is on-hold from a DECT handset, the external party might be disconnected after 30 seconds.

Fix a bug with SIP dialog event package which is used for Busy Lamp Function (BLF) and by Cisco Unified CM. When an outgoing call was initiated the

NOTIFY dialog event was sent before the dialog was initialized and data was invalid.

When sending peer reflexive ICE candidates, add correct relative address and select correct candidate for RTCP. This resolves an issue reported in DECTESC-527 concerning Skype calls in a setup with Lync 2013 and IP-DECT server. An external Skype user calls over federation service and the call can be answered with a Lync Client or a handset on the IP DECT server. If the call is answered with the DECT device, the call would terminate after a few seconds.

If handset sharing is activated always save user access code in users file.

Previously if handset sharing was activated and a device was bound to a user, a change of the user PIN would not be persisted and the IP DECT server would revert to the old PIN after a reboot.

Reset in-memory SIP authentication data when user parameters related to authentication is changed. The authentication mechanism was not reset correctly when user data with impact on the authentication was modified. This potentially had the effect, that administrator changes did not take effect until the system was restarted, or the user was disabled and enabled again.

The startup sequence of processes during a boot has been changed. With the previous startup sequence, a firmware update could result in the unit stopping to do provisioning checks. This means the unit would need to be manually rebooted or power-cycled after the update to start the provisioning checks again. The issue exists potentially in older versions of the firmware, thus downgrading from version PCS14A\_ to a previous version might still exhibit this problem.

Previously the IP DECT Server could in some cases attempt to access TCP connection data on TCP connections which were no longer valid. This has been corrected.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	language	Specifies the language used for sending system messages to the phones. Values: da danish, de german, en english, es spanish, fr french, it italian, nl dutch, no norwegian, pt portuguese, ru russian, sv swedish. Default: en.
config.xml	Added	feature_codes.pickup.local	Specifies the feature code used for enabling call pickup on Cisco Unified CM.

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			Values: The feature code users must dial for call pickup local. Default: **3
config.xml	Added	feature_codes.pickup.group_other	Specifies the feature code used for enabling call pickup other group on Cisco Unified CM.  Values: The feature code users must dial for call pickup other group. Default: **8
config.xml	Added	feature_codes.conference.meetme	Specifies the feature code used for enabling Meet-Me Conference on Cisco Unified CM.  Values: The feature code users must dial for Meet-Me Conference. Default: **5\$
config.xml	Added	sip.tcp_contact_ephemeral_port	Enable this to add the TCP ephemeral port (the local TCP port of the outgoing connection) to the contact header used in outgoing SIP messages. Otherwise the local listening port is used. Values: true/false Default: false.

## Version PCS14\_\_ - Q1, 2014

### Added or Changed Features

The server now supports using multicast for communicating to the base stations.

This can be utilized to support up to 1024 base stations on an IP DECT Server 6500.

To enable this, configure a multicast address in Configuration|Wireless Server|Multicast address. If multicast is not enabled, the server will not allow more than 256 base stations. Furthermore, if multicast is enabled, old base stations that do not support multicast are marked as outdated.

Support for handset sharing is implemented (license required).

The traditional concept of a communication device is to have a device (phone)

assigned to a number/SIP username.

The basic concept of handset sharing is to break the link between the device and the number, and enable any number/user to sign-in to any device. Refer to separate application note describing handset sharing for additional information.

The DECT Server is now able to handle call forking to a mix of ICE and non-ICE enabled endpoints. Previously, a scenario with forking to a mix of ICE and non-ICE enabled endpoints could result in disabling ICE for the complete call. This sometimes resulted in issues with calls from DECT handsets to Lync clients. Sometimes the call would not be established, and an ERROR 500 would be displayed in the DECT handset display, when the call is answered. This issue has been seen in the field in a Microsoft Lync configuration, and was reported in DECTESC-507.

The server no longer re-transmits SIP requests when TCP or TLS is used as transport protocol. When a reliable transport is used, SIP request are not allowed to be retransmitted on timeout errors. Microsoft Lync was not able to handle these incorrect re-transmissions and spurious un-explainable errors occurred as a side-effect.

Abort a handover if the media resource fails to start handover. This aborts the handover faster and more gracefully, and allows the server to log an error if it happens.

Simplified the system backup/restore functionality. Earlier, parts of the complete backup could be restored individually. However, this could cause inconsistencies in the restored data due to interdependencies between different data such as users and DECT subscription.

The protocol for communication between the master and the slave server in a redundancy setup has been made more robust. Furthermore, there was a problem when more than 1000 users were replicated. This issue has been fixed.

If the handset and server call hold state get out of sync, it is handled gracefully, and does not result in the logging of an error. Without this correction, the handset could get stuck in a call hold state.

In the case where a media resource or a base station loses the connection to a server, the device will initiate a new connection to the server. The server will now accept a new connection from a device, before the server has detected a connection failure from the same device. This eliminates the "Already connected on socket" error, and reduces the time it takes the new connection to be ready for use.

Since ICE was introduced in the KGAP, an abnormal call release in an incoming call would be logged with "base: Unknown", until the first handover was performed. Now, the time window where an abnormal release can report an unknown base station has been reduced drastically.

Furthermore, information about which base station the current call is on is now improved. Previously, the part of the server that logs an abnormal call release did not know which base station the current call was on for any outgoing call

before digits were received. For example, any abnormal call release in an outgoing call that was initiated by pressing off-hook (overlap dialing), resulted in an abnormal call release log entry with base: Unknown.

Do not check for blacklisting for the current registrar when connected to Lync or “Send all messages to current registrar” is enabled. Some SIP servers do not support this and require a re-registration to switch to another proxy.

Re-factored handling of DECT-module.

- If a high number of connections are established, a new algorithm moves the dummy bearer to make the remaining idle slots visible to the handsets. This will make it easier for handsets to establish a new connection when many connections are already established.
- Burst Mode Controller frequency adjustment is controlled by IP CPU for higher precision.
- Re-introduced keep-alive signaling between the higher layers of the base station and the lower layers handling the DECT module (BMC ping). This is introduced as a security precaution, to ensure that the higher layers detect a failure in the lower layers as soon as possible.
- Subcell mode handling implemented. This is required preparation for handling of the upcoming external antenna option.
- The functionality for getting a RSSI map for other base stations seen in the air has been improved.

If the system kernel hangs, it now automatically reboots after 30 seconds.

The version of the linux kernel is bumped to version to 3.10.19.

The system ARI is now displayed in the List Users part of the web-gui. This way, the ARI is right at hand when subscribing handsets while monitoring progress on the List Users gui page.

When exporting users to a CSV or XML file using Users|Import/export, the users are sorted by username instead of by IPEI.

The procedure for delivering standby texts to handsets has been refactored and improved. It was previously allowed to update the standby text on the handset even in the case where an application was connected to the handset. However, this would tear down the connection between the application and the handset. As a result, changing the standby text from the GUI while the handset was in an active MSF call (e.g. corporate phonebook) meant that the server would end up in a state where it was not possible to update the standby text on the specific handset.

An IPEI is required before a SIP user registration is performed.

The free text search in the List Users part of the web-gui now supports special characters. This, for example, allows searching for a user with special characters in the display name.

Take care of duplicate RPNs when performing synchronization loop check. Previously, duplicate RPNs would confuse the loop check algorithm and potentially lead to misleading results such as the reporting of false positives.

Improved the way an address for internal RTP is selected. This avoids some connection problems in mixed IPv4/IPv6 setups.

Make sure to log at least a notice level message when the connection from the base station to the DECT server is lost.

When configuring a base station as freerunning, set primary and secondary sync to its own RPN and not 0. This is less misleading.

The packet capture no longer includes the ethernet checksum bytes at the end of the packet. This matches standard pcap file conventions.

Introduced new Equipment Manufacturer Code (0x0298), which has been used in production from (approx.) October 2013.

Cosmetic change to Spectralink web-gui theme for submenus.

## Removed Features

The Auto-create users functionality controlled by the Configuration|Wireless Server|Autocreate users setting has become obsolete and has been removed. If a handset with an unknown IPEI is to be allowed to subscribe to the system, the recommended approach is to create a SIP user without specifying an IPEI. When subscribing a handset with an unknown IPEI, it is automatically created/associated with the first available SIP user without a specified IPEI.

## Corrections

If the "force https" setting was enabled to ensure that exclusively encrypted access was available to the user interface, an unwanted side effect would occur. The export logs functionality would result in the export of empty log files. Specifically, all HTML and XML files would be empty. This issue was reported in DECTESC-500. Additionally, it was not possible to perform a central firmware upgrade of media resources and base stations from the server if "force https" was enabled on the server.

Fixed a problem where ACK send to a hostname could not be TLS validated because the hostname was reset during DNS resolution. This error was seen in some Microsoft Lync installations, when the Lync server failed to answer quickly enough.

Avoid a buffer overflow and log a notice message if more than 20 ICE candidates are received in SDP.

If the server received an excessive amount of ICE candidates in an incoming SDP message (more than 20) the server could restart. If more candidates are received than the server can handle, the remaining ICE candidates are skipped and a notice message is logged to the message log. This issue was seen in the field in a Microsoft Lync setup and was reported in DECTESC-496.

In a setup with redundancy, enabled changes to the base station synchronization settings were in some cases not replicated correctly between the master and the slave server. As a result changes to the synchronization chain would not take effect until the base stations were rebooted.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	rfp.multicast.address	Enables multicast for base station signaling and specifies the address to use. Values: A valid IPv4/IPv6 multicast address. Default: None
config.xml	Added	rfp.multicast.ttl	Specifies the TTL of multicast messages send to the base stations Values: 1-255 Default: 1 which will limit the multicast to the local LAN. The value must be increased to extend the multicast outside the LAN.
config.xml	Removed	dect.auto_create_users	If enabled, a user is automatically added to the Server when a DECT handset tries to subscribe to a DECT system. Values: true/false Default: false.

## Version PCS13F\_ - Q4, 2013

### Added or Changed Features

Previously, the attempt to correct read-errors on the internal flash, could result in the device not booting. The read-error correction has been improved to eliminate these scenarios. IMPORTANT read-errors on the internal flash may occur at some point due to wear of the flash. If the device has pre-PCS13F\_ firmware, it is unable to boot if this happens. Therefore, it is highly recommended that you update to the new firmware. If the failure scenario mentioned above occurs before the firmware is updated, the device has to be returned for repair.

The WEB-gui has been rebranded and renamed with the new Spectralink color scheme and logo.

<i>Previous model name</i>	<i>New model name</i>
KIRK Wireless Server 400	Spectralink IP-DECT Server 400
KIRK Wireless Server 6500	Spectralink IP-DECT Server 6500



<i><b>Previous model name</b></i>	<i><b>New model name</b></i>
KIRK Media Resource 6500	Spectralink IP-DECT Media Resource
KIRK IP Base Station 6500	Spectralink IP-DECT Base Station

- The KIRK/Spectralink handsets have been renamed according to the following table.

<i><b>Previous model name</b></i>	<i><b>New model name</b></i>
KIRK 4020	Spectralink 7420
KIRK 4040	Spectralink 7440
KIRK 4080	Spectralink 7480
KIRK 5020	Spectralink 7520
KIRK 5040	Spectralink 7540
KIRK 6020	Spectralink 7620
KIRK 6040	Spectralink 7640
KIRK 7010	Spectralink 7710
KIRK 7020	Spectralink 7720
KIRK 7040	Spectralink 7740
KIRK Butterfly	Spectralink Butterfly
KIRK Site Survey	Spectralink 7000 Site Survey

The integration with Microsoft Lync has been improved. Users on the IP-DECT Server now support the Microsoft Lync framework for being invited to a Lync conference. When a user is invited to a conference, the following three steps are involved:

**Step one:** When a Lync client invites a user to a conference, a special conference invitation is received by the IP-DECT Server. This is the message that goes from the “inviter” to the “invitee” giving the URI of the conference focus. The message is a special SIP INVITE request with information about the conference instead of normal Session Description Protocol content in the message body.

**Step two:** The IP-DECT Server starts a signaling session with the conference focus, which is accomplished with another INVITE with a special content type of “application/cccp+xml.” CCCP stands for Centralized Conference Control Protocol, which is the protocol Lync uses for communication with conference

server roles. Once this session is established, the Lync user is connected to the conference, but does not yet have any media sessions established. (This is the point where you can see someone in the conference roster, but the phone icon, IM icon, etc. next to their name is still grayed out.)

**Step three:** The last step is to connect to the conference media. For an audio conference, this means dialing in to the audio/video MCU. The MCU, or Multipoint Control Unit, is the Lync component that mixes media for the conference and distributes it to the participants. When connected, media flows directly to the MCU. The last step is accomplished with a normal INVITE with Session Description Protocol content used to negotiate media transmission between the Lync user and the A/V MCU. Once this signaling session is established, and media begins flowing between the Lync user and the MCU, the conference join is complete.

The implementation of TLS/SSL authentication of clients connecting to the device has been updated. The previous implementation did not handle clients that start with a SSL2/3 handshake well. This problem was identified in the field caused by Perl scripts connecting to the device for supervision purposes.

Duplicate IP addresses are now handled more gracefully. Prior to using an IP address, the device checks if the address is in use by another device. If configured for DHCP, the device declines the duplicate address and requests a new one. If configured for a static IP address with an address conflict, the device does not bring up its network interface and it thereby avoids disrupting the service of the conflicting device.

Handling of IPv6 addresses has been updated.

On the base station menu Configuration|Base Station, it is now possible to enter an IPv6 address for the IP-DECT Server to which the base station should connect to.

On the IP-DECT Server menu Administration|Base station and Administration|Media Resource, the link to a base station and a media resource can now handle an IPv6 address.

If the base station or media resource is local (located on the IP-DECT Server), the link to the loopback address in RFP and MR administration, has been removed.

The handling of Network Time Protocol (NTP) has been updated. The amount of time that can be adjusted is increased from 200 milliseconds to 1 second. Furthermore, the minimum delay for the NTP response filter is increased from 10 milliseconds to 20 milliseconds. This gives a smoother operation of the NTP handling and should reduce the number of NTP notice messages in the message log, especially in scenarios with a jittery IP connection to the NTP server.

Make the uplane handling on the base station more robust. Do not allow associating a new RTP resource, if one is already associated. Do not allow requesting an uplane, if a RTP resource cannot be allocated. Report to the IP-DECT Server if an uplane cannot be requested or connected.

The messaging handling in the IP-DECT Server has been refactored, and range checks for message text and callback numbers have been improved. The IP-DECT Server is now prepared for handling longer text messages and longer callback numbers. Furthermore, the IP-DECT Server now supports sending more information in a single DECT protocol message than before. The maximum length of callback numbers is now 64 characters (previously 24). The maximum length of MSF messages is now 180 characters (previously 72). Whether to use old or new limits is controlled by the setting `dect.allow_long_messages`. If this setting is false (default), the old limits are enforced. **WARNING** this feature is not yet supported by the handsets, thus setting `dect.allow_long_messages` to true is not recommended at this point.

During a transfer, the IP-DECT Server now sends a BYE from the transferee to the transferor after the call to the transfer target has been established. This shortens the window where the transferee is not able to handle REFERs etc. from the transfer target. The old behavior can be restored by setting `sip.send_bye_with_refer_notify=false`. This solves DECTESC-485 SIP Group overflow transfer not working. The issue was identified in an interop test with Shoretel.

The media resource sends the build number of the running firmware to the KWS in the startup message.

The base station sends the build number of the running firmware to the IP-DECT Server in the startup message.

The IP-DECT Server Web-gui now shows the build number of the firmware on IP-DECT Media Resources and IP-DECT Base Stations in the case of development/beta versions of the firmware.

The IP-DECT Server no longer responds with 400 Bad Request, when a SIP server is terminating a SIP subscription. Specifically, Microsoft Lync sometimes terminates the SIP subscription for presence, and the IP-DECT Server should respond with 200 OK. The wrong response can have caused problems in some presence scenarios.

Make remote syslog work with dynamically changed IP address. Previously, if the device changed IP address during operation, it would stop sending remote syslog messages.

The Linux kernel has been updated to version 3.9.9.

Log an error on the IP-DECT Server, if an uplane cannot be requested or connected on a base station. Earlier, this was only logged locally on the base station.

Log info message when provisioning download is started in order to ease debugging.

Make the RFP number look the same in the log messages. When referring to RFP number use `RfpNo` not `RFP`.

Make `Status|Logs` use HTML-safe formatting for log messages. Some messages might contain data which break HTML formatting. This is now escaped correctly.

Add core dumping feature and include core files in exported logs. This is strictly for debugging/developer purposes. Per default this feature is not enabled, it is controlled by config set/get debug.coredumps (true/false).

The firmware is prepared for a new license regarding the handling of repeaters on a KWS400 system.

## Removed Features

None

## Corrections

On handsets running in legacy mode (old generation user interface), the call waiting indication is now turned off correctly when the remote end cancels the call. When an incoming call waiting is pending, the display shows an indication and an audible indication is played. This indication was not correctly cleared when the remote end cancelled the incoming call.

Correct LED handling when having a primary and a secondary DECT synchronization source. When the synchronization source changed while connections were active, the LED indication was changed to idle even though it should continue indicating active. This is now corrected.

The SIP Call-ID header field uniquely identifies a particular call, or the registrations of a particular user. A Random Number Generator (RNG) is used to provide unique Call-IDs. In earlier versions, this RNG could be seeded several times, potentially compromising the uniqueness of the SIP Call-ID, which could lead to different calls/registrations having the same Call-ID.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	dect.allow_long_messages	<p>This setting controls usage of long MSF messages and long callback numbers. If this setting is false (default) the following limits are enforced. - 24 char callback number - 72 char msf messages.</p> <p>If the setting is true the following limits are enforced: - 64 char callback number - 180 char msf messages.</p> <p>WARNING use with caution. If the handsets</p>

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			do not support long callback numbers and messages, enabling this feature might cause handsets to crash. Values: true/false. Default: false.
config.xml	Added	sip.send_bye_with_refer_notify	This setting controls IP-DECT Server behavior during transfer. If the setting is true the IP-DECT Server sends a BYE from the transferee to the transferor after the call to the transfer target has been established. Values: true/false. Default: true.
config.xml	Added	debug.coredumps	This setting controls whether the device will make a core dump in the case of a process crash. This setting is for debugging/developer purposes only. Values: true/false. Default: false.

## Version PCS13Eb

### Added or Changed Features

None

### Removed Features

None

### Corrections

Increase buffers used to create XML for SERVICE requests send to Lync. This fixes a problem discovered by Microsoft during interop test. The KWS was unable to make federated calls.

When moving remaining TCP buffer also move null termination. This addresses DECTESC-480 TCP problem with Avaya. The scenario leading to this issue was related to group call on an Avaya Communication Manager (ACM).

Delete UDP connections from connection table when they are deleted. This addresses DECTESC-430 where SIP stops to work after some connection trouble between redundancy master and slave. Furthermore cleanup connection creation.

If a call is set up on an existing MAC connection, re-use the old uplane if present. Solves DECTESC-471 and DECTESC-483, DECTESC-476, DECTESC-481 and DECTESC-487 which all report about problems with losing audio after a handover.

Avoid underflow when subtracting unsigned lengths, which would cause large buffer overruns in RTP queues. One scenario which has been seen to trigger this behavior is related to changing audio-codec mid-call. This issue was reported in DECTESC-488.

Media/RTP handling has been updated. The media load scaling used to calculate the available number of free channels on a base station, did not handle the simultaneous allocation of many channels correctly.

## Configuration File Parameter Changes

None

## Version PCS13E\_ - Q3, 2013

### Added or Changed Features

Added support for IPv6. IPv4 addresses are a limited resource and the transition to IPv6 becomes more and more urgent. With this release of the firmware, the KWS is ready for the transition to IPv6.

With this release of the firmware, the KWS can communicate with all relevant services via IPv6 and IPv4. That is, the KWS can communicate with IPv6 enabled SIP servers, XML-RPC based applications and maintenance services such as DNS and NTP.

The implementation is dual stacked, and IPv6 and IPv4 can be mixed according to customer needs. If DNS names are used for services, the DNS will be used to determine the protocol to be used.

The IPv6 configuration parameters can be determined in three ways:

Stateless Address Auto Configuration (SLAAC) - where the IPv6 address and the default gateway is retrieved via router advertisements from routers.

Statefull (DHCPv6) - where the IPv6 configuration is retrieved via DHCP much like IPv4.

Static - where the IPv6 address and the default gateway is configured from the GUI of the KWS.

Improved handling of SIP server errors and failover. To improve the user experience and make the SIP communication smoother, the KWS now keeps

track of IP addresses that cannot be reached due to transport or timeout errors. This is accomplished by blacklisting IP addresses with transport or timeout errors for 30 seconds. No communication with a blacklisted IP address is attempted if an alternative (failover) address can be determined. Specifically, this addresses DECTESC-441 where the KWS was unable to register all users to the secondary SIP server because it spent too much time waiting for timeouts from the primary SIP server.

Support of changing IP address during operation. If the IP address is changed during operation either by DHCP (IPv4/IPv6) or router advertisements (IPv6), the KWS now handles this gracefully. In previous versions of the software, this caused internal inconsistencies which could lead to malfunction.

Bumped base station protocol version to 7. The base station protocol version has been bumped to support IPv6.

Changed SIP User-Agent string format to better fit RFC3261 and make Microsoft Lync client version filtering possible.

When configured for standard SIP the User-Agent string is now product/PCSrevision.

When configured for Microsoft Lync the User-Agent string is now product/major.minor.update.revision.

For example:

Standard: KWS6500/PCS13E\_3123.

Lync: KWS6500/13.5.0.43123.

This addresses DECTESC-468.

When parsing SIP Alert-Info header used for controlling internal/external ringing and auto-answer, the KWS now matches part of a string instead of the complete string.

For example, is the following now allowed:

Alert-Info: <http://www.vertical.com>;info=alert-external

This was reported in DECTESC-467 which refers to the Wave PBX 4.0.0.2780 from Vertical.

Add P-Preferred-Identity to OK response for UPDATE request when configured for Microsoft Lync. This addresses DECTESC-466 where external calls through a gateway are terminated after 30 minutes due to a failed session refresh from the gateway.

Remove P-Preferred-Identity from OK response for PRACK request when not configured for Lync.

Switch to a new DHCP client in order to support DHCPv6. The new DHCP client has more features, but is more pedantic with regard to the format of the vendor option used by the media resource and base station to retrieve the KWS address. The format understood by the old and new DHCP client is:

<vendor option=43><length><sub option=43><sub length><IP address as string>[optional NULL].

For example 2b 0b 2b 09 31 30 2e 31 2e 32 2e 33 00 for the KWS server IP address 10.1.2.3.

Add support for DHCP option 2, time offset. With this option the desired time zone can be controlled by the DHCP server. The offset in seconds is expressed as a two's complement 32-bit integer. Refer to RFC2132 for details.

Do not discard incoming SIP requests without a username in the request URI. This is correct behavior. Specifically, this makes the KWS answer correctly with a 501 Not Implemented error when a REGISTER request is received.

Change the TCP port used for communication between redundant servers to 56017. Port 58017, which previously was used for this is in the default range for media resource external RTP. The new port 56017 is in the same port range as the other TCP signaling channels.

More correct registration of the base station number (RfpNo) when an abnormal call release is logged. In some situations, the current base station is not known, and it was logged as RfpNo=0. This made RfpNo 0 take the blame for more abnormal releases than was correct. Now, the base station is logged as unknown when it is not known.

When no time zone has been configured the KWS will use UTC. Previously, the Configuration|General|Timezone in the GUI would display UTC-1 (Amsterdam,Barcelona,...) even though the timezone was unconfigured. This has been changed.

Ensure that the MAC address and UUID of the device is always handled and presented in lowercase.

During a handover with DECT encryption enabled the encryption parameters are exchanged earlier in order to make a smoother handover.

Prepare for new base station features and store more information about the base stations in the KWS base station database.

Make the protocols between the KWS and the media resource and the base station more robust. This is to reduce the probability that a problem in one of the units will cause problems in the other units.

## Removed Features

None

## Corrections

Correct handling of (S)RTP when an outgoing call is forked to a mix of endpoints using RTP and SRTP. The KWS switched correctly to SRTP but failed to switch back to RTP if the call was answered by an endpoint not using SRTP. This addresses DECTESC-444 where a call in a Microsoft Lync setup is forked to a PSTN gateway not using SRTP and some Lync clients using SRTP. If the call was answered by the gateway noise was played by the gateway.



Fix a problem where an incoming call is never completing the STUN/TURN/ICE allocation. The problem is solved by not using STUN/TURN when ICE is not used. Specifically, this addresses DECTESC-461 where an incoming call from a PSTN gateway in a Microsoft Lync setup never makes the DECT handset start alerting.

Fix a problem where the KWS released a waiting call towards the handset even though no call waiting was signaled to the handset. This resolves DECTESC-462 where a Lync team call scenario caused the handsets to generate an abnormal call release due to invalid signaling from the KWS.

Allow connections to the HTTP and XML-RPC server from clients using TLS 1.1 and newer. Without this fix, recent versions of, for example. Google Chrome failed to connect via HTTPS.

Correct check for synchronization loops when a base station is configured for auto sync. Without this correction base stations configured for auto sync. were not checked for sync. loops and undetected sync. loops could exist.  
Be aware that auto sync. is still not intended for production use and should only be used during the deployment phase.

Downgrade the library used for making packet captures because the new one sometimes skipped the first packet in a capture.

Fix a problem where the KWS failed to lookup a hostname for which it had to add the domain name in order to be able to look it up. The problem was triggered by enabling DNS SRV records for SIP.

Remove a state/event error when MR\_COMPLETE\_cfm is received for a terminated call. This could happen if a call was terminated very shortly after it was established.

Terminate call correctly if MR\_COMPLETE\_cfm returns bad status. In some situations when the media negotiation failed to complete correctly, a BYE was not sent and the remote endpoint had a hanging call.

Remove memory leaks and static code analysis problems and make the software more correct and robust.

## Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	network.ipv6.method	Specifies the method used to obtain an IPv6 configuration.  Values:  "slaac" Use router advertisements to obtain an IPv6 address.  "dhcp" Use DHCPv6 to obtain an IPv6 address.

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
			“static” Configure IPv6 address and gateway manually. “disabled” Disable IPv6 support.  Default: “disabled”
config.xml	Added	network.ipv6.ipaddr	Specify a static IPv6 address including the prefix length.  Values: <IPv6 address>/prefix Example: 3000::2/64
config.xml	Added	network.ipv6.gateway	Specify a static IPv6 gateway.  Values: <IPv6 address> Example: 3000::1

## Version PCS13B\_ - Q2, 2013

### Added or Changed Features

The KWS integration to Lync has been improved. The KWS now supports controlling the global call forward state of a Lync user. Handsets connected to Lync via the KWS are now able to manipulate the global call forward state of a Lync user, using configurable feature codes. The default feature codes are:

<i>Feature code</i>	<i>Description</i>
*21*<extension>#	Enables unconditional call forward to extension
*21*	Enables unconditional call forward to voicemail
#21#	Disables call forward

The feature codes are configurable under Configuration -> Wireless Server.

The global call forward state is reflected in the handset display by pre-pending the standby text with either [CFU] for unconditional call forward or [CFM] for call forward to voicemail.

The KWS will no longer require a NOTIFY event vnd-microsoft-roaming-self from Lync to be in a dialog. Lync will in some scenarios send a NOTIFY before the 200 OK that creates the dialog. This resolves DECTESC-440 where the KWS did not present the correct calling-party-number.

Only allow INVITE with replaces for the inactive/secondary call while SIP endpoint is in a two calls state. A strange Lync transfer scenario caused a crash because INVITE with replaces was received during a transfer.

The media handling in handover scenarios has been optimized.

During a handover the Media resource will stay on the original base station as long as media is received from it. Previously, the media resource could in some cases switch to the new base station too early, which could result in a short crackling noise during handover.

Furthermore, SRTP handling during handover has been updated. The Media resource could previously detect false replay attacks, during handover when SRTP was received from two base stations. This is no longer the case.

The firmware update process has been improved to eliminate potential firmware update problems.

Previously, the KWS would log a state/event error in some scenarios where a handset ends a call which is put on hold. This is no longer the case.

The Polycom branding and naming in the product has been removed and replaced by Spectralink. Theme handling for customizing naming and web-interface has been added.

The IP address configuration GUI has been changed. IPv4 boot protocol selection (DHCP-assigned or static IP address) is now done using a combo box instead of two radio buttons. Additionally some more tooltips have been added to network settings.

The VLAN setting has been moved from IP settings to Ethernet settings.

LED handling has been changed.

Previously, the indication LED on the KWS would be flashing green, if a voice call was active. Starting with this release, the LED flashes green if a radio connection is active, even if no voice stream is established. This makes LED indication consistent for KWS and base stations.

If the device is a Media resource, the LED flashes green if a voice stream is active on the device.

The default Certificate Authority (CA) bundle with trusted CAs has been updated.

The rfp tag in the rfps.xml file now has a description property. This way the textual description will be available in the rfps.xml file.

The conversion from handset partnumber to textual description used in the Users | List Users part of the WEB-GUI has been updated.

The new KIRK 4080 (14122802) has been added, and several ATUS part numbers have been renamed.

Tooltip for capture PCAP custom filter now tells to use PCAP filter syntax.

## Removed Features

None

## Corrections

Fixed problem with Lync presence publication. The KWS could sometimes stop publishing the presence state of a handset and consequently the Lync user could appear as always busy. The problem was caused by incorrect handling of incoming presence NOTIFY requests without state information.

The problem was reported in DECTESC-447. It was introduced in firmware PCS12C\_ as an unwanted side effect of introducing support for SBA.

Fixed problem with Statistics Abnormal Releases list, when running redundancy. Previously, the reported total did not include abnormal releases from the slave. Now the total is correct and the abnormal release list is sorted by timestamp (and not by master first, then slave). This addresses DECT-222.

Mark central phonebook update as idle when a LDAP update fails. This corrects a problem where the phonebook stopped updating after a failed LDAP access, and a reboot was required.

Previously, if a user with a username longer than 32 characters initiated a text call, this could result in a restart of the KGAP, for example, when accessing the central phonebook. This has been corrected.

Fixed a rare problem with user database replication from master to slave in a redundant setup. If usernames or IPEIs are interchanged for two users while the slave is disconnected, the slave will not be able to store the changes and responds with an error duplicate username or IPEI. This is fixed by automatically deleting the slave user database and rebooting the slave. Log a critical error if the master is unable to store data in the slave during replication at connect.

The problem was reported from the field.

Support deleting clusters when replicating from master to slave.

Eliminated an issue seen with redundancy and XML-RPC. If, for example, an XML-RPC application sent an SMS with an unknown username, and the KWS was running a redundancy setup, it would result in a restart of the KGAP.

Removed memory leak in the central phonebook when empty strings are retrieved from LDAP.

An issue with comparison of certificate validity timestamps has been addressed. This corrects a problem where the KWS claims a certificate to be expired if it expires within the current year. For example, if the current year is 2013 and the certificate expires in December 2013, the KWS will claim it expired starting from January 2013. The consequence of the bug is that the KWS will be unable to make connections via TLS for SIP or provisioning if the server presents a certificate that expires within the same year.

When a central firmware update of MR6500 was issued from a KWS, the MR6500 did not respond correctly, which resulted in the fact that MR6500 did not support central firmware update from a KWS. This is now corrected.

If a license was installed which allowed the KWS to handle more users than supported by the KWS, the number of allowed users was displayed incorrectly. This has been corrected.

### Configuration File Parameter Changes

<i>File</i>	<i>Action</i>	<i>Parameter</i>	<i>Description</i>
config.xml	Added	feature_codes.call_forward.voicemail.enable	<p>Specifies the feature code used for enabling call forward to voicemail (CFM) on Lync.</p> <p>Values: The feature code users must dial to enable call forward to voicemail.</p> <p>Default: *21*</p>

## Version PCS13\_\_\_\_

Initial KWS6500 version.